
WEAR CONTAMINATION **FLUID CONDITION** **NORMAL SEVERE SEVERE**

Machine Id

NOT GIVEN WC0925950							
Diesel Engine							
Fluid							
{not provided} (GAL)							
RECOMMENDATION	Test	UOM	Method	Limit/Abn	Current	History1	History2
We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.	Sample Number		Client Info		WC0925950		
	Sample Date		Client Info		23 Jun 2024		
	Machine Age	mls	Client Info		0		
	Oil Age	mls	Client Info		0		
	Filter Age	mls	Client Info		0		
	Oil Changed		Client Info		N/A		
	Filter Changed		Client Info		N/A		
	Sample Status				SEVERE		
WEAR	Iron	ppm	ASTM D5185m	>100	7		
All component wear rates are normal.	Chromium	ppm	ASTM D5185m	>20	<1		
	Nickel	ppm	ASTM D5185m	>4	<1		
	Titanium	ppm	ASTM D5185m		<1		
	Silver	ppm	ASTM D5185m	>3	<1		
	Aluminum	ppm	ASTM D5185m	>20	4		
	Lead	ppm	ASTM D5185m	>40	<1		
	Copper	ppm	ASTM D5185m	>330	2		
	Tin	ppm	ASTM D5185m	>15	<1		
	Vanadium	ppm	ASTM D5185m		<1		
	White Metal	scalar	*Visual	NONE	NONE		
	Yellow Metal	scalar	*Visual	NONE	NONE		
CONTAMINATION	Silicon	ppm	ASTM D5185m	>25	4		
CONTAMINATION	Potassium	ppm	ASTM D5185m		8		
There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.	Fuel	%	ASTM D3524	>5	▲ 31.7		
	Water	,-	WC Method		NEG		
	Glycol		WC Method		NEG		
	Soot %	%	*ASTM D7844	>3	0.1		
	Nitration	Abs/cm	*ASTM D7624	>20	7.5		
	Sulfation	Abs/.1mm	*ASTM D7415	>30	18.7		
	Silt	scalar	*Visual	NONE	NONE		
	Debris	scalar	*Visual	NONE	NONE		
	Sand/Dirt	scalar	*Visual	NONE	NONE		
	Appearance	scalar	*Visual	NORML	NORML		
	Odor	scalar	*Visual	NORML	NORML		
	Emulsified Water	scalar	*Visual	>0.2	NEG		
FLUID CONDITION The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.	Sodium	ppm	ASTM D5185m		0		
	Boron	ppm	ASTM D5185m		211		
	Barium	ppm	ASTM D5185m		1		
	Molybdenum	ppm	ASTM D5185m		61		
	Manganese	ppm	ASTM D5185m		<1		
	Magnesium	ppm	ASTM D5185m		301		
	Calcium	ppm	ASTM D5185m		970		
	Phosphorus	ppm	ASTM D5185m		730		
	Zinc	ppm	ASTM D5185m		888		
	Sulfur	ppm	ASTM D5185m		2244		
	Oxidation	Abs/.1mm	*ASTM D7414	>25	14.0		
	Base Number (BN)	0 0			5.4		
	Visc @ 100°C	cSt	ASTM D445		7.2		



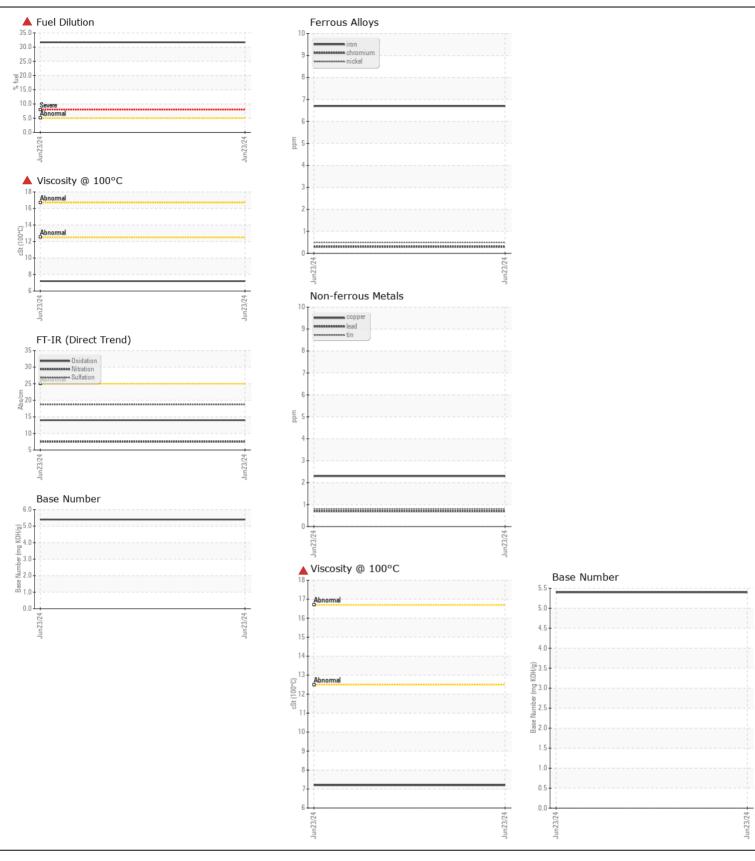

Certificate L2367

Laboratory Sample No.

: WC0925950 Lab Number : 06217890 Unique Number : 11096087

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received

Tested Diagnosed Test Package: FLEET (Additional Tests: FuelDilution, PercentFuel)

: 24 Jun 2024 : 26 Jun 2024

: 26 Jun 2024 - Wes Davis

SALEM NATIONALEASE CORPORATION 198 PARK PLAZA DRIVE WINSTON SALEM, NC US 27105

Contact: Audrey Hopkins Audrey.Hopkins@salemcorp.com T: (336)767-9642

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: x: