



OIL ANALYSIS REPORT

WEAR	NORMAL
CONTAMINATION	NORMAL
FLUID CONDITION	NORMAL

Area
DAVE DAVENPORT [6748]
Machine Id
CUMMINS 6BTA330-2800 60254308
Component
Port Diesel Engine
Fluid
{not provided} (--- GAL)

RECOMMENDATION

Resample at the next service interval to monitor.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		VPA052969	---	---
Sample Date		Client Info		28 Jun 2024	---	---
Machine Age	hrs	Client Info		1502	---	---
Oil Age	hrs	Client Info		0	---	---
Filter Age	hrs	Client Info		0	---	---
Oil Changed		Client Info		Not Changd	---	---
Filter Changed		Client Info		Not Changd	---	---
Sample Status				NORMAL	---	---

WEAR

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>90	20	---	---
Chromium	ppm	ASTM D5185m	>20	<1	---	---
Nickel	ppm	ASTM D5185m	>2	<1	---	---
Titanium	ppm	ASTM D5185m	>2	<1	---	---
Silver	ppm	ASTM D5185m	>2	<1	---	---
Aluminum	ppm	ASTM D5185m	>20	3	---	---
Lead	ppm	ASTM D5185m	>40	<1	---	---
Copper	ppm	ASTM D5185m	>330	3	---	---
Tin	ppm	ASTM D5185m	>15	<1	---	---
Vanadium	ppm	ASTM D5185m		<1	---	---
White Metal	scalar	*Visual	NONE	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	NONE	---	---

CONTAMINATION













There is no indication of any contamination in the oil.

Silicon	ppm	ASTM D5185m	>25	6	---	---
Potassium	ppm	ASTM D5185m	>20	4	---	---
Fuel		WC Method	>3.0	<1.0	---	---
Water		WC Method	>0.2	NEG	---	---
Glycol		WC Method		NEG	---	---
Soot %	%	*ASTM D7844	>6	0.2	---	---
Nitration	Abs/cm	*ASTM D7624	>20	8.6	---	---
Sulfation	Abs/.1mm	*ASTM D7415	>30	21.0	---	---
Silt	scalar	*Visual	NONE	NONE	---	---
Debris	scalar	*Visual	NONE	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	NONE	---	---
Appearance	scalar	*Visual	NORML	NORML	---	---
Odor	scalar	*Visual	NORML	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	NEG	---	---

FLUID CONDITION

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

Sodium	ppm	ASTM D5185m		2	---	---
Boron	ppm	ASTM D5185m		260	---	---
Barium	ppm	ASTM D5185m		<1	---	---
Molybdenum	ppm	ASTM D5185m		88	---	---
Manganese	ppm	ASTM D5185m		<1	---	---
Magnesium	ppm	ASTM D5185m		634	---	---
Calcium	ppm	ASTM D5185m		1487	---	---
Phosphorus	ppm	ASTM D5185m		672	---	---
Zinc	ppm	ASTM D5185m		808	---	---
Sulfur	ppm	ASTM D5185m		2272	---	---
Oxidation	Abs/.1mm	*ASTM D7414	>25	16.2	---	---
Base Number (BN)	mg KOH/g	ASTM D2896		8.3	---	---
Visc @ 100°C	cSt	ASTM D445		13.3	---	---

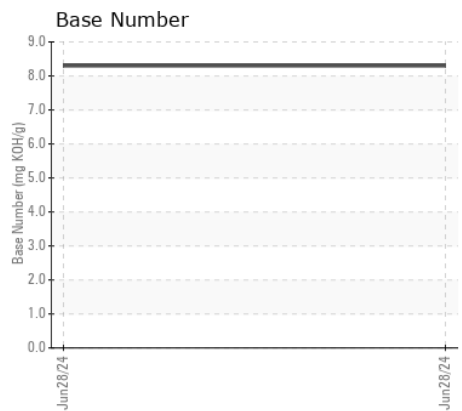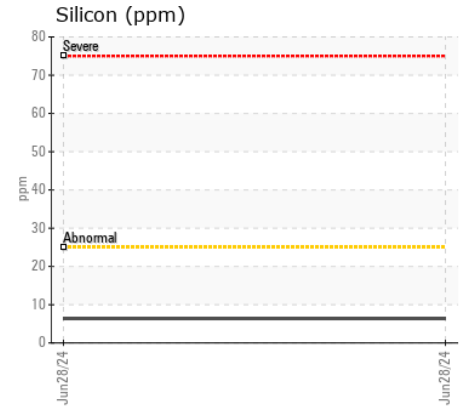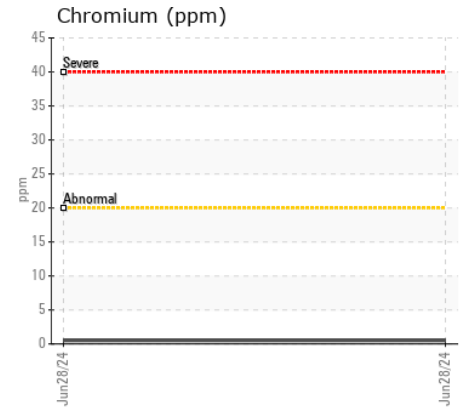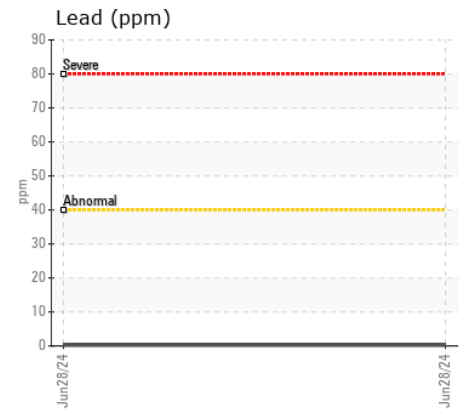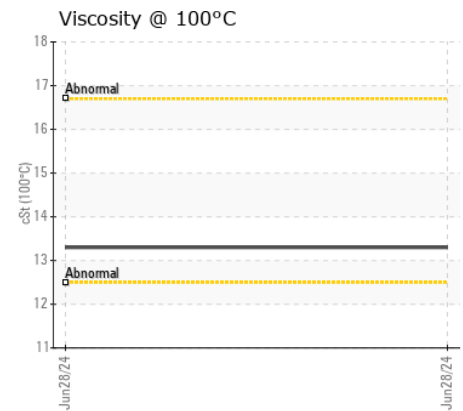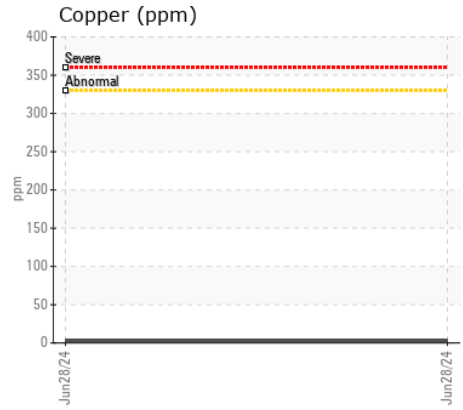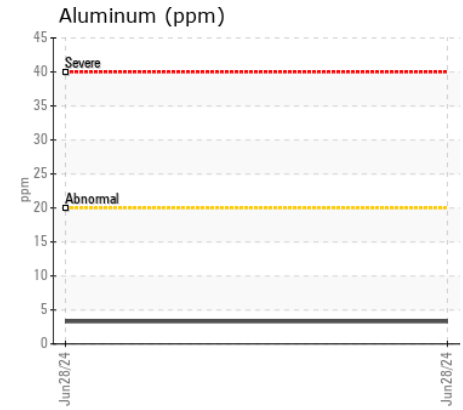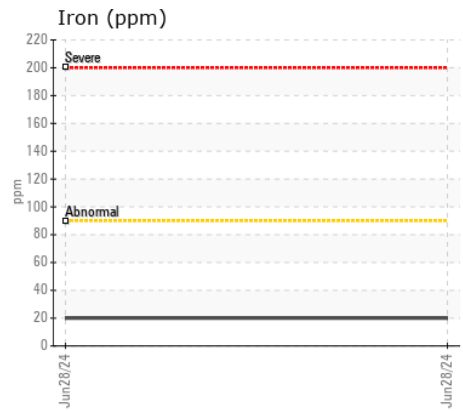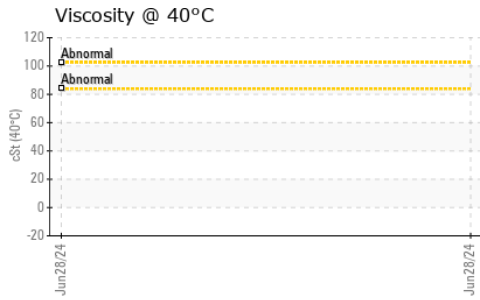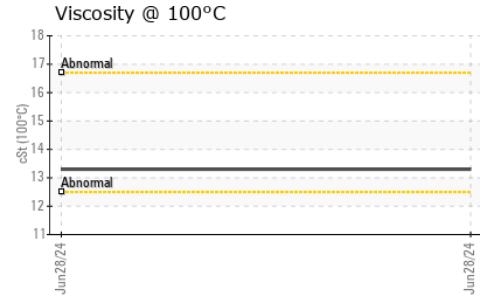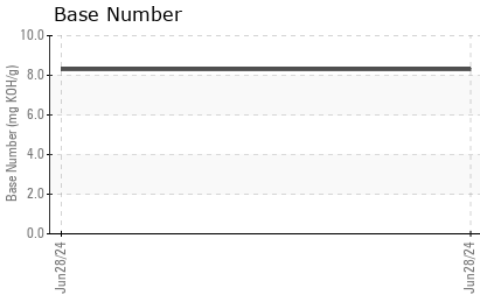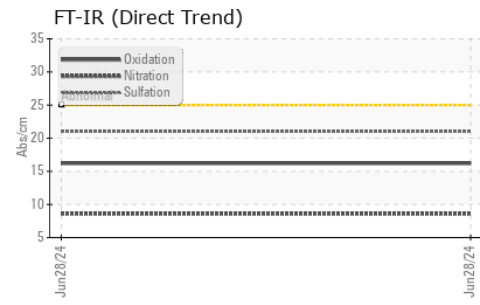

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : VPA052969 **Received** : 02 Jul 2024
Lab Number : 06225953 **Tested** : 05 Jul 2024
Unique Number : 11109446 **Diagnosed** : 05 Jul 2024 - Jonathan Hester
Test Package : MOB 1 (Additional Tests: TBN, KV40)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Northwest Diesel Power
 1325 ROEDER AVE SUITE 103
 BELLINGHAM, WA
 US 98225
 Contact: BRANDON ROBERTSON
 parts@nwdieselpower.com

T:
F: