



Machine Id  
**2304**  
Component  
**Diesel Engine**  
Fluid  
**PETRO CANADA DURON SHP 15W40 (52 QTS)**

**RECOMMENDATION**

We advise that you check for the source of the coolant leak. We recommend that you drain the oil from the component if this has not already been done. We advise that you flush the component thoroughly before re-filling with oil. We recommend an early resample to monitor this condition.

Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		<b>GFL0123375</b>	GFL0082474	GFL0050790
Sample Date		Client Info		<b>27 Jun 2024</b>	26 Sep 2023	09 May 2023
Machine Age	mls	Client Info		<b>698736</b>	34901	0
Oil Age	mls	Client Info		<b>698736</b>	324	0
Filter Age	mls	Client Info		<b>698736</b>	324	0
Oil Changed		Client Info		<b>N/A</b>	Changed	N/A
Filter Changed		Client Info		<b>N/A</b>	Changed	N/A
Sample Status				<b>SEVERE</b>	ABNORMAL	ABNORMAL

**WEAR**

All component wear rates are normal.

Iron	ppm	ASTM D5185m	>120	<b>33</b>	27	51
Chromium	ppm	ASTM D5185m	>20	<b>1</b>	<1	1
Nickel	ppm	ASTM D5185m	>5	<b>0</b>	<1	<1
Titanium	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	>2	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m	>20	<b>7</b>	<1	0
Lead	ppm	ASTM D5185m	>40	<b>0</b>	2	4
Copper	ppm	ASTM D5185m	>330	<b>5</b>	5	3
Tin	ppm	ASTM D5185m	>15	<b>0</b>	<1	2
Vanadium	ppm	ASTM D5185m		<b>0</b>	0	<1
White Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE

**CONTAMINATION**










Fuel content negligible. Test for glycol is positive. There is a high concentration of glycol present in the oil.

Silicon	ppm	ASTM D5185m	>25	<b>7</b>	3	4
Potassium	ppm	ASTM D5185m	>20	<b>417</b>	<1	2
Fuel	%	ASTM D3524	>3.0	<b>0.3</b>	4.7	5.4
Water		WC Method	>0.2	<b>NEG</b>	NEG	NEG
Glycol	%	*ASTM D2982		<b>0.10</b>	NEG	NEG
Soot %	%	*ASTM D7844	>4	<b>0.3</b>	1.1	1.8
Nitration	Abs/cm	*ASTM D7624	>20	<b>7.0</b>	6.0	8.2
Sulfation	Abs/.1mm	*ASTM D7415	>30	<b>19.3</b>	18.5	21.8
Silt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	*Visual	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	<b>NEG</b>	NEG	NEG

**FLUID CONDITION**

The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

Sodium	ppm	ASTM D5185m		<b>48</b>	2	1
Boron	ppm	ASTM D5185m	0	<b>7</b>	<1	4
Barium	ppm	ASTM D5185m	0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m	60	<b>55</b>	58	58
Manganese	ppm	ASTM D5185m	0	<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185m	1010	<b>857</b>	912	907
Calcium	ppm	ASTM D5185m	1070	<b>1130</b>	992	979
Phosphorus	ppm	ASTM D5185m	1150	<b>1012</b>	977	974
Zinc	ppm	ASTM D5185m	1270	<b>1216</b>	1178	1202
Sulfur	ppm	ASTM D5185m	2060	<b>2899</b>	3071	3501
Oxidation	Abs/.1mm	*ASTM D7414	>25	<b>14.4</b>	12.6	16.4
Base Number (BN)	mg KOH/g	ASTM D2896	9.8	<b>9.1</b>	8.4	7.7
Visc @ 100°C	cSt	ASTM D445	15.4	<b>14.6</b>	13.2	12.8

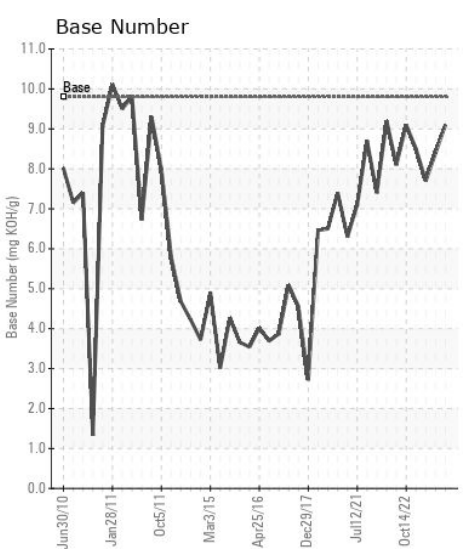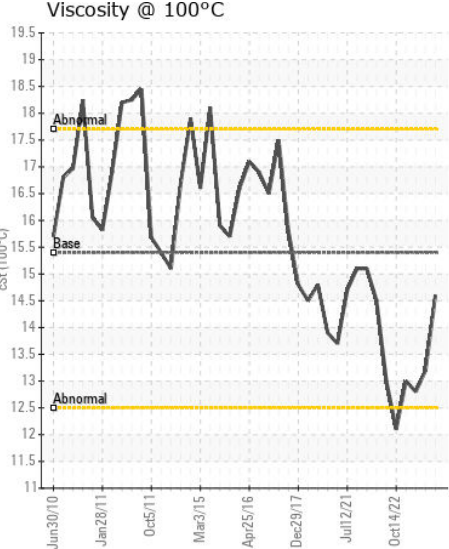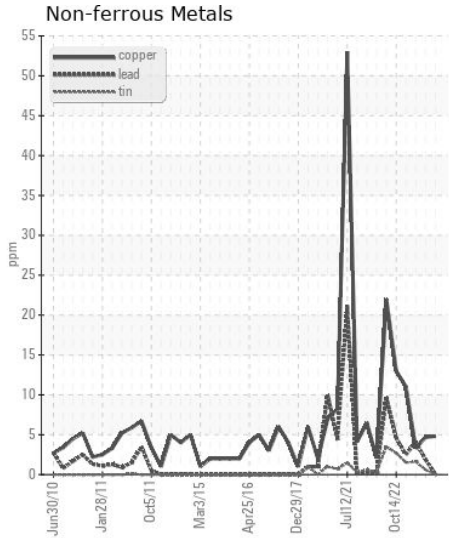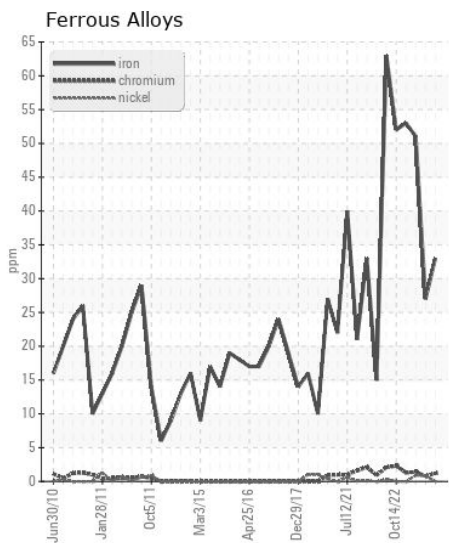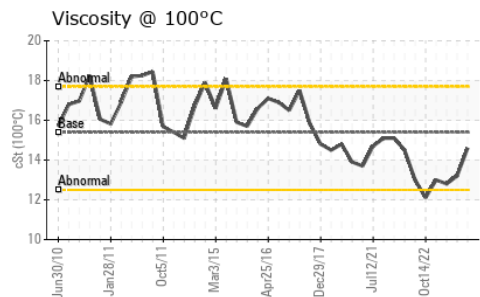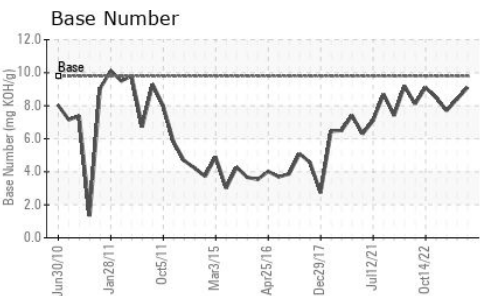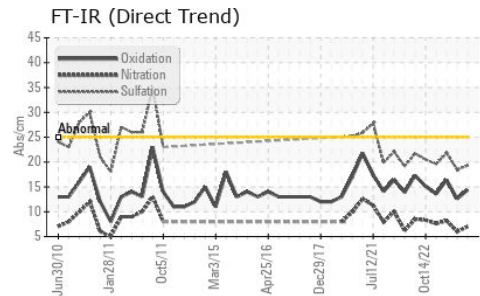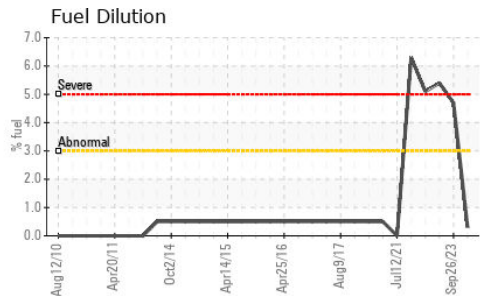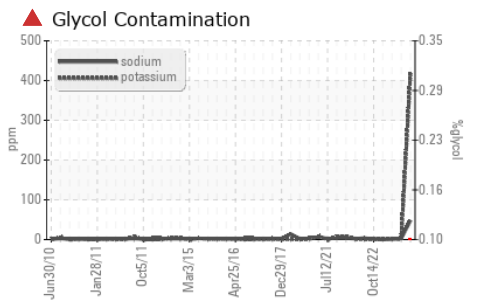

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : GFL0123375 **Received** : 03 Jul 2024  
**Lab Number** : 06227091 **Tested** : 08 Jul 2024  
**Unique Number** : 11110584 **Diagnosed** : 08 Jul 2024 - Wes Davis  
**Test Package** : FLEET ( Additional Tests: Glycol, PercentFuel )

**GFL Environmental - 007 - Brunswick**  
 2809 Galloway Road  
 Bolivia, NC  
 US 28422  
 Contact: DONALD CRAVEN  
 dcraven@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (910)253-4179