

WEAR ABNORMAL CONTAMINATION NORMAL FLUID CONDITION NORMAL

## [A35771] JOHN DEERE 644P 1DW644PAARLX23263

Rear Differential

JOHN DEERE HY-GARD HYD/TRANS (30 GAL)

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor. ( Customer Sample Comment: A35771 )

WEAR

Bearing and/or bushing wear is indicated.

\_\_\_\_\_

## CONTAMINATION

There is no indication of any contamination in the oil.


## **FLUID CONDITION**

The condition of the oil is acceptable for the time in service.

RAN5 (30 C	IAL)					
Test	UOM	Method	Limit/Abn	Current	History1	History2
Sample Number		Client Info		WE0007703		
Sample Date		Client Info		11 Jul 2024		
Machine Age	hrs	Client Info		574		
Oil Age	hrs	Client Info		574		
Filter Age	hrs	Client Info		574		
Oil Changed		Client Info		Not Changd		
Filter Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
PQ		ASTM D8184		21		
Iron	ppm	ASTM D5185m	>500	71		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>25	<b>▲</b> 70		
Copper	ppm	ASTM D5185m	>100	<b>1</b> 35		
Tin	ppm	ASTM D5185m	>10	8		
Vanadium	ppm	ASTM D5185m		0		
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Silicon	ppm	ASTM D5185m	>75	9		
Potassium	ppm	ASTM D5185m	>20	3		
Water	1-1-	WC Method	>.2	NEG		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>.2	NEG		
Sodium	ppm	ASTM D5185m		3		
Boron	ppm	ASTM D5185m	6	19		
Barium	ppm	ASTM D5185m	0	3		
Molybdenum	ppm	ASTM D5185m	0	9		
Manganese	ppm	ASTM D5185m		3		
Magnesium	ppm	ASTM D5185m	145	102		
Calcium	ppm	ASTM D5185m	3570	3206		
Phosphorus	ppm	ASTM D5185m	1290	1092		
Zinc	ppm	ASTM D5185m	1640	1154		
Sulfur	ppm	ASTM D5185m		4318		
Visc @ 40°C	cSt	ASTM D445	57.0	56.7		

Report Id: WARMAD [WUSCAR] 06236449 (Generated: 07/17/2024 10:18:33) Rev: 1

Submitted By: BOBBY LUCKY

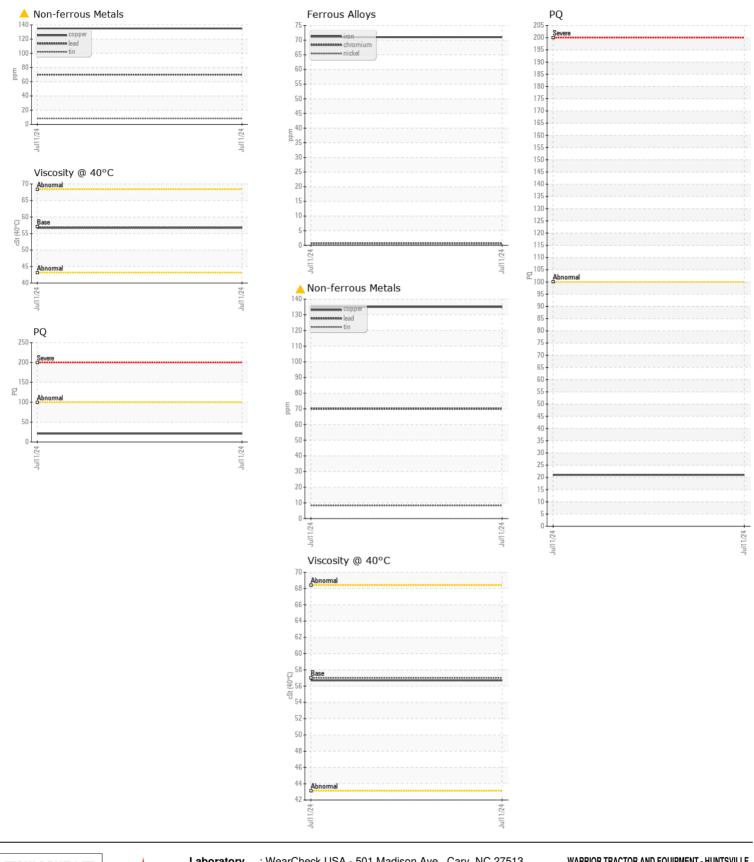

WARRIOR TRACTOR AND EQUIPMENT - HUNTSVILLE Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Sample No. : WE0007703 Received 25135 ONE AVIATION WAY SW : 15 Jul 2024 £ MADISON, AL Lab Number : 06236449 Tested : 16 Jul 2024 Unique Number : 11125283 Diagnosed : 17 Jul 2024 - Sean Felton US 35756 Test Package : CONST (Additional Tests: PQ) Contact: BOBBY LUCKY Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369. warriorparts033@gmail.com \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. T: F: Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)