



Secteur

MICHAUDVILLE

Identité de la machine

1223

Composant

Transmission (Auto)

Fluid

DEXRON III (--- GAL)

RECOMMENDATION

We recommend that you drain the fluid from the component if this has not already been done. We recommend an early resample to monitor this condition. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm. Please specify the component make and model with your next sample.

USURE

Aluminum ppm levels are abnormal. Torque converter wear is indicated.












CONTAMINATION

There is no indication of any contamination in the fluid.

ÉTAT DU FLUIDE

The fluid is no longer serviceable as a result of the abnormal and/or severe wear.

Table with 7 columns: Test, UOM, Method, Limit/Abn, Current, History1, History2. Rows include various oil analysis tests like Numéro d'échant., Date d'échant., Âge de la Machine, etc.

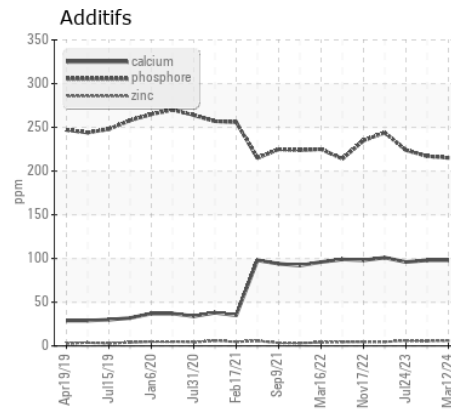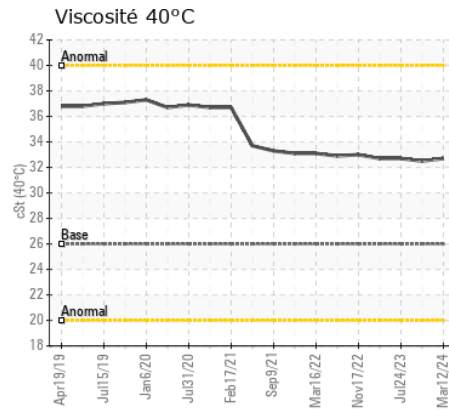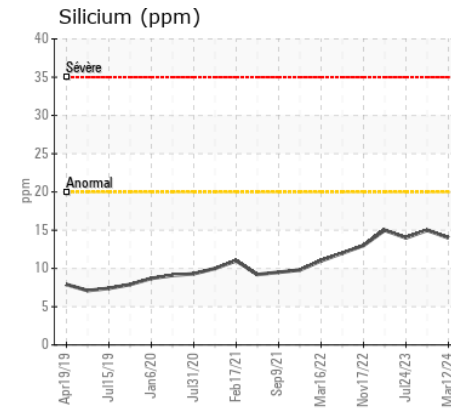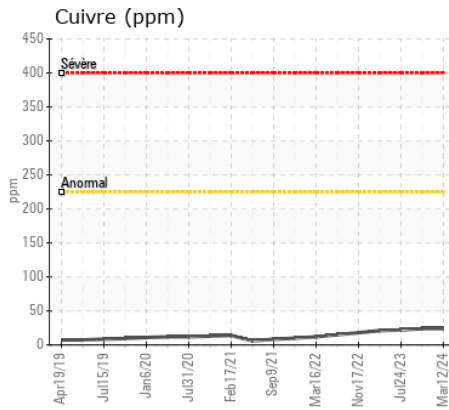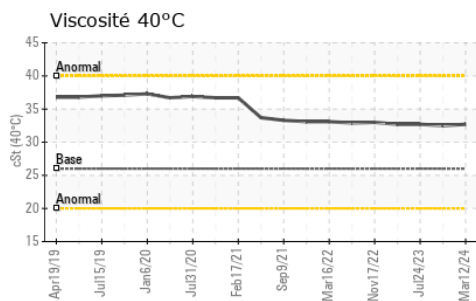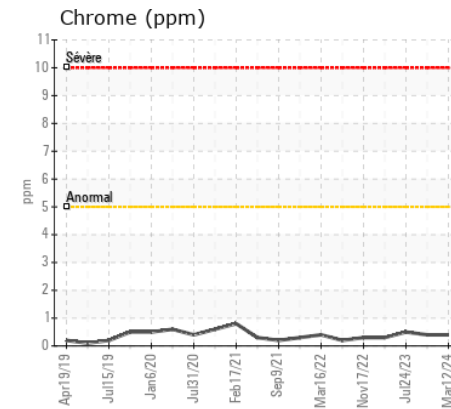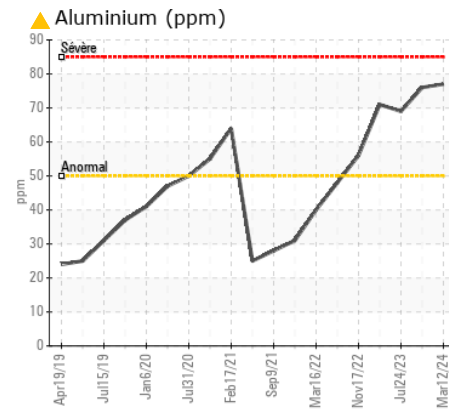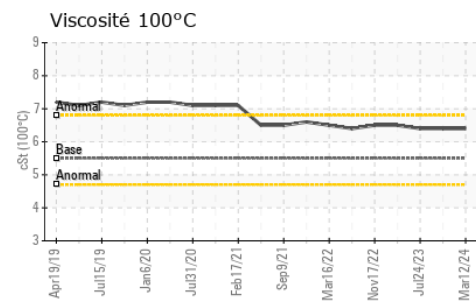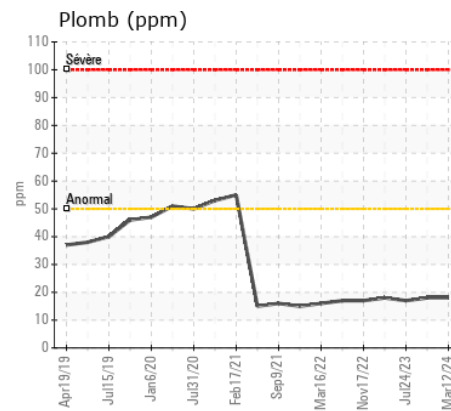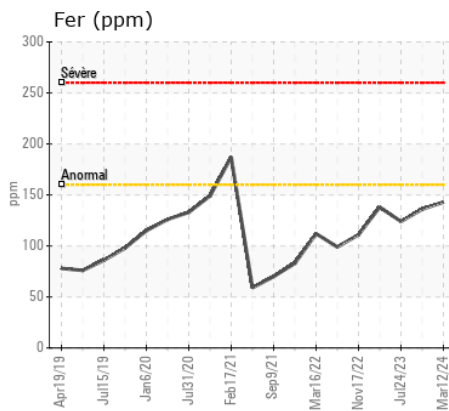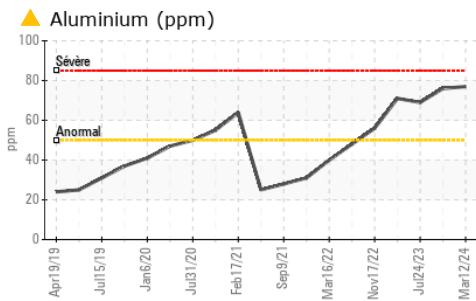

ISO 17025:2017
Accredited
Laboratory

Laboratoire : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
N° d'échantillon : PC0084451
N° de laboratoire : 02621804
Numéro unique : 5746923
Analyse : MOB 1 (Additional Tests: KV100, VI)

LES ENTREPRISES MICHAUVILLE INC.
 270 RUE BRUNET
 MONT ST-HILAIRE, QC
 CA J3H 0M6
 Contact: Martin Trudel
 mtrudel@michaudville.com

*Pour discuter ce rapport, contacter le service à la clientèle au 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 La validez de los resultados y la interpretación se basan en la muestra y la información proporcionada.*