

# [Orlen Upstream Canada / 16-7-63-5W6] 1850 STABILIZER REBOILER

## Customer: PTRHTF20175

QUADRA CHEMICALS 7802 98 STREET

CLAIRMONT, AB T0H 0W0 Canada

Attn: Quadra Samples

Tel:

E-Mail: quadra samples@quadra.ca

### System Information

System Volume: 2300 ltr

Bulk Operating Temp: 215F / 102C

Heating Source:

Blanket:

Fluid: PETRO CANADA PETRO-THERM

Make: ALCO

### Sample Information


Aug19

Lab No: 02305912 Analyst: Clinton Buhler Sample Date: 08/06/19 Received Date: 08/30/19 Completed: 09/11/19

Recommendation: Sample results indicate that the heat transfer fluid is suitable for continued service. Please re-sample in 12 months


Comments:

Sample Date	Received Date	Fluid Age	Sample Location	Flash Point (COC)	Water (KF)	Viscosity (40°C)	Acid Number	Solids	GCD 10%	GCD 50%	306 GCD	GCD % < 335°C	
	mm/dd/yy			°F/°C	ppm	cSt	mg/KOH/ g	%wt	°F/°C	°F/°C	°F/°C	%	
08/06/19	08/30/19	14m	SIGHT GLASS	464 / 240	7.3	34.8	0.009	0.091	718 / 381	801 / 427	903 / 484	0.00	
11/25/18	12/14/18	6m		450 / 232	484.4	35.0	0.02	0.093	723 / 384	812 / 433	919 / 493	0.45	
06/08/18	06/15/18	0m	MIDDLE SIGHT GLASS	187 / 86	6.9	23.5	0.025	0.151	665 / 352	796 / 425	893 / 478	7.77	
05/11/18	05/30/18	18m		478 / 248	8.2	35.1	0.035	0.028	722 / 383	812 / 434	917 / 492	0.19	
04/08/17	05/26/17	5m	HEATER SIGHT GLASS	442 / 228	52.3	33.8	0.052	0.047	722 / 384	814 / 434	903 / 484	0.73	
12/20/16	01/05/17	0m		446 / 230	123.3	35.3	0.030	0.060	724 / 385	816 / 436	905 / 485	0.38	
Baseline Data				433 / 223		34.2	0.03		720 / 382	817 / 436	900 / 482	1.00	
A cid N	umbor		Viscosity @ 40°C					Flack Doint (OC)					

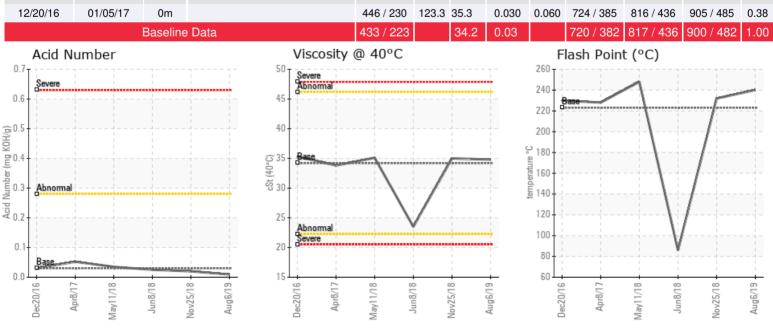



Elemental analysis results (above) in parts per million (ppm). [10,000 ppm = 1.0%]

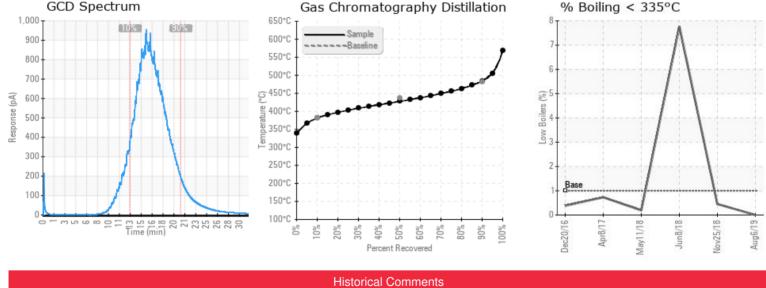

# Sample results indicate that the heat transfer fluid is suitable for continued service. Please re-sample in 6 months. Water contamination levels are marginally high. Water contamination levels are marginally high. (GCD) 90% Distillation Point is marginally high. Sample results indicate that the heat transfer fluid is not suitable for continued service. COC flash point is severely low. This poses a safety risk if the fluid was to be re-used. The % boil off < 335°C value of 7.77 (new is 1%) also indicates severe contamination of the fluid with condensate. The fluid's viscosity @40C and 10% GCD also indicates this contamination. Fluid replacement should be considered. Once system has been cleaned and filled with fresh fluid, take a base-line fluid sample after initial filling and again after 24 hours of service at normal operating temperature. Please ensure sample registration cards reflect the new time on fluid. Unit 1850 sample results from May 11, 2018 indicate the fluid is suitable for continued service. At time of this sample review, it is known that the this system has been contaminated with condensate since the sample was drawn on May 11. Results of sample drawn June 8, 2018 will be reviewed once available. Please ensure all sample registration information is included, such as system volume and if there is blanket gas in use and system age. Fluid is suitable for continued service. Check to ensure blanket gas is in use. Re-sample in 6-12 months Fluid is in Good condition. Resample in 6 months.

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.