

HEAT TRANSFER SYSTEM

Customer: PTRHTF30154
 Panolam Surface Systems
 61 Domtar Road
 Huntsville, ON P1H 2J7 Canada
 Attn: MIKE GODDEN
 Tel: (705)789-9683
 E-Mail: mike_godden@panolam.com




System Information
 System Volume: 60480 ltr
 Bulk Operating Temp: 509F / 265C
 Heating Source:
 Blanket:
 Fluid: PETRO CANADA CALFLO AF
 Make: GEKA



Sample Information
 Lab No: 02495672
 Analyst: Yen Garcia
 Sample Date: 06/10/22
 Received Date: 06/20/22
 Completed: 07/23/22
 Yen Garcia
 yen.garcia@HFSinclair.com

Recommendation:

Comments: (GCD) 90% Distillation Point is marginally high. COC Flash Point is marginally low. Fluid Replacement is Scheduled for 2023.




Sample Date	Received Date	Fluid Age	Sample Location	Flash Point (COC)	Water (KF)	Viscosity (40°C)	Acid Number	Solids	GCD 10%	GCD 50%	GCD 90%	GCD % < 335°C
	mm/dd/yy			°F/°C	ppm	cSt	mg/KOH/g	%wt	°F/°C	°F/°C	°F/°C	%
06/10/22	06/20/22	20.0y	primary circ pump	363 / 184	48.5	26.8	0.17	0.136	673 / 356	792 / 422	906 / 486	5.99
10/14/21	10/22/21	16.0y		352 / 178	87.4	25.3	0.17	0.047	671 / 355	790 / 421	904 / 484	6.22
08/19/20	08/26/20	6.0y	THERMAL OIL BUILDING	349 / 176	193.2	23.5	0.14	0.046	667 / 353	789 / 421	902 / 483	6.83
Baseline Data				435 / 224		32.7	0.03		693 / 367	790 / 421	887 / 475	2.5

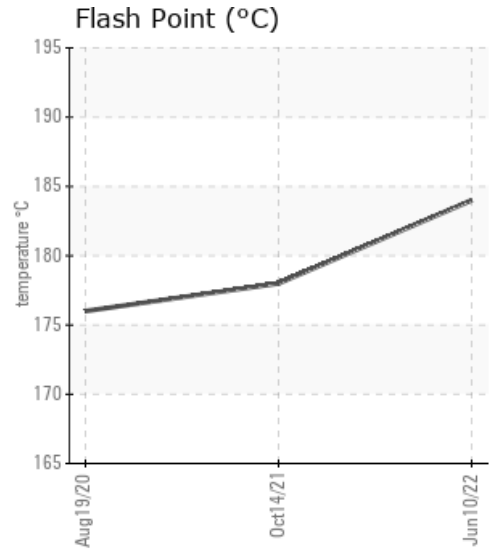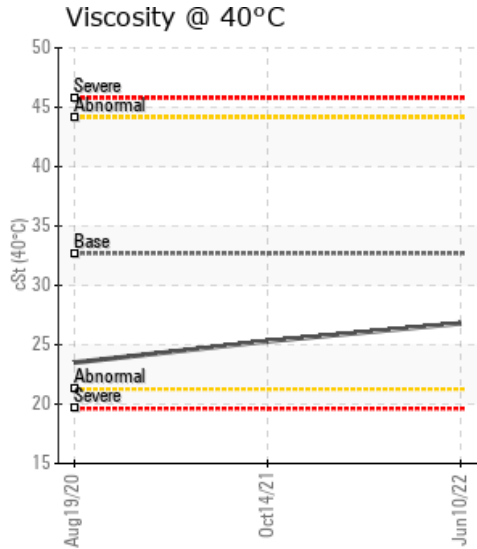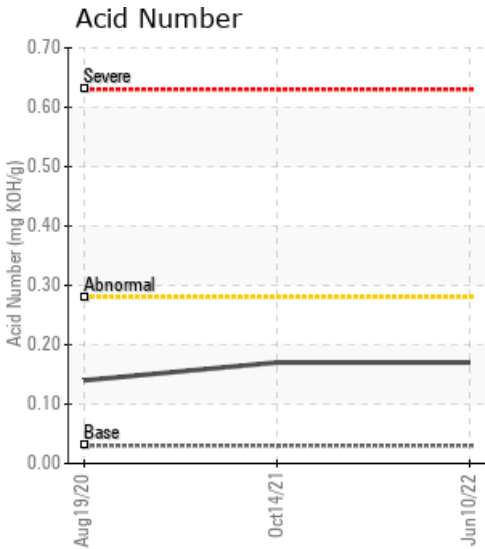

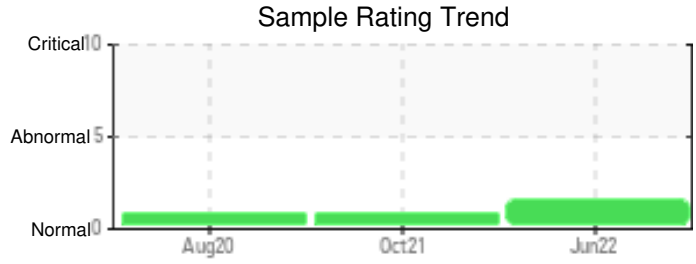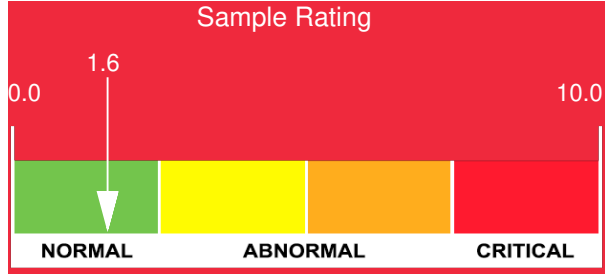

Sample Date	Iron	Chromium	Nickel	Aluminum	Copper	Lead	Tin	Cadmium	Silver	Vanadium	Silicon	Sodium	Potassium	Titanium	Molybdenum	Antimony	Manganese	Lithium	Boron	Magnesium	Calcium	Barium	Phosphorus	Zinc
06/10/22	19	0	0	0	0	0	0	0	0	0	1	3	2	0	0	0	0	0	0	0	0	0	48	0
10/14/21	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	31	0
08/19/20	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	1	0	0	0	27	0
Baseline Data			0	0						0			0	0					0				270	

Elemental analysis results (above) in parts per million (ppm). [10,000 ppm = 1.0%]

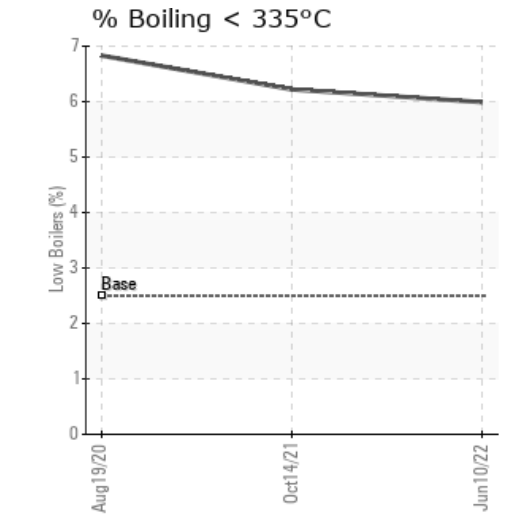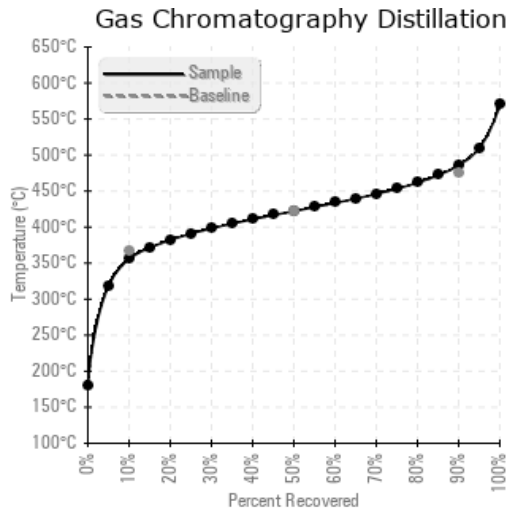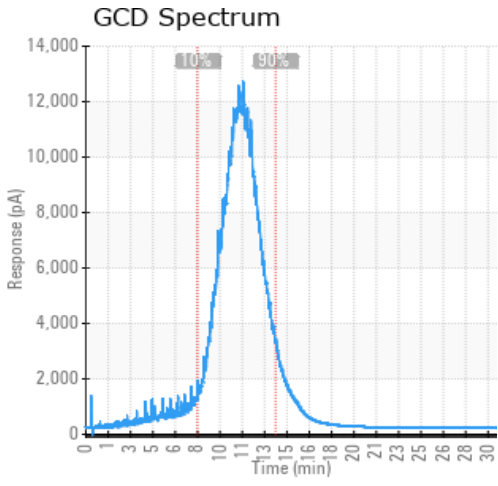

Historical Comments	
10/14/21	Sample indicates the presence of low boilers. GCD%<335°C was measured at 6.22%. Typical is 2.5%. Low Boilers can be reduced by following the heat transfer system manufacturers procedure for venting of the expansion tank. The higher % of low boilers has reduced the flash point to 178°C versus a typical of 224°C. Viscosity has also been reduced to 25.3 cSt@40°C from the typical of 32.3 for Calllo AF. GCD%@90% indicates some cracking of the fluid. Solids remain low at 0.047%. Next steps to consider: 1 - venting of the low boilers, following heat transfer system manufacturers recommended procedure. 2 - Sweetening the system by replacing approx 10% of the volume of the system, to help bring the viscosity and flash point up. However this should be done after the low boilers have been vented. Sample fluid after low boilers have been vented. Sample system before the planned change out in 2022. COC Flash Point is abnormally low.
08/19/20	the sample shows, lower viscosity, lower flash point, and higher oil evaporation below 335 C. have you added any oil into the system? It seems that there is a lower viscosity oil added to this system. at this stage, the low flash point is not a safety concern, but you need to monitor it. The system also does not show any acid formation and pipe corrosion. Please resample after 6 months. COC Flash Point is abnormally low.

Petro-Canada makes no representation or warranty of any kind, either express or implied, as to the accuracy or completeness of the analysis and assumes no responsibility and shall have no liability whatsoever with respect to such analysis, or a party's use of it. Petro-Canada is a division of HollyFrontier Corporation.