



1762-070170 - Front Differential

Sample No: LH0264112

Oil Type: LIEBHERR GEAR BASIC 90 LS

LH0264112			
11 Aug 2023			
742			
742			
Changed			
ABNORMAL			
N			
	ABNORMAL	ABNORMAL	ABNORMAL

Visc @ 40°C

-

-

0

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

ADDITIVES

ppm

ppm

ppm

ppm

ppm

ppm

_

cSt **194**

Silicon	ppm	0 20			
Sodium	ppm	06			
Potassium	ppm	○ <1			

WEA	R META	LS		
Iron	ppm	0 193	 	
Copper	ppm	<mark>()</mark> 138	 	
Lead	ppm	01	 	
Tin	ppm	<mark>)</mark> 9	 	
Aluminum	ppm	01	 	
Chromium	ppm	0 2	 	
Molybdenum	ppm	0 ()	 	
Nickel	ppm	○ <1	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	54	 	
Vanadium	ppm	0	 	

BINDERHOLZ

260 PIPER LN ENFIELD, NC US 27823 Contact: ROBERT BULLOCK robert.bullock@binderholz.com T: F:

Diagnosis

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.Bearing and/or bushing wear is indicated. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	BINENF
Unique No:	10605047
Signed:	Sean Felton
Report Date:	16 Aug 2023

0 14

0

0 59

0

0

0 2363

Contact/Location: ROBERT BULLOCK - BINENF






Ferrous Alloys

GRAPHS

 \odot

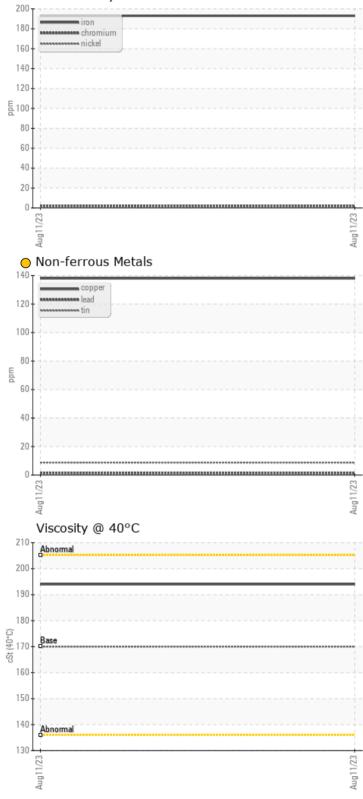

Report Id: BINENF [WUSCAR] 05925100 (Generated: 08/16/2023 16:11:59) Rev: 1