

LIEBHERR

CONSTRUCTION EQUIPMENT



LIEBHERR L546 1755-67311 - Front Right Wheel Hub

Sample No: LH0263979

Oil Type: GEAR OIL SAE 80W90



SAMPLE INFORMATION

Sample Number	LH0263979	LH0244326	---	---
Sample Date	16 Oct 2023	07 Mar 2023	---	---
Machine Hours	967	436	---	---
Oil Hours	0	0	---	---
Oil Changed	Changed	Changed	---	---
Sample Status	ATTENTION	NORMAL	---	---

FAHRNER EXCAVATING

PO BOX 36

PLOVER, MI

US 54467

Contact: JUSTIN F

excavatinginc@gmail.com

T: (715)341-8902

F:



OIL CONDITION

Visc @ 40°C	cSt	● 132	● 182	---	---
-------------	-----	-------	-------	-----	-----



CONTAMINATION

Silicon	ppm	● 2	● 2	---	---
Sodium	ppm	● 1	● 38	---	---
Potassium	ppm	● 2	● 8	---	---



WEAR METALS

Iron	ppm	● 225	● 4	---	---
Copper	ppm	● <1	● <1	---	---
Lead	ppm	● 0	● 0	---	---
Tin	ppm	0	<1	---	---
Aluminum	ppm	● <1	● <1	---	---
Chromium	ppm	● 2	● 1	---	---
Molybdenum	ppm	● <1	0	---	---
Nickel	ppm	● 2	● 1	---	---
Titanium	ppm	<1	0	---	---
Silver	ppm	0	0	---	---
Manganese	ppm	● 3	<1	---	---
Vanadium	ppm	0	2	---	---



ADDITIVES

Calcium	ppm	● 34	1	---	---
Magnesium	ppm	● 5	0	---	---
Zinc	ppm	● 35	0	---	---
Phosphorus	ppm	● 1028	5	---	---
Barium	ppm	● 0	0	---	---
Boron	ppm	<1	<1	---	---

Diagnosis

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. An increase in the iron level is noted. All other component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: FAHPLO

Unique No: 10712617


Signed: Sean Felton

Report Date: 27 Oct 2023




GRAPHS

● Ferrous Alloys

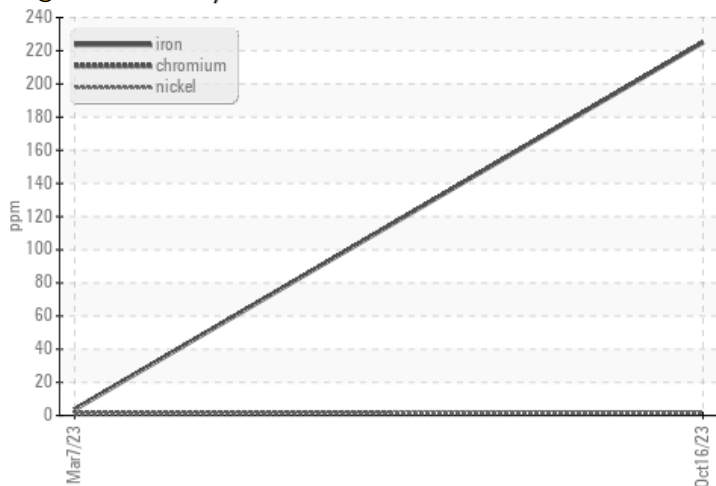

Non-ferrous Metals

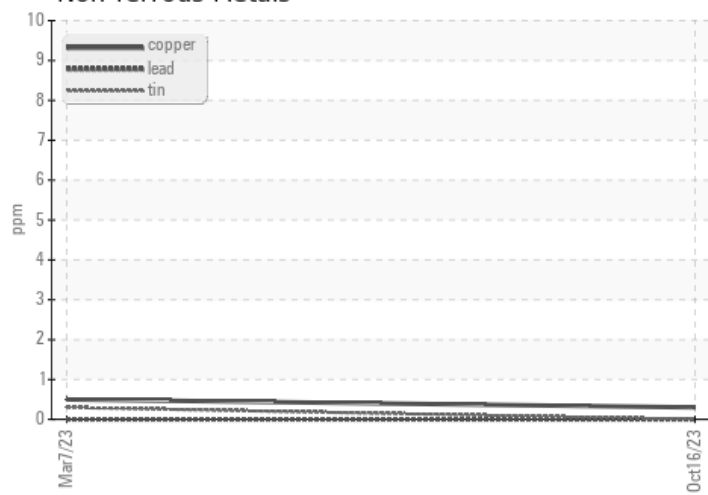

Viscosity @ 40°C

