

LIEBHERR

CONSTRUCTION EQUIPMENT



[[MANASSAS TOPSOIL]] LIEBHERR L556 050193-1332 - Rear Left W

Sample No: LH0258959

Oil Type: LIEBHERR GEAR BASIC 90 LS



SAMPLE INFORMATION

Sample Number	LH0258959	---	---	---
Sample Date	18 Oct 2023	---	---	---
Machine Hours	1670	---	---	---
Oil Hours	1670	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	ABNORMAL	---	---	---

LIEBHERR EQUIPMENT SOURCE

10119 RESIDENCY ROAD
 MANASSAS, VA
 US 20110
 Contact: TOM HEINEY
 tom.heiney@liebherr.com
 T: (703)392-0111
 F: (703)331-5604



OIL CONDITION

Visc @ 40°C	cSt	196	---	---	---
-------------	-----	-----	-----	-----	-----



CONTAMINATION

Silicon	ppm	19	---	---	---
Sodium	ppm	7	---	---	---
Potassium	ppm	1	---	---	---



WEAR METALS

Iron	ppm	132	---	---	---
Copper	ppm	69	---	---	---
Lead	ppm	0	---	---	---
Tin	ppm	2	---	---	---
Aluminum	ppm	2	---	---	---
Chromium	ppm	1	---	---	---
Molybdenum	ppm	4	---	---	---
Nickel	ppm	2	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	28	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	15	---	---	---
Magnesium	ppm	6	---	---	---
Zinc	ppm	48	---	---	---
Phosphorus	ppm	2048	---	---	---
Barium	ppm	0	---	---	---
Boron	ppm	0	---	---	---

Diagnosis


The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. Bearing and/or bushing wear is indicated. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: LIEBHERRVA
 Unique No: 10736231
 Signed: Sean Felton
 Report Date: 10 Nov 2023




GRAPHS

Ferrous Alloys

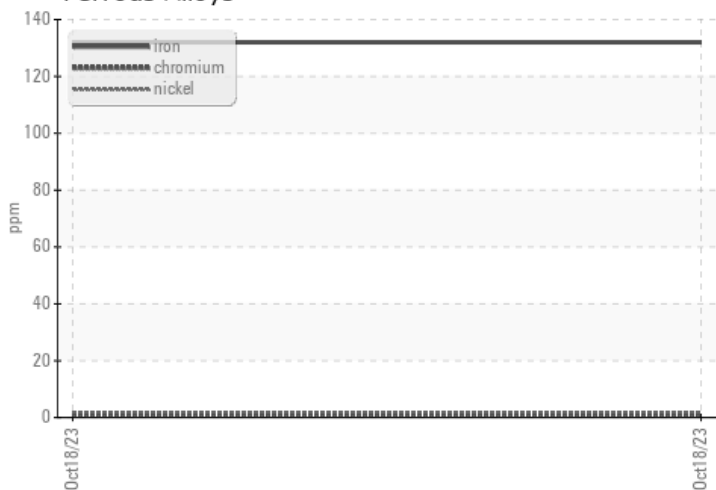

Non-ferrous Metals

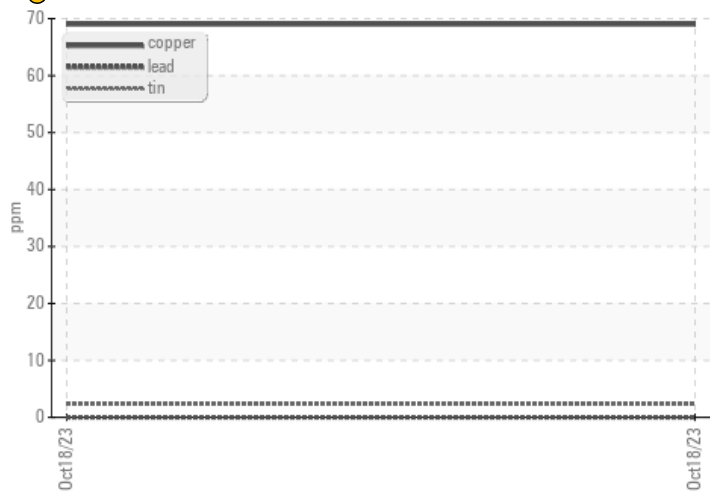

Viscosity @ 40°C

