# LIEBHERR

**CONSTRUCTION EQUIPMENT** 

## **LIEBHERR R926 056525-1715 - Splitter Box**

**Sample No:** LH0268483

Oil Type: LIEBHERR GEAR BASIC 90 LS

Ō SAMP	<b>LE INFOR</b>	MATION				
Sample Number		LH0268483				
Sample Date		07 Dec 2023				
Machine Hours		840				
Oil Hours		840				
Oil Changed		Changed				
Sample Status		NORMAL				
OIL CONDITION						
Visc @ 40°C	cSt	<b>191</b>				
CONTAMINATION						
Water	%	NEG				
		<u> </u>				

CONTAMINATION						
Water	%	NEG				
Silicon	ppm	<b>2</b>				
Sodium	ppm	<b>2</b>				
Potassium	ppm	<b>0</b>				
(Ö) WEAR	METALC					

WEA	R METALS			
Iron	ppm	<b>63</b>	 	
Copper	ppm	<b>2</b>	 	
Lead	ppm	<b>0</b>	 	
Tin	ppm	<b>0</b>	 	
Aluminum	ppm	<b>0</b>	 	
Chromium	ppm	<b>0</b> <1	 	
Molybdenum	ppm	<b>0</b>	 	
Nickel	ppm	<b>0</b>	 	
Titanium	ppm	<1	 	
Silver	ppm	0	 	
Manganese	ppm	<b>3</b>	 	
Vanadium	ppm	0	 	

Variadiaiii	ppiii	•				
ADDITIVES						
Calcium	ppm	<b>0</b>				
Magnesium	ppm	<b>0</b>				
Zinc	ppm	<b>16</b>				
Phosphorus	ppm	<b>1304</b>				
Barium	ppm	<b>0</b>				
Boron	ppm	<b>0</b>				



## LIEBHERR EQUIPMENT SOURCE

8200 FAYETTEVILLE ROAD RALEIGH, NC

US 27603

Contact: JOSEPH GERMEROTH joseph.germeroth@liebherr.com

T:

F: (919)329-0084

#### Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.


Depot: LIEBHERRNC
Unique No: 10780742
Signed: Jonathan Hester
Report Date: 14 Dec 2023

# CONSTRUCTION EQUIPMENT





#### **GRAPHS**

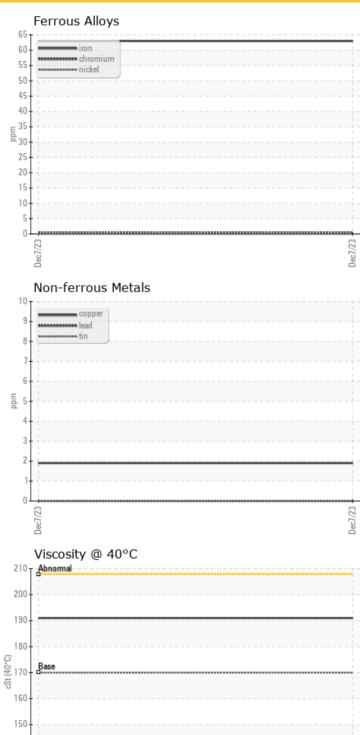

Abnormal

130

Dec7/23