

# LIEBHERR

## CONSTRUCTION EQUIPMENT



### LIEBHERR LH40M T18823-1215 - Rear Right Wheel Hub

Sample No: LH0243906

Oil Type: LIEBHERR GEAR BASIC 90 LS



#### LIEBHERR EQUIPMENT SOURCE

4100 CHESTNUT AVENUE  
NEWPORT NEWS, VA  
US 23607

Contact: LUKE APPLEBY  
Lucas.Appleby@liebherr.com  
T:  
F: (757)298-8700



#### SAMPLE INFORMATION

Sample Number	LH0243906	---	---	---
Sample Date	27 Feb 2024	---	---	---
Machine Hours	5666	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	ABNORMAL	---	---	---



#### OIL CONDITION

Visc @ 40°C	cSt	● 176	---	---	---
-------------	-----	-------	-----	-----	-----



#### CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	● 8	---	---	---
Sodium	ppm	● 13	---	---	---
Potassium	ppm	● 1	---	---	---



#### WEAR METALS

Iron	ppm	● 109	---	---	---
Copper	ppm	● 155	---	---	---
Lead	ppm	● 0	---	---	---
Tin	ppm	● <1	---	---	---
Aluminum	ppm	● 1	---	---	---
Chromium	ppm	● <1	---	---	---
Molybdenum	ppm	● 0	---	---	---
Nickel	ppm	● <1	---	---	---
Titanium	ppm	● 0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	● 3	---	---	---
Vanadium	ppm	0	---	---	---



#### ADDITIVES

Calcium	ppm	41	---	---	---
Magnesium	ppm	● 2	---	---	---
Zinc	ppm	● 100	---	---	---
Phosphorus	ppm	● 2272	---	---	---
Barium	ppm	● <1	---	---	---
Boron	ppm	● <1	---	---	---

#### Diagnosis


The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. Bearing and/or bushing wear is indicated. All other component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: LIEBHERRUS  
Unique No: 10915851  
Signed: Don Baldrige  
Report Date: 11 Mar 2024




### GRAPHS

#### Ferrous Alloys

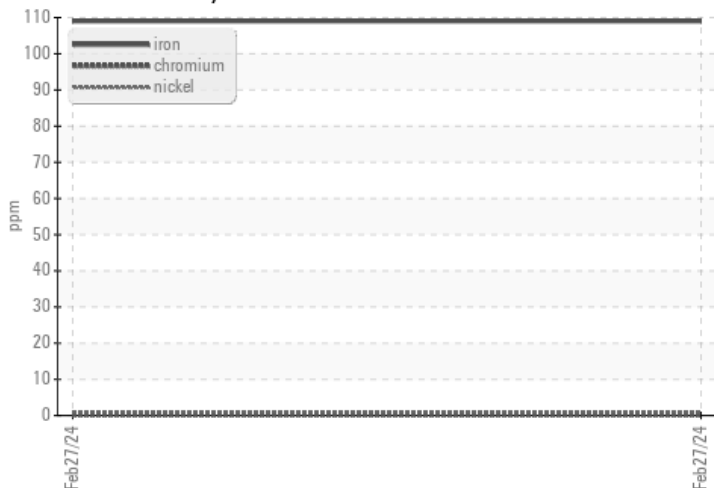

#### Non-ferrous Metals

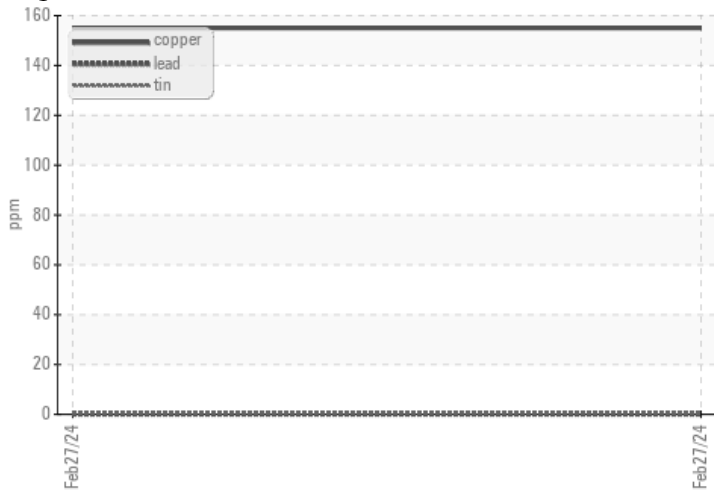

#### Viscosity @ 40°C

