

# LIEBHERR

## CONSTRUCTION EQUIPMENT



### LIEBHERR LH50 Timber 136525-1474 - Rear Left Wheel Hub

Sample No: LH0268710

Oil Type: LIEBHERR GEAR BASIC 90 LS



**LIEBHERR EQUIPMENT SOURCE**  
 8200 FAYETTEVILLE ROAD  
 RALEIGH, NC  
 US 27603  
 Contact: TAYLOR BLALOCK  
 taylor.blalock@liebherr.com  
 T: (757)718-0491  
 F: (919)329-0084



#### SAMPLE INFORMATION

Sample Number	LH0268710	---	---	---
Sample Date	07 Mar 2024	---	---	---
Machine Hours	3600	---	---	---
Oil Hours	1300	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	ABNORMAL	---	---	---



#### OIL CONDITION

Visc @ 40°C	cSt	● 190	---	---	---
-------------	-----	-------	-----	-----	-----



#### CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	● 4	---	---	---
Sodium	ppm	● 3	---	---	---
Potassium	ppm	● 0	---	---	---



#### WEAR METALS

Iron	ppm	● 392	---	---	---
Copper	ppm	● 30	---	---	---
Lead	ppm	● 0	---	---	---
Tin	ppm	● 0	---	---	---
Aluminum	ppm	● 2	---	---	---
Chromium	ppm	● 3	---	---	---
Molybdenum	ppm	● 0	---	---	---
Nickel	ppm	● <1	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	● 6	---	---	---
Vanadium	ppm	<1	---	---	---



#### ADDITIVES

Calcium	ppm	● 0	---	---	---
Magnesium	ppm	● 0	---	---	---
Zinc	ppm	● 33	---	---	---
Phosphorus	ppm	● 1870	---	---	---
Barium	ppm	● 171	---	---	---
Boron	ppm	● 0	---	---	---

#### Diagnosis

The oil change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor. Gear wear is indicated. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.


Depot: LIEBHERRNC  
 Unique No: 10917252  
 Signed: Sean Felton  
 Report Date: 12 Mar 2024

Submitted By: TAYLOR BLALOCK




### GRAPHS

#### ● Ferrous Alloys

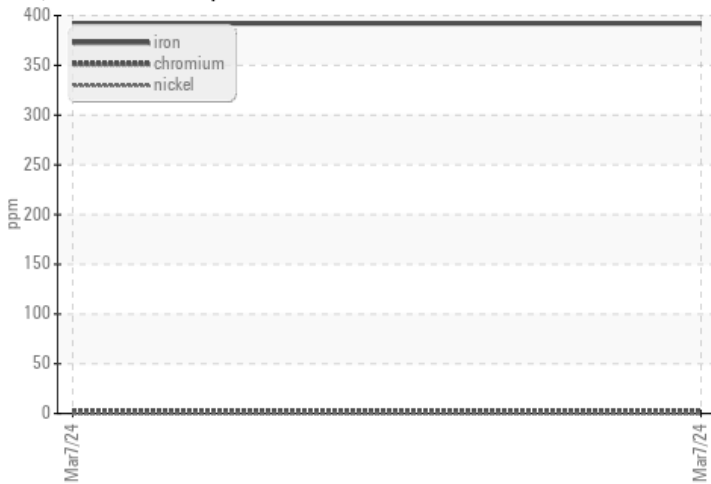

#### Non-ferrous Metals

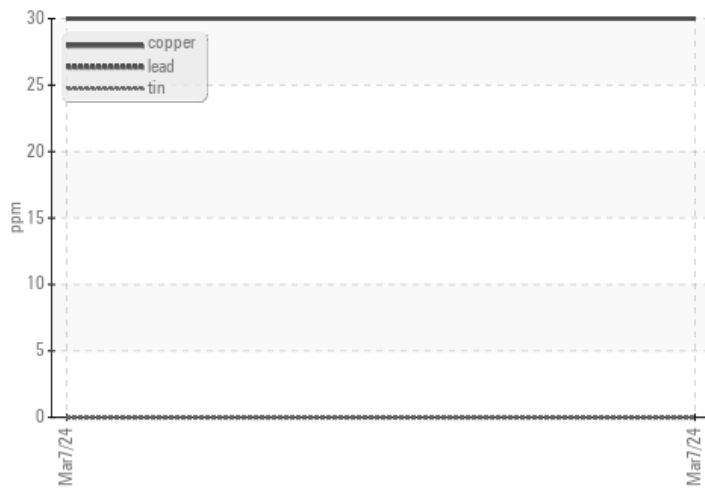

#### Viscosity @ 40°C

