

LIEBHERR

CONSTRUCTION EQUIPMENT



LIEBHERR LH110 1227-155752 - Swing Drive

Sample No: LH0267077

Oil Type: SAE 30W



KINDER MORGAN

4301 IVERSON

TRINITY, AL

US 35601

Contact: RICKY JOHNSON

ricky_johnson@kindermorgan.com

T:

F: (256)355-5250



Sample Information

Sample Number	LH0267077	LH0267545	LH0280586	LH0280586
Sample Date	10 Jun 2024	20 May 2024	18 Apr 2024	19 Mar 2024
Machine Hours	2998	2578	1980	1544
Oil Hours	967	547	0	0
Oil Changed	Changed	Not Changd	Changed	Not Changd
Sample Status	ATTENTION	ATTENTION	ATTENTION	ATTENTION



Oil Condition

Visc @ 40°C	cSt	94.2	90.2	175	176
		●	●	●	●



Contamination

Water	%	NEG	NEG	NEG	NEG
Silicon	ppm	● 3	● 3	● 5	● 6
Sodium	ppm	● <1	● 4	● 2	● 3
Potassium	ppm	● 1	● 2	● <1	● 2



Wear Metals

Iron	ppm	● 50	● 36	● 182	● 265
Copper	ppm	● 142	● 99	● 116	● 118
Lead	ppm	● 0	● 0	● 1	● <1
Tin	ppm	● 4	● 2	● 10	● 11
Aluminum	ppm	● 2	● 2	● 1	● 2
Chromium	ppm	● <1	● <1	● <1	● 1
Molybdenum	ppm	● 3	● 4	● 0	● 1
Nickel	ppm	● 0	● <1	● 0	● <1
Titanium	ppm	● <1	● <1	● <1	● 0
Silver	ppm	● 0	● <1	● 0	● 0
Manganese	ppm	● <1	● <1	● 2	● 2
Vanadium	ppm	● <1	● <1	● 0	● <1



Additives

Calcium	ppm	● 324	● 259	● 96	● 98
Magnesium	ppm	● 37	● 34	● <1	● 0
Zinc	ppm	● 196	● 165	● 53	● 45
Phosphorus	ppm	● 527	● 440	● 2154	● 2091
Barium	ppm	● 0	● 0	● 3	● 1
Boron	ppm	● 9	● 8	● 6	● 9

Diagnosis

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

Depot: KINTRI

Unique No: 11089042


Signed: Don Baldrige

Report Date: 23 Jun 2024




Graphs

Ferrous Alloys

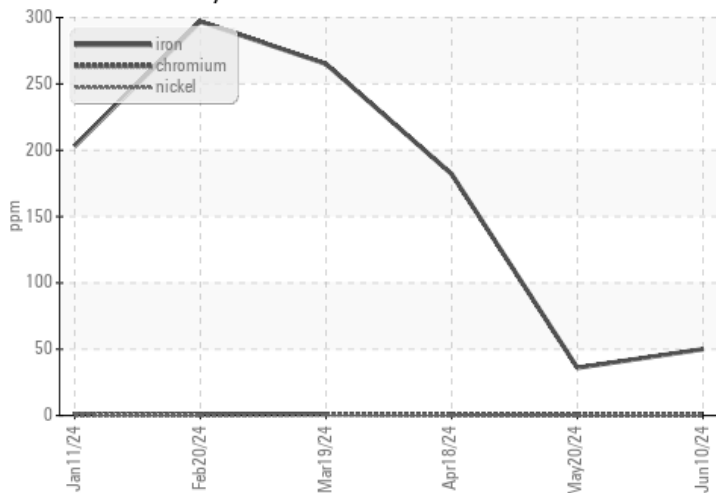

Non-ferrous Metals

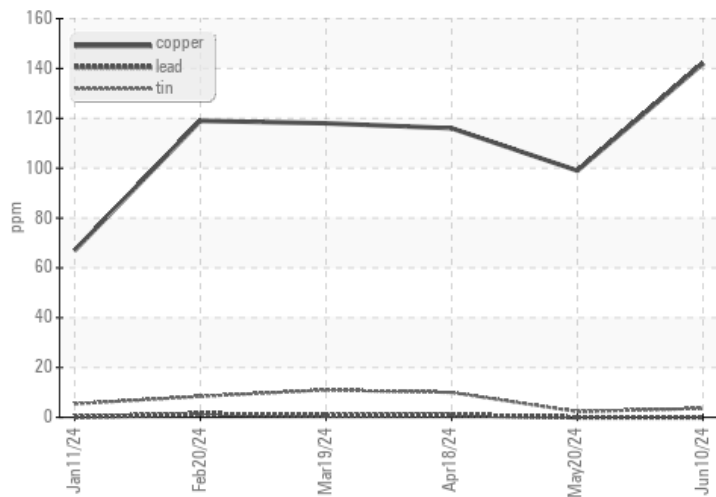

Viscosity @ 40°C

