

LIEBHERR L550 076577-1825 - Rear Left Wheel Hub

Sample No: LH0290654

Oil Type:

Information sur l'échantillon Numéro d'échant. LH0290654 --

11 Jun 2024 541

0

N/A NORMAL

0 194

GEAR OIL SAE 80W90

Date d'échant.						
Heures de la Machine						
Heures de l'huile						
Huile changée						
Statut de l'echant						

État d'huile

Visc 40°C

cSt

Conto	mination			
Eau	%	NEG	 	
Silicium	ppm	30	 	
Sodium	ppm	6	 	
Potassium	maa	0	 	

Métaux d'usure Fer ppm 0 267 Cuivre 0 91 ppm Plomb 02 ppm Étain ppm 7 Aluminium ppm 02 Chrome ppm 02 Molybdène 0 (ppm Nickel ppm 04 Titane ppm 0 Argent 0 ppm Manganèse 21 ppm Vanadium ppm 0

0 **Additifs** Calcium ppm 6 Magnésium ppm 03 Zinc 0 24 ppm Phosphore ppm 0 2199 Baryum ppm ○ <1 Bore ppm 02





142975 CANADA LTEE (MIRONOR)

751 CH DE LA 2E CONCESSION BROWNSBURG-CHATHAM, QC CA J8G 1S9 Contact: Francis Sylvestre

T: (450)898-9225 F:

Diagnostic

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W90. Please confirm.Metal levels are typical for a new component breaking in. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

 Depot:
 142BRO

 Unique No:
 5799616

 Signed:
 Kevin Marson


 Report Date:
 17 Jun 2024

 Submitted By: Eric Leblond

CONSTRUCTION EQUIPMENT



Graphs

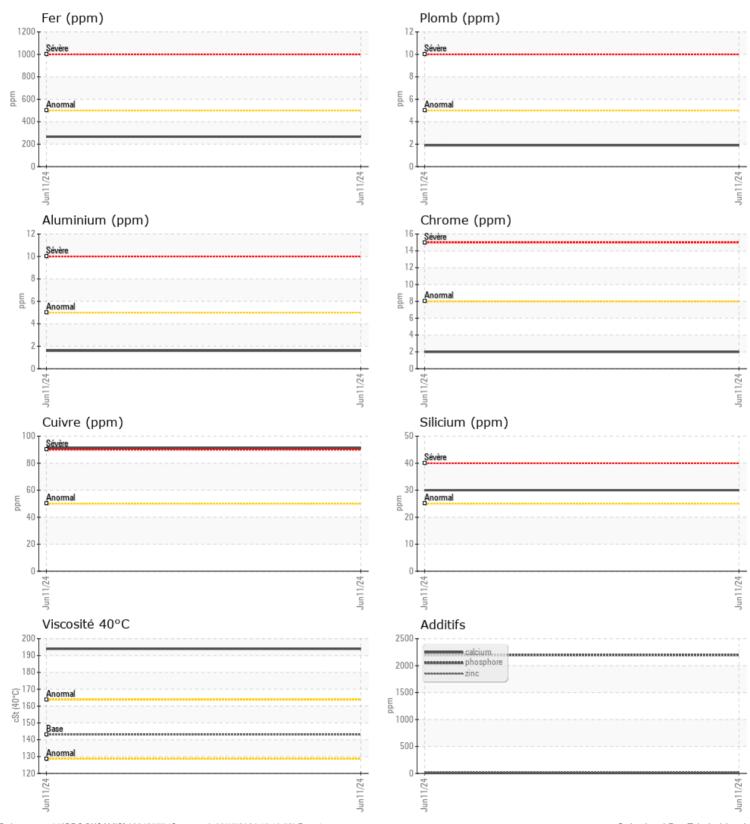

ID du rapport: 142BRO [WCAMIS] 02642077 (Generated: 06/17/2024 15:10:52) Rev: 1