



OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Machine Id
9196
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

DIAGNOSIS

Recommendation

Nous vous recommandons de vérifier tous les endroits par lesquels des contaminants peuvent pénétrer dans le système. Nous vous recommandons de remplacer le filtre et d'utiliser un système de filtrage hors-ligne afin d'améliorer la propreté du fluide. Le reniflard d'air doit être réparé. Si il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une quantité élevée de matières particulaires (2 à 100 µm de taille) présente dans l'huile.

Fluid Condition

l'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0088824	GFL0072729	GFL0021362
Sample Date	Client Info		30 Aug 2023	14 Mar 2023	07 Jul 2021
Machine Age	kms	Client Info	21063	411520	18408
Oil Age	kms	Client Info	1200	0	0
Oil Changed	Client Info		Not Chngd	N/A	Not Chngd
Sample Status			SEVERE	SEVERE	SEVERE

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >50	7	14	12
Chromium	ppm	ASTM D5185(m) >10	<1	<1	<1
Nickel	ppm	ASTM D5185(m) >4	0	0	<1
Titanium	ppm	ASTM D5185(m)	<1	<1	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m) >5	<1	2	1
Lead	ppm	ASTM D5185(m) >4	<1	<1	<1
Copper	ppm	ASTM D5185(m) >15	2	4	3
Tin	ppm	ASTM D5185(m) >4	0	<1	<1
Antimony	ppm	ASTM D5185(m)	0	<1	<1
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	5	3	<1
Barium	ppm	ASTM D5185(m) 0	0	0	0
Molybdenum	ppm	ASTM D5185(m) 0	4	2	<1
Manganese	ppm	ASTM D5185(m) 1	0	<1	<1
Magnesium	ppm	ASTM D5185(m) 0	94	29	16
Calcium	ppm	ASTM D5185(m) 50	144	132	62
Phosphorus	ppm	ASTM D5185(m) 330	399	351	337
Zinc	ppm	ASTM D5185(m) 430	452	404	405
Sulfur	ppm	ASTM D5185(m) 760	1016	886	875
Lithium	ppm	ASTM D5185(m)	<1	<1	<1




CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	2	4	2
Sodium	ppm	ASTM D5185(m)	7	11	4
Potassium	ppm	ASTM D5185(m) >20	1	<1	1

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	128954	152959	194536
Particles >6µm	ASTM D7647	>1300	37840	92097	36870
Particles >14µm	ASTM D7647	>160	606	491	30
Particles >21µm	ASTM D7647	>40	136	50	4
Particles >38µm	ASTM D7647	>10	1	1	0
Particles >71µm	ASTM D7647	>3	0	0	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	24/22/16	24/24/16	25/22/12


OIL ANALYSIS REPORT

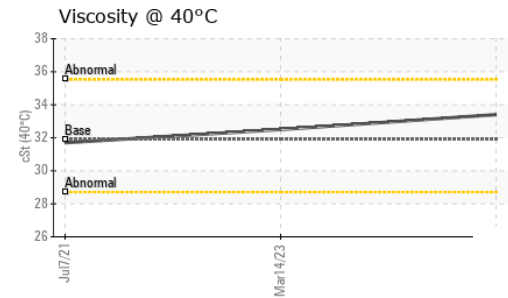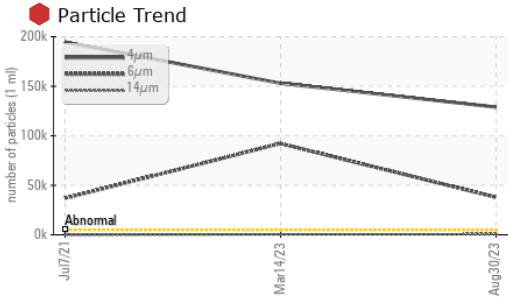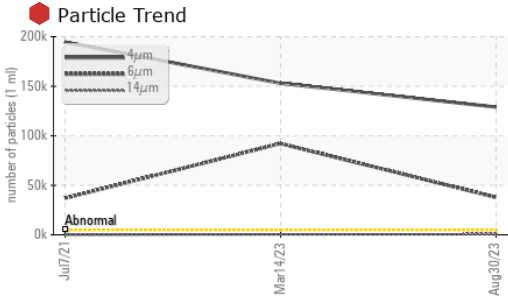





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	33.4	32.5	31.7

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

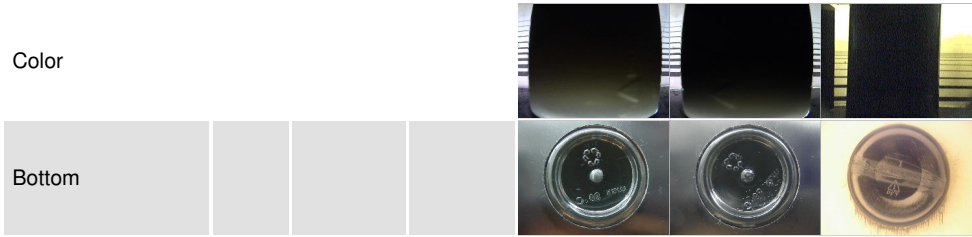

GRAPHS

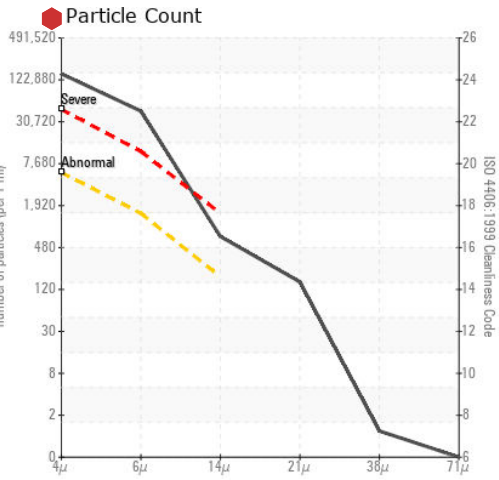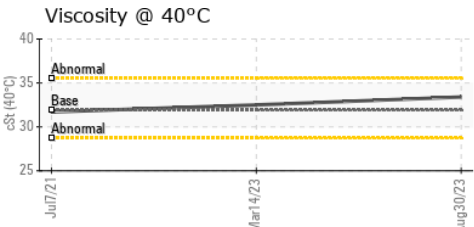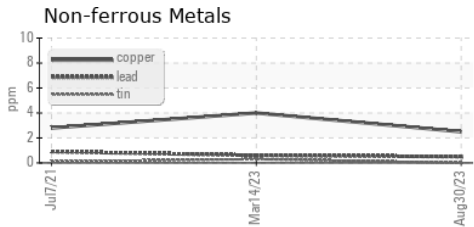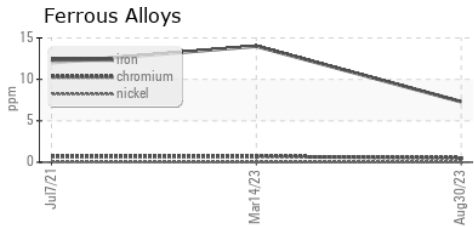

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 747 - GMA - Solid Waste
Sample No. : GFL0088824 **Received** : 05 Sep 2023
Lab Number : 02580395 **Diagnosed** : 06 Sep 2023
Unique Number : 5633455 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

4 Chemin du Tremblay,
 Boucherville, QC
 CA J4B 6Z5
 Contact: Steve Voyer
 svoyer@matrec.ca
 T: (450)641-3070
 F: