




OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Machine Id
911041
Component
Hydraulic System
Fluid
PETRO CANADA HYDREX MV 32 (--- GAL)

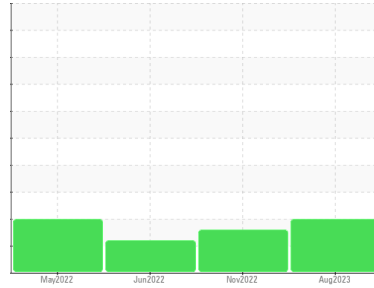

DIAGNOSIS

Recommendation

Vérifier les scelles et/ou les filtres pour des points d'entrée des contaminants. Le reniflard d'air doit être réparé. S'il n'est pas classé, nous vous recommandons de le remplacer par un reniflard à air adapté au micron et / ou au dessicant. Si évalué, nous vous recommandons de réparer / remplacer le reniflard. Nous avons pris note que le filtre a été remplacé au moment de l'échantillonnage. Échantillonner de nouveau dans 30 à 45 jours afin de contrôler la situation.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une grande quantité de limon (particules de 4 à 14 microns) dans l'huile.

Fluid Condition

L'huile peut encore servir si la contamination peut être réduite à un niveau acceptable.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GFL0087664	GFL0061766	GFL0053339
Sample Date	Client Info		29 Aug 2023	15 Nov 2022	08 Jun 2022
Machine Age	kms	Client Info	117031	3079	1840
Oil Age	kms	Client Info	0	0	0
Oil Changed	Client Info		Not Chngd	N/A	Not Chngd
Sample Status			SEVERE	ABNORMAL	ABNORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >50	48	13	17
Chromium	ppm	ASTM D5185(m) >10	6	2	<1
Nickel	ppm	ASTM D5185(m) >4	0	<1	0
Titanium	ppm	ASTM D5185(m)	<1	0	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m) >5	2	<1	<1
Lead	ppm	ASTM D5185(m) >4	0	<1	0
Copper	ppm	ASTM D5185(m) >15	<1	<1	1
Tin	ppm	ASTM D5185(m) >4	0	0	0
Antimony	ppm	ASTM D5185(m)	0	<1	<1
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<1	<1	<1
Barium	ppm	ASTM D5185(m) 0	0	0	0
Molybdenum	ppm	ASTM D5185(m) 0	<1	0	0
Manganese	ppm	ASTM D5185(m) 1	<1	0	0
Magnesium	ppm	ASTM D5185(m) 0	3	1	2
Calcium	ppm	ASTM D5185(m) 50	61	54	57
Phosphorus	ppm	ASTM D5185(m) 330	371	364	393
Zinc	ppm	ASTM D5185(m) 430	443	411	462
Sulfur	ppm	ASTM D5185(m) 760	826	811	923
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS




	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	6	2	4
Sodium	ppm	ASTM D5185(m)	20	6	12
Potassium	ppm	ASTM D5185(m) >20	2	<1	<1

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	83293	32483	21234
Particles >6µm	ASTM D7647	>1300	3018	4211	1083
Particles >14µm	ASTM D7647	>160	79	241	51
Particles >21µm	ASTM D7647	>40	18	49	12
Particles >38µm	ASTM D7647	>10	1	2	0
Particles >71µm	ASTM D7647	>3	0	1	0
Oil Cleanliness	ISO 4406 (c)	>19/17/14	24/19/13	22/19/15	22/17/13




OIL ANALYSIS REPORT

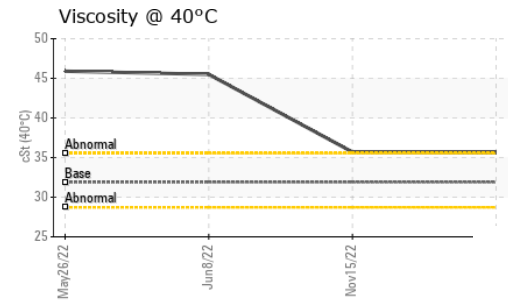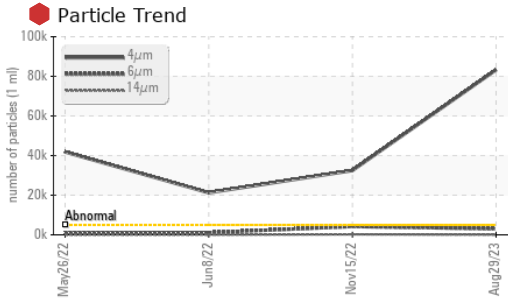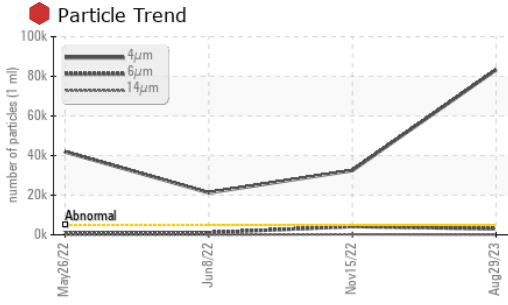





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	31.9	35.6	35.7 ▲ 45.5

SAMPLE IMAGES

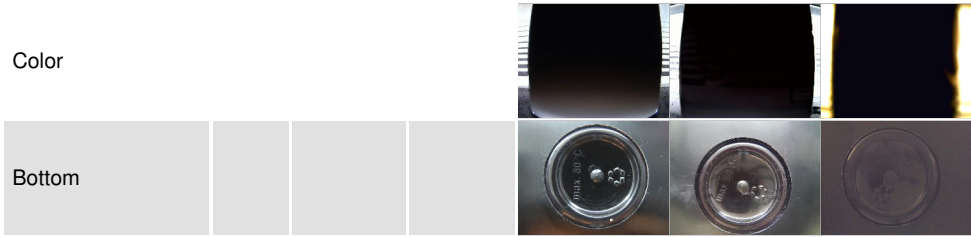

GRAPHS

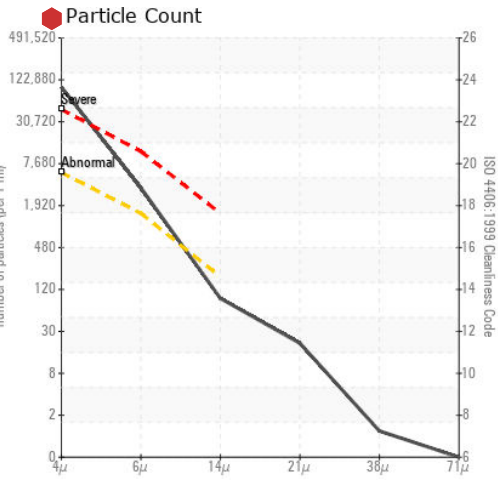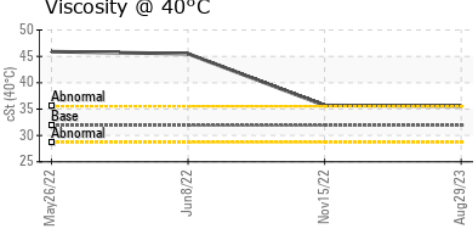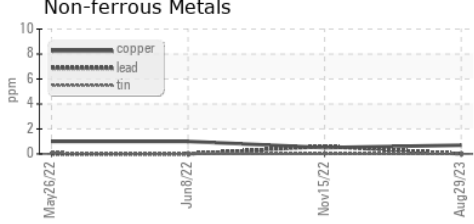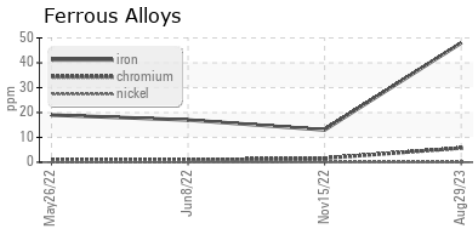

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 747 - GMA - Solid Waste
Sample No. : GFL0087664 **Received** : 05 Sep 2023
Lab Number : 02580409 **Diagnosed** : 06 Sep 2023
Unique Number : 5633469 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: PrtCount)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

4 Chemin du Tremblay,
 Boucherville, QC
 CA J4B 6Z5
 Contact: Steve Voyer
 svoyer@matrec.ca
 T: (450)641-3070
 F: