


OIL ANALYSIS REPORT

SHARP BUS LINES Machine Id INTERNATIONAL 1250

Component

Diesel Engine

PETRO CANADA DURON HP 15W40 (--- GAL)

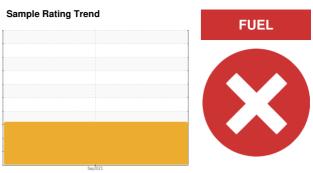

DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.


Fluid Condition

Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

							
AL)				Sep2023			
SAMPLE INFO	RMATION	method	limit/base	current	history1	history2	
Sample Number		Client Info		PC0081553			
Sample Date		Client Info		21 Sep 2023			
Machine Age	kms	Client Info		206758			
Oil Age	kms	Client Info		5000			
Oil Changed		Client Info		Changed			
Sample Status				SEVERE			
CONTAMINA	TION	method	limit/base	current	history1	history2	
Glycol		WC Method		NEG			
WEAR META	LS	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>100	23			
Chromium	ppm	ASTM D5185(m)	>20	<1			
Nickel	ppm	ASTM D5185(m)	>4	<1			
Titanium	ppm	ASTM D5185(m)		0			
Silver	ppm	ASTM D5185(m)	>3	0			
Aluminum	ppm	ASTM D5185(m)	>20	2			
Lead	ppm	ASTM D5185(m)	>40	0			
Copper	ppm	ASTM D5185(m)	>330	<1			
Tin	ppm	ASTM D5185(m)	>15	0			
Antimony	ppm	ASTM D5185(m)		0			
Vanadium	ppm	ASTM D5185(m)		0			
Beryllium	ppm	ASTM D5185(m)		0			
Cadmium	ppm	ASTM D5185(m)		0			
ADDITIVES		method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	0	2			
Barium	ppm	ASTM D5185(m)	0	0			
Molybdenum	ppm	ASTM D5185(m)	60	51			
Manganese	ppm	ASTM D5185(m)	0	<1			
Magnesium	ppm	ASTM D5185(m)	1010	789			
Calcium	ppm	ASTM D5185(m)	1070	819			
Phosphorus	ppm	ASTM D5185(m)	1150	862			
Zinc	ppm	ASTM D5185(m)	1270	953			
Sulfur		ASTM D5185(m)	2060	2141			
Lithium	ppm	ASTM D5185(m)	2000	<1			
	ppm	ASTIVI DSTOS(III)		<1			
CONTAMINA	NTS	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	4			
Sodium	ppm	ASTM D5185(m)		18			
Potassium	ppm	ASTM D5185(m)	>20	0			
Fuel	%	ASTM D7593*	>2.0	21.1			
INFRA-RED		method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>3	1.4			
Nitration	Abs/cm	ASTM D7624*	>20	11.2			
Sulfation	Abs/.1mm	ASTM D7415*	>30	26.0			
					hiotomit		
FLUID DEGRA			limit/base	current	history1	history2	
Oxidation	Abs/.1mm	ASTM D7414*	>25	25.0			



OIL ANALYSIS REPORT

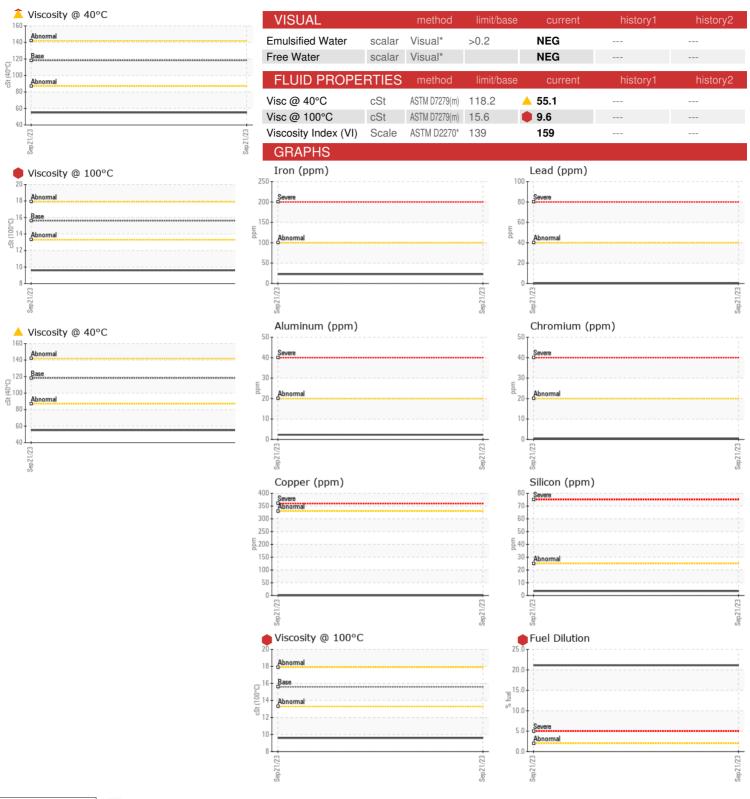



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : PC0081553 : 02584618

: 5645683

Received Diagnosed

: 22 Sep 2023 : 25 Sep 2023 Diagnostician : Bill Quesnel

Test Package : MOB 1 (Additional Tests: FuelDilution, KV40, PercentFuel, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

ICSB - Brantford 567 Oak Park Rd. Brantford, ON CA N3T 5L8 Contact: Doug Hall Djhall@sharpbus.com T: (519)751-3434