


OIL ANALYSIS REPORT

SHARP BUS LINES Machine Id INTERNATIONAL 1260

Component

Diesel Engine

PETRO CANADA DURON HP 15W40 (--- GAL)

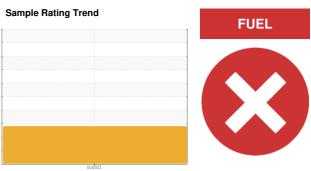

DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.


▲ Fluid Condition

Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

AL)				0::7023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PC0081541		
Sample Date		Client Info		05 Oct 2023		
Machine Age	kms	Client Info		256288		
Oil Age	kms	Client Info		7000		
Oil Changed	KIIIO	Client Info		Changed		
Sample Status		Oliciti illio		SEVERE		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>127	20		
Chromium	ppm	ASTM D5185(m)		<1		
Nickel	ppm	ASTM D5185(m)	>30	<1		
Titanium	ppm	ASTM D5185(m)	>2	0		
Silver	ppm	ASTM D5185(m)	>2	<1		
Aluminum	ppm	ASTM D5185(m)	>59	3		
Lead	ppm	ASTM D5185(m)	>29	<1		
Copper	ppm	ASTM D5185(m)	>135	<1		
Tin	ppm	ASTM D5185(m)	>2	0		
Antimony		ASTM D5185(m)	<i>></i> L	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium		ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
	ppm	ASTIVI DSTOS(III)		<u> </u>		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	2		
Barium	ppm	ASTM D5185(m)	0	<1		
Molybdenum	ppm	ASTM D5185(m)	60	50		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	1010	764		
Calcium	ppm	ASTM D5185(m)	1070	823		
Phosphorus	ppm	ASTM D5185(m)	1150	790		
Zinc	ppm	ASTM D5185(m)	1270	937		
Sulfur	ppm	ASTM D5185(m)	2060	2049		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>18	2		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Fuel	%	ASTM D7593*	>2.0	16.1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0.9		
Nitration	Abs/cm	ASTM D7624*	>20	9.5		
Sulfation	Abs/.1mm	ASTM D7024 ASTM D7415*	>30	24.0		
FLUID DEGRAD			limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	23.6		



OIL ANALYSIS REPORT

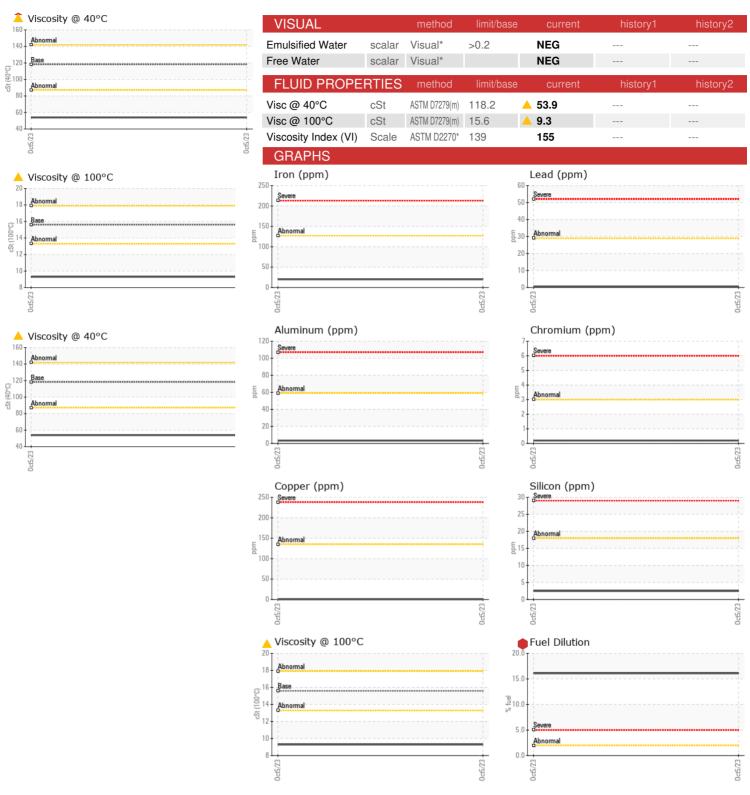



CALA ISO 17025:2017 Accredited

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : 02588825

: PC0081541 : 5657891

Received

: 13 Oct 2023 Diagnosed : 16 Oct 2023 Diagnostician : Wes Davis

Test Package : MOB 1 (Additional Tests: FuelDilution, KV40, PercentFuel, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

ICSB - Brantford 567 Oak Park Rd. Brantford, ON CA N3T 5L8 Contact: Doug Hall Djhall@sharpbus.com T: (519)751-3434