

Area
SHARP BUS LINES
Machine Id
INTERNATIONAL 1213
Component
Diesel Engine
Fluid
DIESEL ENGINE OIL SAE 15W40 (--- GAL)



DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a high amount of fuel present in the oil. Light concentration of carbon/soot present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition

Viscosity of sample indicates oil is within SAE 5W40 range, advise investigate. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			PC0081382	---	---
Sample Date	Client Info			28 Sep 2023	---	---
Machine Age	kms	Client Info		265123	---	---
Oil Age	kms	Client Info		4000	---	---
Oil Changed	Client Info			Changed	---	---
Sample Status				SEVERE	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Glycol	WC Method			NEG	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	54	---	---
Chromium	ppm	ASTM D5185(m)	>20	<1	---	---
Nickel	ppm	ASTM D5185(m)	>4	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>3	<1	---	---
Aluminum	ppm	ASTM D5185(m)	>20	4	---	---
Lead	ppm	ASTM D5185(m)	>40	2	---	---
Copper	ppm	ASTM D5185(m)	>330	<1	---	---
Tin	ppm	ASTM D5185(m)	>15	<1	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---


ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	3	---	---
Barium	ppm	ASTM D5185(m)	10	0	---	---
Molybdenum	ppm	ASTM D5185(m)	100	58	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	450	874	---	---
Calcium	ppm	ASTM D5185(m)	3000	945	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	876	---	---
Zinc	ppm	ASTM D5185(m)	1350	1066	---	---
Sulfur	ppm	ASTM D5185(m)	4250	2158	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	4	---	---
Sodium	ppm	ASTM D5185(m)	>158	2	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Fuel	%	ASTM D7593*	>2.0	9.7	---	---

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	3.9	---	---
Nitration	Abs/cm	ASTM D7624*	>20	14.9	---	---
Sulfation	Abs/.1mm	ASTM D7415*	>30	30.9	---	---

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	25.5	---	---












OIL ANALYSIS REPORT

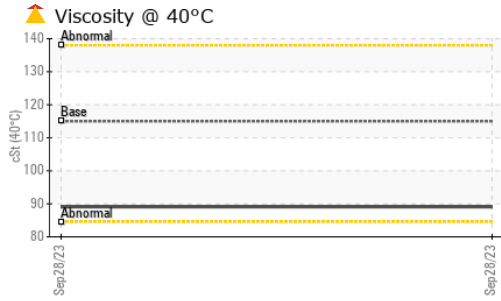

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	115	▲ 89.1	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	13.2	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	126	148	---	---

GRAPHS

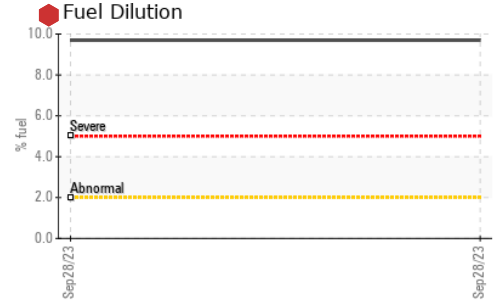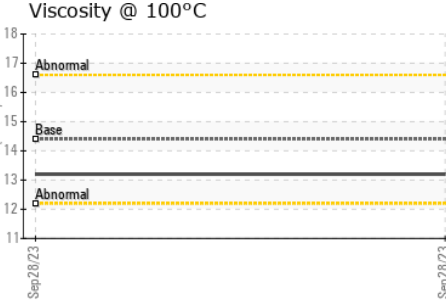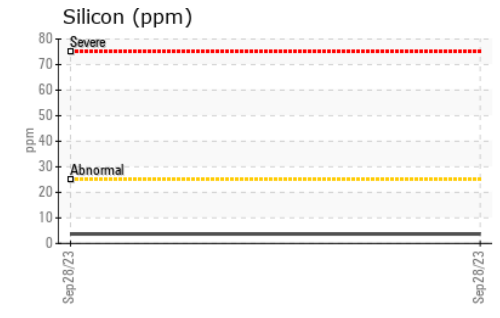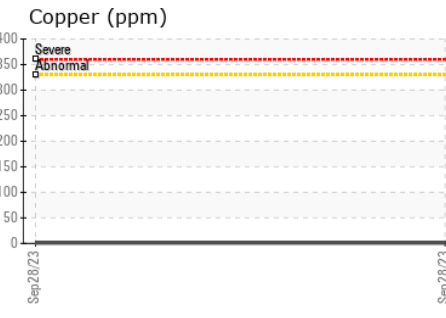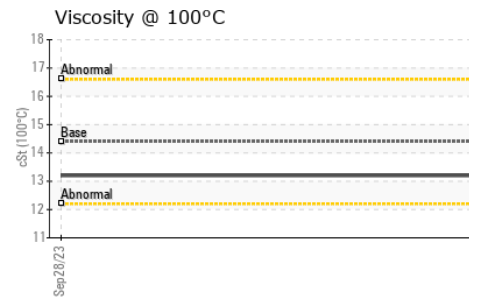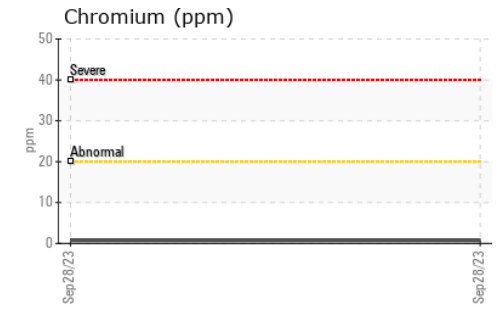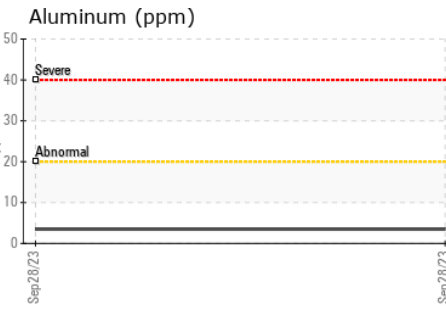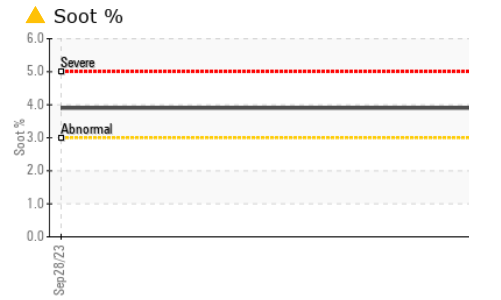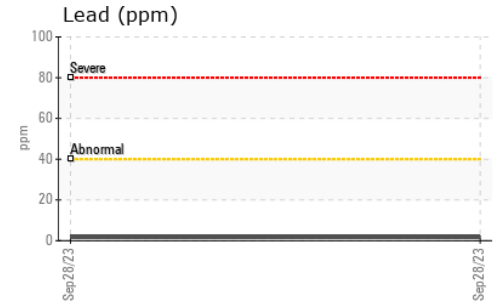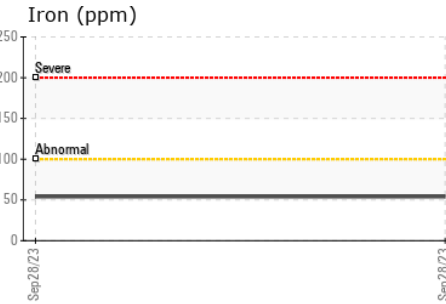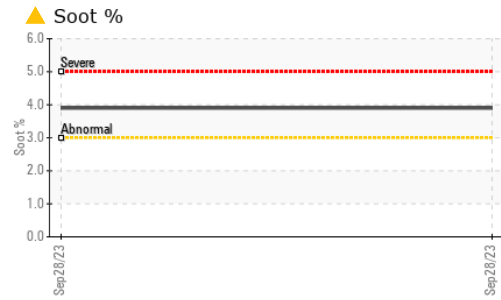

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC0081382 **Received** : 30 Oct 2023
Lab Number : **02592822** **Diagnosed** : 01 Nov 2023
Unique Number : 5669901 **Diagnostician** : Kevin Marson
Test Package : MOB 1 (Additional Tests: FuelDilution, KV40, PercentFuel, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

ICSB - Brantford
 567 Oak Park Rd.
 Brantford, ON
 CA N3T 5L8
 Contact: Doug Hall
 Djhall@sharpbus.com
 T: (519)751-3434
 F: