




Area
SHARP BUS LINES
Machine Id
INTERNATIONAL 1248
Component
Diesel Engine
Fluid
PETRO CANADA DURON HP 15W40 (--- GAL)

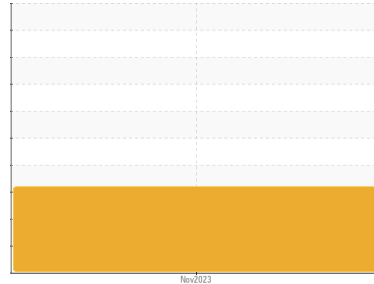

DIAGNOSIS

Recommendation
We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

Wear
All component wear rates are normal.

Contamination
There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition
Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION method limit/base current history1 history2

Sample Number	Client Info	PC0081527	---	---
Sample Date	Client Info	01 Nov 2023	---	---
Machine Age	kms Client Info	205224	---	---
Oil Age	kms Client Info	3250	---	---
Oil Changed	Client Info	Changed	---	---
Sample Status		SEVERE	---	---

CONTAMINATION method limit/base current history1 history2

Water	WC Method	>0.2	NEG	---	---
Glycol	WC Method		NEG	---	---

WEAR METALS method limit/base current history1 history2

Iron	ppm	ASTM D5185(m)	>127	23	---	---
Chromium	ppm	ASTM D5185(m)	>3	<1	---	---
Nickel	ppm	ASTM D5185(m)	>30	0	---	---
Titanium	ppm	ASTM D5185(m)	>2	0	---	---
Silver	ppm	ASTM D5185(m)	>2	<1	---	---
Aluminum	ppm	ASTM D5185(m)	>59	2	---	---
Lead	ppm	ASTM D5185(m)	>29	2	---	---
Copper	ppm	ASTM D5185(m)	>135	<1	---	---
Tin	ppm	ASTM D5185(m)	>2	<1	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES method limit/base current history1 history2

Boron	ppm	ASTM D5185(m)	0	2	---	---
Barium	ppm	ASTM D5185(m)	0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	60	49	---	---
Manganese	ppm	ASTM D5185(m)	0	0	---	---
Magnesium	ppm	ASTM D5185(m)	1010	778	---	---
Calcium	ppm	ASTM D5185(m)	1070	851	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	822	---	---
Zinc	ppm	ASTM D5185(m)	1270	961	---	---
Sulfur	ppm	ASTM D5185(m)	2060	2082	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---




CONTAMINANTS method limit/base current history1 history2

Silicon	ppm	ASTM D5185(m)	>18	6	---	---
Sodium	ppm	ASTM D5185(m)		2	---	---
Potassium	ppm	ASTM D5185(m)	>20	0	---	---
Fuel	%	ASTM D7593*	>2.0	13.2	---	---

INFRA-RED method limit/base current history1 history2

Soot %	%	ASTM D7844*	>3	0.9	---	---
Nitration	Abs/cm	ASTM D7624*	>20	9.3	---	---
Sulfation	Abs.1mm	ASTM D7415*	>30	22.9	---	---

OIL ANALYSIS REPORT






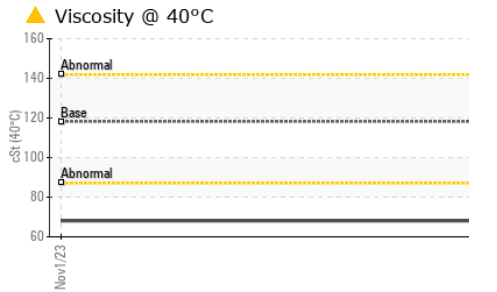
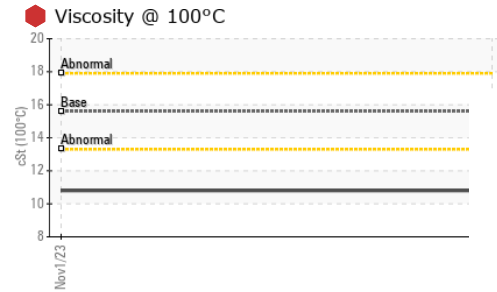
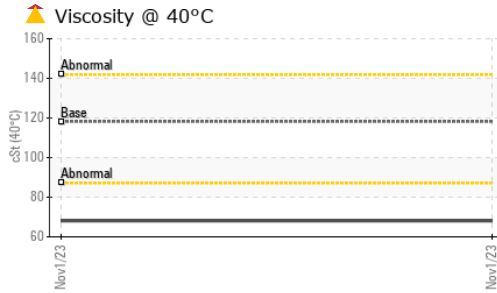


FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs./1mm	ASTM D7414*	>25	20.3	---	---

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	118.2	68.1	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.6	10.8	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	139	148	---	---

GRAPHS

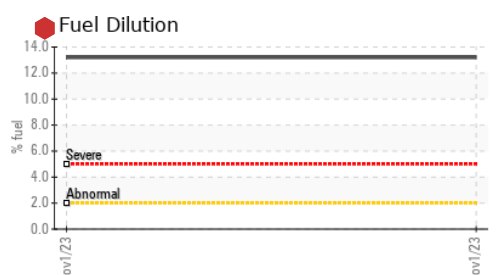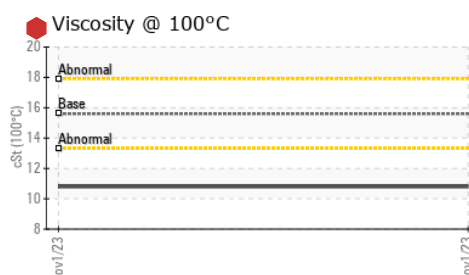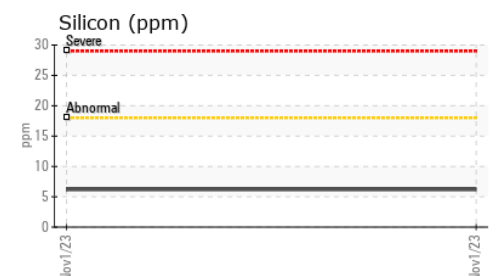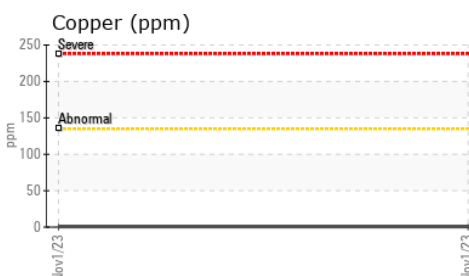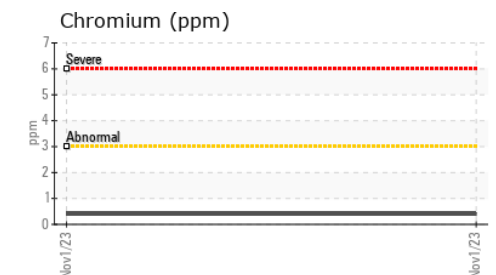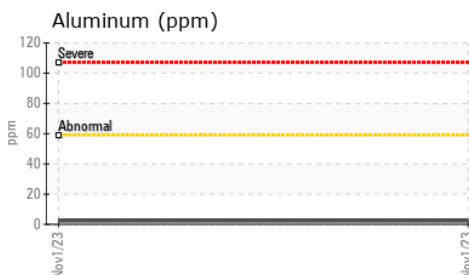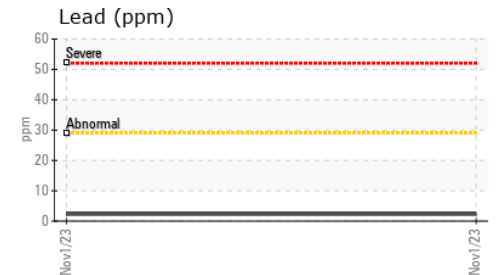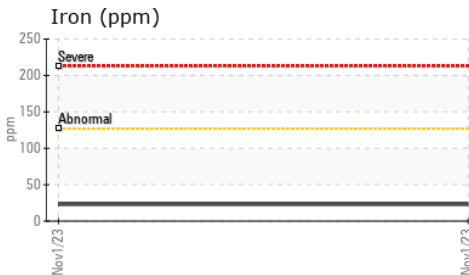

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC0081527 **Received** : 22 Nov 2023
Lab Number : **02598159** **Diagnosed** : 23 Nov 2023
Unique Number : 5683239 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: FuelDilution, KV40, PercentFuel, VI)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

ICSB - Brantford
 567 Oak Park Rd.
 Brantford, ON
 CA N3T 5L8
 Contact: Doug Hall
 Djhall@sharpbus.com
 T: (519)751-3434
 F: