

Area
SHARP BUS LINES
Machine Id
IC 1098
Component
Diesel Engine
Fluid
PETRO CANADA DURON SHP 15W40 (--- GAL)



DIAGNOSIS

Recommendation

We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of fuel present in the oil. Light concentration of carbon/soot present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition

The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			PC0081470	---	---
Sample Date	Client Info			18 Oct 2023	---	---
Machine Age	kms	Client Info		291232	---	---
Oil Age	kms	Client Info		2918	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				ABNORMAL	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method	>0.2		NEG	---	---
Glycol	WC Method			NEG	---	---





WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	41	---	---
Chromium	ppm	ASTM D5185(m)	>20	<1	---	---
Nickel	ppm	ASTM D5185(m)	>4	<1	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)	>3	<1	---	---
Aluminum	ppm	ASTM D5185(m)	>20	7	---	---
Lead	ppm	ASTM D5185(m)	>40	<1	---	---
Copper	ppm	ASTM D5185(m)	>330	<1	---	---
Tin	ppm	ASTM D5185(m)	>15	0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	2	---	---
Barium	ppm	ASTM D5185(m)	0	0	---	---
Molybdenum	ppm	ASTM D5185(m)	60	53	---	---
Manganese	ppm	ASTM D5185(m)	0	0	---	---
Magnesium	ppm	ASTM D5185(m)	1010	824	---	---
Calcium	ppm	ASTM D5185(m)	1070	943	---	---
Phosphorus	ppm	ASTM D5185(m)	1150	890	---	---
Zinc	ppm	ASTM D5185(m)	1270	1039	---	---
Sulfur	ppm	ASTM D5185(m)	2060	2229	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	2	---	---
Sodium	ppm	ASTM D5185(m)		2	---	---
Potassium	ppm	ASTM D5185(m)	>20	<1	---	---
Fuel	%	ASTM D7593*	>5	▲ 7.3	---	---

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	▲ 3.6	---	---
Nitration	Abs/cm	ASTM D7624*	>20	11.6	---	---
Sulfation	Abs./1mm	ASTM D7415*	>30	27.0	---	---

OIL ANALYSIS REPORT





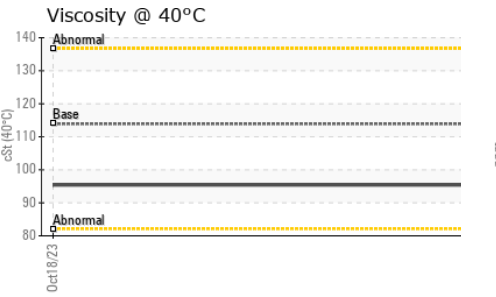
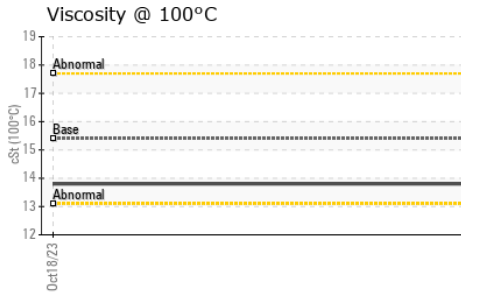
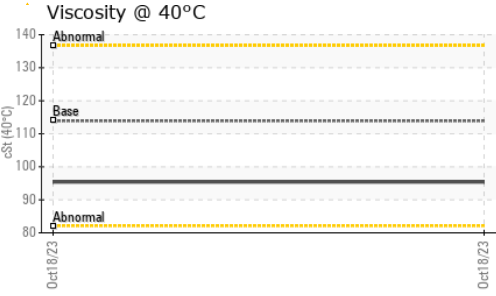
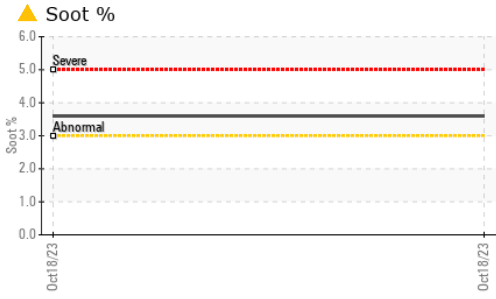


FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs./1mm	ASTM D7414*	>25	16.7	---	---

VISUAL		method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	113.9	95.4	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	13.8	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	142	146	---	---

GRAPHS

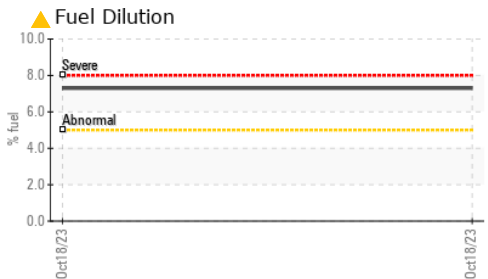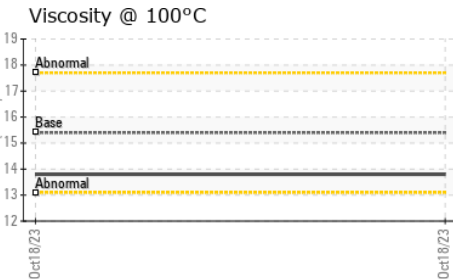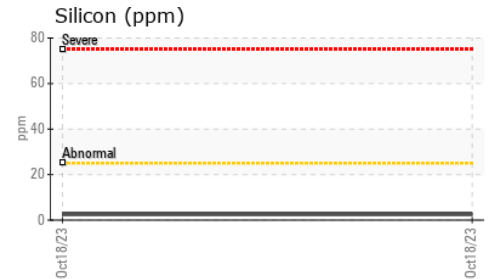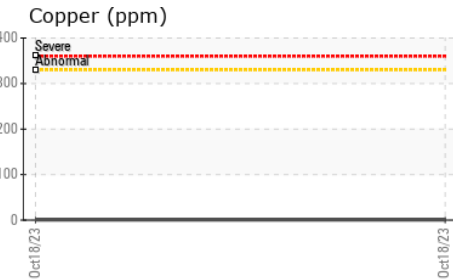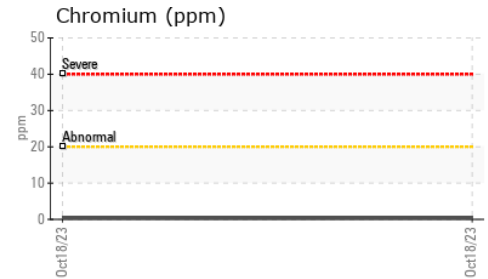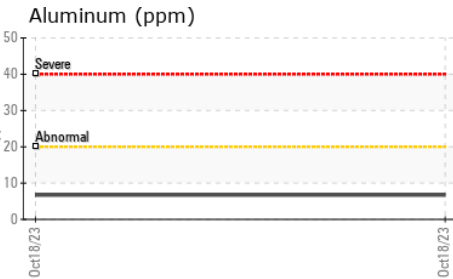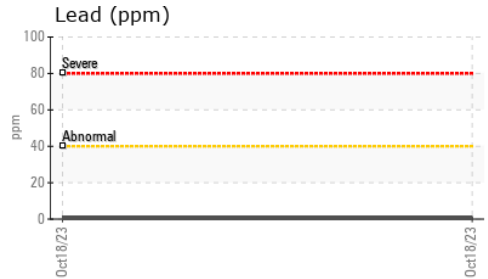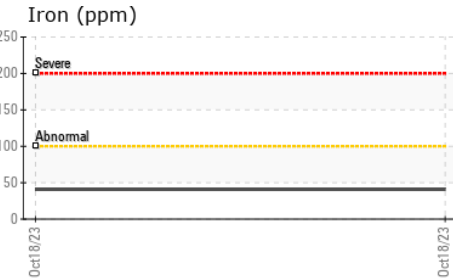

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC0081470 **Received** : 24 Nov 2023
Lab Number : 02598638 **Diagnosed** : 27 Nov 2023
Unique Number : 5683718 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: FuelDilution, KV40, PercentFuel, VI)

ICSB - Brantford
 567 Oak Park Rd.
 Brantford, ON
 CA N3T 5L8
 Contact: Doug Hall
 Djhall@sharpbus.com
 T: (519)751-3434
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.