

OIL ANALYSIS REPORT

EX0300

Component **Hydraulic System**

NOT GIVEN (--- GAL)

Sample Rating Trend

DIAGNOSIS

Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. The filter change at the time of sampling has been noted. Resample in 30-45 days to monitor this situation. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

There is a high amount of silt (particulates < 14 microns in size) present in the oil.


Fluid Condition

The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

				Nov2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0094023		
Sample Date		Client Info		28 Nov 2023		
Machine Age	kms	Client Info		0		
Oil Age	kms	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				SEVERE		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron		ASTM D5185(m)	>65	18		
Chromium	ppm	ASTM D5185(m)	>6	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)	>10	0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	. ,	. E	<1		
Lead	ppm	ASTM D5185(m) ASTM D5185(m)	>5 >45	1		
	ppm	ASTM D5185(m)	>120	6		
Copper	ppm	, ,	>120	0		
	ppm	ASTM D5185(m)	>4	0		
Antimony	ppm	ASTM D5185(m)		-		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		6		
Calcium	ppm	ASTM D5185(m)		62		
Phosphorus	ppm	ASTM D5185(m)		269		
Zinc	ppm	ASTM D5185(m)		283		
Sulfur	ppm	ASTM D5185(m)		5189		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	2		
Sodium	ppm	ASTM D5185(m)		3		
Potassium	ppm	ASTM D5185(m)	>20	2		
FLUID CLEAN	LINESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	50597		
Particles >6µm		ASTM D7647	>1300	10967		
Particles >14µm		ASTM D7647	>160	▲ 310		
Particles >21µm		ASTM D7647	>40	42		
Particles >38µm		ASTM D7647	>10	2		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	23/21/15		



OIL ANALYSIS REPORT

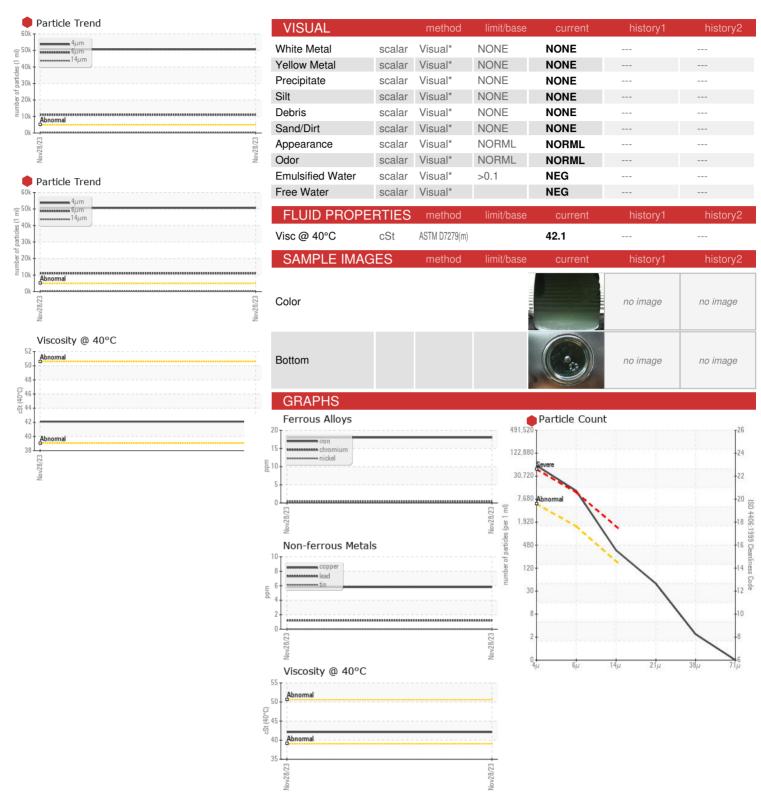



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: GFL0094023 : 02601885

: 5694970

Received

: 08 Dec 2023 : 09 Dec 2023

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 968 - Boylston 151 Waste Management Road Hiwy 16 Boylston, NS

Diagnosed : Wes Davis Diagnostician Test Package : MOB 1 (Additional Tests: PrtCount)

CA B0H 1G0 Contact: Bruce Avery bruce.avery@gflenv.com T:

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

F: