

OIL ANALYSIS REPORT

Scissor Decks XLIFT195

Component

Rear Differential

GEAR OIL SAE 90 (--- GAL)

Sample Rating Trend



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 90. Please confirm.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Nov2023		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PC0074976		
Sample Date		Client Info		24 Nov 2023		
Machine Age	hrs	Client Info		1023		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	204		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	2		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>100	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	400	1		
Barium	ppm	ASTM D5185(m)	200	3		
Molybdenum	ppm	ASTM D5185(m)	12	0		
Manganese	ppm	ASTM D5185(m)		13		
Magnesium	ppm	ASTM D5185(m)	12	5		
Calcium	ppm	ASTM D5185(m)	150	130		
Phosphorus	ppm	ASTM D5185(m)	1650	1621		
Zinc	ppm	ASTM D5185(m)	125	80		
Sulfur	ppm	ASTM D5185(m)	22500	20562		
Lithium	ppm	ASTM D5185(m)		6		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	13		
Sodium	ppm	ASTM D5185(m)		6		
Potassium	ppm	ASTM D5185(m)	>20	3		



OIL ANALYSIS REPORT

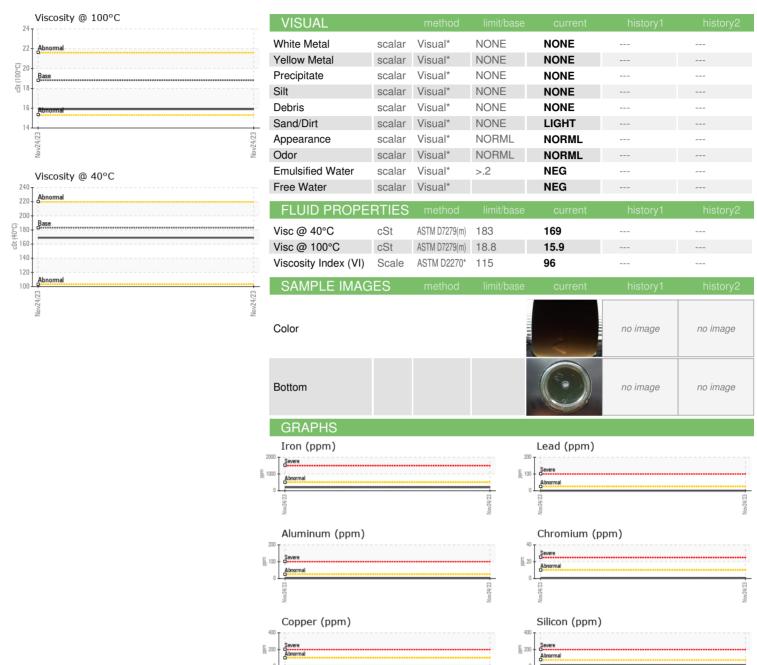



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : PC0074976

: 02604472

: 5697557

Recieved

: 20 Dec 2023 Diagnosed

Diagnostician : Wes Davis

: 20 Dec 2023

Additives

Timmins, ON

Lakeshore Gold Timmins West

Test Package : MOB 1 (Additional Tests: KV100, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Viscosity @ 40°C

Contact: Dale Arseneau darseneau@ca.panamericansilver.com

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (705)269-4344

CA