


OIL ANALYSIS REPORT



525002 **Diesel Engine**

PETRO CANADA DURON SHP 15W40 (--- GAL)

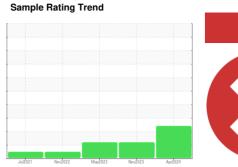



DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

▲ Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

Fluid Condition

Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

W 3HF 15W40 (-	GAL)	Jui2021	NOVZUZZ	May2023 NOV2023	Aprzuz4	
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0113202	GFL0097319	GFL0082549
Sample Date		Client Info		24 Apr 2024	14 Nov 2023	25 May 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		26985	22642	598950
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				SEVERE	ABNORMAL	ABNORMAL
CONTAMINA	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METAI	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>120	2	1	2
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>5	0	0	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	<1
Silver	ppm	ASTM D5185(m)	>2	0	<1	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>40	0	<1	<1
Copper	ppm	ASTM D5185(m)	>330	<1	1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	6	6	7
Barium	ppm	ASTM D5185(m)	0	0	<1	0
Molybdenum	ppm	ASTM D5185(m)	60	53	55	54
Manganese	ppm	ASTM D5185(m)	0	0	0	<1
Magnesium	ppm	ASTM D5185(m)	1010	874	894	905
Calcium	ppm	ASTM D5185(m)	1070	980	980	1071
Phosphorus	ppm	ASTM D5185(m)	1150	922	943	1058
Zinc	ppm	ASTM D5185(m)	1270	1076	1100	1130
Sulfur	ppm	ASTM D5185(m)	2060	2391	2462	2590
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	<1	0	3
Sodium	ppm	ASTM D5185(m)		1	<1	1
Potassium	ppm	ASTM D5185(m)	>20	<1	0	0
Fuel	%	ASTM D7593*	>3.0	▲ 5.8	▲ 3.7	▲ 3.9
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>4	0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	6.2	4.9	5.3
Sulfation	Abs/.1mm	ASTM D7415*	>30	17.7	17.6	17.3



OIL ANALYSIS REPORT





CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02631541 Unique Number : 5772694

10

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : GFL0113202 Received : 26 Apr 2024

Tested : 29 Apr 2024 Diagnosed

Vov14/23

: 29 Apr 2024 - Wes Davis Test Package: MOB 1 (Additional Tests: PercentFuel, Visual)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Viscosity @ 100°C

GFL Environmental - 246 - Windsor 2700 Deziel Dr

▲ Fuel Dilution

0.0

Windsor, ON **CA N8W 5H8** Contact: Dave Varga dvarga@gflenv.com T: (519)944-8009

Nov14/23

13.2

NORML

NEG

NEG

Vov14/23

Submitted By: Dave Varga