


OIL ANALYSIS REPORT

. _ _

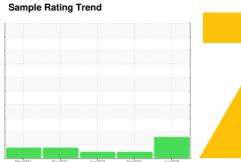

DIRT

Machine Id
351069
Component
Diesel Engine

PETRO CANADA DURON HP 15W40 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check the air filter, air induction system, and any areas where dirt may enter the component. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition. No other corrective action is recommended at this time.

Wear

All component wear rates are normal.

Contamination

Light fuel dilution occurring. There is a moderate concentration of dirt present in the oil. No other contaminants were detected in the oil.


Fluid Condition

The oil is no longer serviceable due to the presence of contaminants.

AL)		May2021	Dec2022	Jun2023 Dec2023	Jun 2024	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0125521	GFL0100656	GFL0077038
Sample Date		Client Info		29 Jun 2024	26 Dec 2023	29 Jun 2023
Machine Age	mls	Client Info		369412	225634	2808
Oil Age	mls	Client Info		0	0	0
Oil Changed		Client Info		Changed	Changed	Changed
Sample Status				ABNORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	6	17	23
Chromium	ppm	ASTM D5185(m)	>20	<1	1	1
Nickel	ppm	ASTM D5185(m)	>2	0	0	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	<1	<1	<1
Aluminum	ppm	ASTM D5185(m)	>25	1	3	3
Lead	ppm	ASTM D5185(m)	>40	0	<1	<1
Copper	ppm	ASTM D5185(m)	>330	<1	<1	1
Tin	ppm	ASTM D5185(m)	>15	0	<1	<1
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	2	3	3
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	60	58	59	58
Manganese	ppm	ASTM D5185(m)	0	0	0	<1
Magnesium	ppm	ASTM D5185(m)	1010	960	924	949
Calcium	ppm	ASTM D5185(m)	1070	1014	1013	1031
Phosphorus	ppm	ASTM D5185(m)	1150	1030	964	1032
Zinc	ppm	ASTM D5185(m)	1270	1173	1134	1178
Sulfur	ppm	ASTM D5185(m)	2060	2632	2583	2455
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	△ 25	4	4
Sodium	ppm	ASTM D5185(m)		2	2	2
Potassium	ppm	ASTM D5185(m)	>20	0	<1	0
Fuel	%	ASTM D7593*	>5	1.5	<1.0	<1.0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0	0.2	0.1
Nitration	Abs/cm	ASTM D7624*	>20	7.4	13.0	12.6
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.3	24.6	24.5



OIL ANALYSIS REPORT

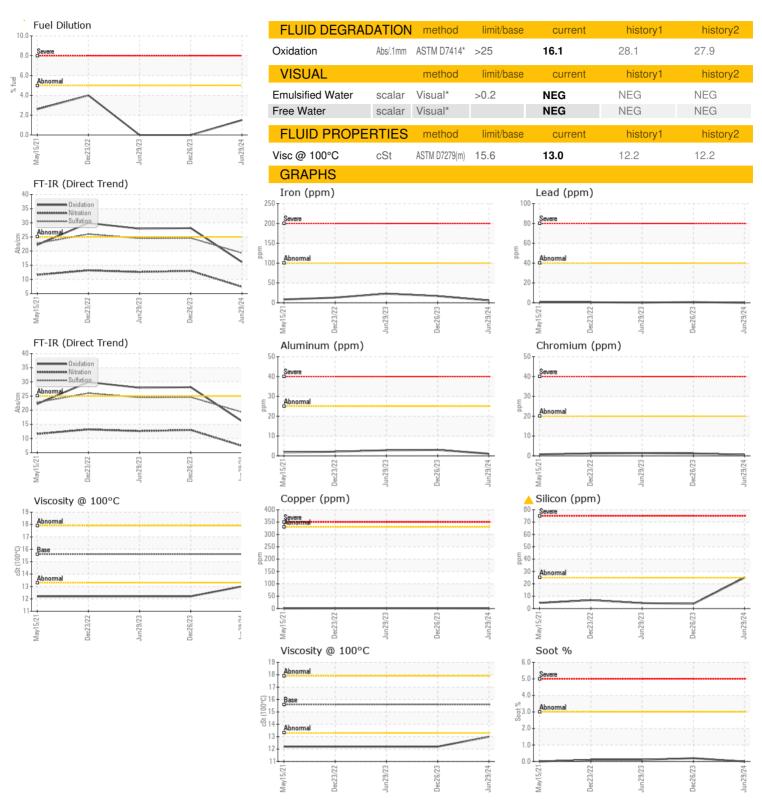



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

Lab Number : 02645763 Unique Number : 5803302

: GFL0125521

Received **Tested** Diagnosed : 05 Jul 2024

: 08 Jul 2024

: 08 Jul 2024 - Kevin Marson

Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 GFL Environmental - 575 - Squamish Hauling

38950 Queens Way, Squamish, BC **CA V8B 0K8**

Contact: Dean Imbeau dimbeau@gflenv.com

T: (604)892-5604 F: (604)892-5238

Submitted By: Jonas Araujo