


Area
TEAM 1
Machine Id
136120 ID Fan Inboard

Component
Bearing
Fluid
PETRO CANADA TURBOFLO R&O 68 (4 QTS)

Sample Rating Trend

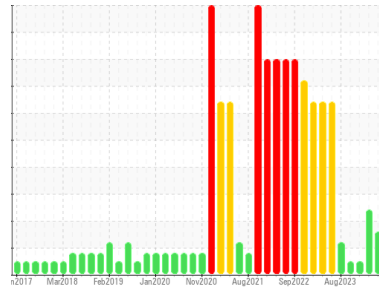

DIAGNOSIS

Recommendation
Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition.

Wear
All component wear rates are normal.

Contamination
Elemental level of silicon (Si) above normal indicating ingress of seal material and/or dirt.

Fluid Condition
The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PC0078830	PC0076930	PC0069860
Sample Date	Client Info	03 Jul 2024	22 Jan 2024	06 Oct 2023
Machine Age	hrs	0	0	0
Oil Age	hrs	0	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		ABNORMAL	ABNORMAL	NORMAL

CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >2	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185(m) >20	2	4	<1
Chromium	ppm ASTM D5185(m) >20	0	0	0
Nickel	ppm ASTM D5185(m) >20	<1	0	0
Titanium	ppm ASTM D5185(m)	0	0	0
Silver	ppm ASTM D5185(m)	0	0	<1
Aluminum	ppm ASTM D5185(m) >20	<1	<1	0
Lead	ppm ASTM D5185(m) >20	20	17	4
Copper	ppm ASTM D5185(m) >20	4	3	<1
Tin	ppm ASTM D5185(m) >20	2	4	0
Antimony	ppm ASTM D5185(m)	0	1	0
Vanadium	ppm ASTM D5185(m)	0	0	0
Beryllium	ppm ASTM D5185(m)	0	0	0
Cadmium	ppm ASTM D5185(m)	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185(m)	<1	0	<1
Barium	ppm ASTM D5185(m)	0	0	<1
Molybdenum	ppm ASTM D5185(m)	0	0	0
Manganese	ppm ASTM D5185(m)	<1	0	0
Magnesium	ppm ASTM D5185(m)	0	<1	0
Calcium	ppm ASTM D5185(m) 0	1	1	<1
Phosphorus	ppm ASTM D5185(m) 4	14	13	5
Zinc	ppm ASTM D5185(m) 0	11	8	1
Sulfur	ppm ASTM D5185(m)	157	151	145
Lithium	ppm ASTM D5185(m)	<1	<1	<1






CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185(m) >15	▲ 26	▲ 27	0
Sodium	ppm ASTM D5185(m)	7	8	<1
Potassium	ppm ASTM D5185(m) >20	1	1	0

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g ASTM D974* 0.11	0.04	0.05	0.10


OIL ANALYSIS REPORT

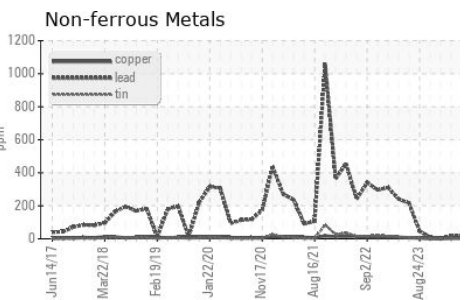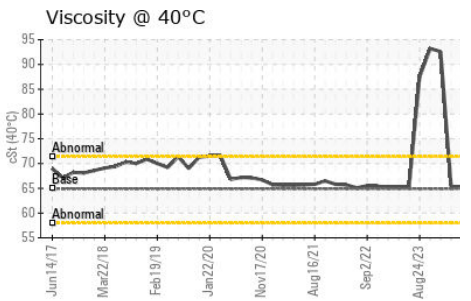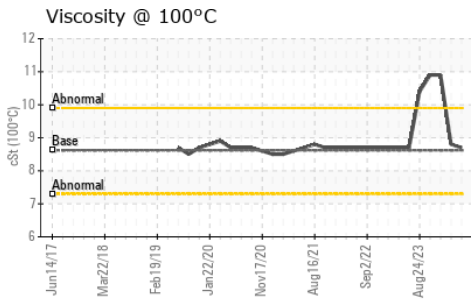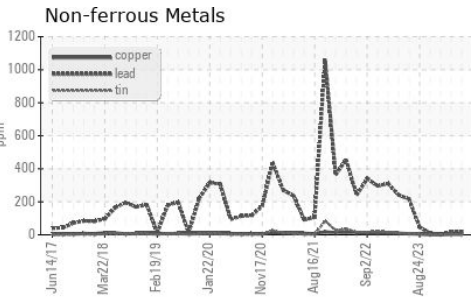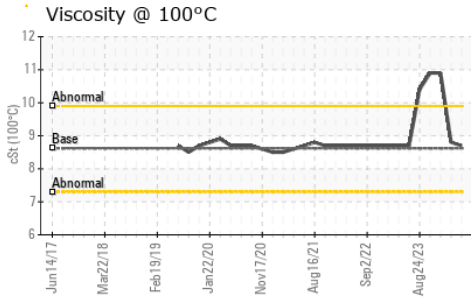


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	HAZY	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	64.9	65.4	92.6
Visc @ 100°C	cSt	ASTM D7279(m)	8.62	8.8	10.9
Viscosity Index (VI)	Scale	ASTM D2270*	104	107	101

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

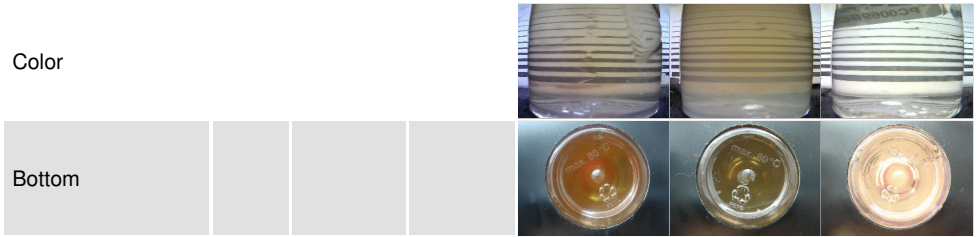

GRAPHS

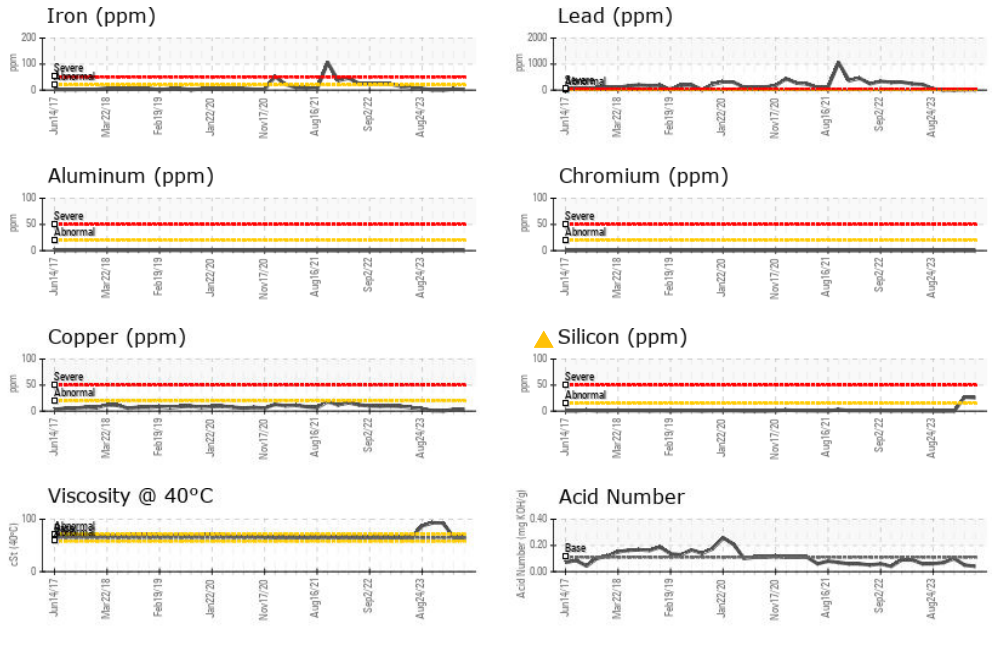

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PC0078830 **Received** : 10 Jul 2024
Lab Number : 02647027 **Tested** : 10 Jul 2024
Unique Number : 5812579 **Diagnosed** : 11 Jul 2024 - Kevin Marson
Test Package : MOB 2 (Additional Tests: KV100, TAN Man, VI)

Dryden Fibre
 Box 3001, 1 Duke Street
 Dryden, ON
 CA P8N 2Z7
 Contact: Adebukola Adekanye
 aadekanye@drydenfibre.ca
 T: (807)223-9950
 F: (807)223-9176

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.