


OIL ANALYSIS REPORT

(89817X) Walgreens [Walgreens] 136A68029

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

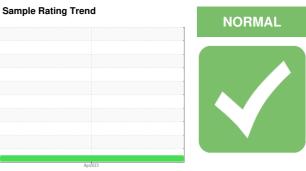

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Metal levels are typical for a components first oil change.

Contamination

There is no indication of any contamination in the


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

| GAL) | | | | Apr2023 | | |
|------------------|----------|-------------|------------|-------------|----------|----------|
| SAMPLE INFOR | MATION | method | limit/base | current | history1 | history2 |
| Sample Number | | Client Info | | PCA0096565 | | |
| Sample Date | | Client Info | | 10 Apr 2023 | | |
| Machine Age | mls | Client Info | | 163510 | | |
| Oil Age | mls | Client Info | | 163510 | | |
| Oil Changed | | Client Info | | Changed | | |
| Sample Status | | | | NORMAL | | |
| CONTAMINAT | ION | method | limit/base | current | history1 | history2 |
| Fuel | | WC Method | >5 | <1.0 | | |
| Glycol | | WC Method | | NEG | | |
| WEAR METAL | _S | method | limit/base | current | history1 | history2 |
| Iron | ppm | ASTM D5185m | >80 | 22 | | |
| Chromium | ppm | ASTM D5185m | >5 | <1 | | |
| Nickel | ppm | ASTM D5185m | >2 | 0 | | |
| Titanium | ppm | ASTM D5185m | | 6 | | |
| Silver | ppm | ASTM D5185m | >3 | 0 | | |
| Aluminum | ppm | ASTM D5185m | >30 | 0 | | |
| Lead | ppm | ASTM D5185m | >30 | 0 | | |
| Copper | ppm | ASTM D5185m | >150 | 1 | | |
| Tin | ppm | ASTM D5185m | >5 | 0 | | |
| Vanadium | ppm | ASTM D5185m | | 0 | | |
| Cadmium | ppm | ASTM D5185m | | 0 | | |
| ADDITIVES | | method | limit/base | current | history1 | history2 |
| Boron | ppm | ASTM D5185m | 2 | 5 | | |
| Barium | ppm | ASTM D5185m | 0 | 0 | | |
| Molybdenum | ppm | ASTM D5185m | 50 | 47 | | |
| Manganese | ppm | ASTM D5185m | 0 | <1 | | |
| Magnesium | ppm | ASTM D5185m | 950 | 694 | | |
| Calcium | ppm | ASTM D5185m | 1050 | 1216 | | |
| Phosphorus | ppm | ASTM D5185m | 995 | 918 | | |
| Zinc | ppm | ASTM D5185m | 1180 | 1111 | | |
| Sulfur | ppm | ASTM D5185m | 2600 | 3015 | | |
| CONTAMINAN | NTS | method | limit/base | current | history1 | history2 |
| Silicon | ppm | ASTM D5185m | >20 | 5 | | |
| Sodium | ppm | ASTM D5185m | | 15 | | |
| Potassium | ppm | ASTM D5185m | >20 | 20 | | |
| INFRA-RED | | method | limit/base | current | history1 | history2 |
| Soot % | % | *ASTM D7844 | >3 | 0.5 | | |
| Nitration | Abs/cm | *ASTM D7624 | >20 | 9.6 | | |
| Sulfation | Abs/.1mm | *ASTM D7415 | >30 | 21.0 | | |
| FLUID DEGRA | DATION | method | limit/base | current | history1 | history2 |
| Oxidation | Abs/.1mm | *ASTM D7414 | >25 | 17.1 | | |
| Base Number (BN) | | ASTM D2896 | | 6.6 | | |
| () | 0 - 3 | | | | | |



OIL ANALYSIS REPORT

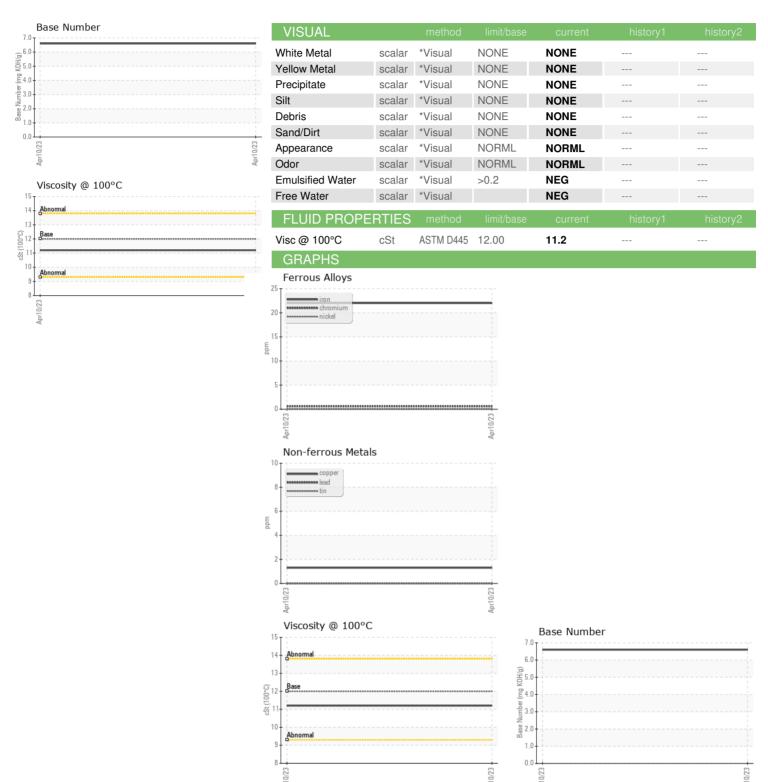





Certificate L2367

Laboratory Sample No. Lab Number

Unique Number

: PCA0096565 : 05827124 : 10440617 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 24 Apr 2023

: 25 Apr 2023 Diagnosed : Wes Davis Diagnostician

Transervice - Shop 1376 - Berkeley-Linden 3425 Tremley Point Road

Linden, NJ US 07036

Contact: Shop 1376 Oil Analysis shop1376@transervice.com T:

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: