

OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



734063 Component

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- 0

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

iAL)				Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0100783		
Sample Date		Client Info		29 Jul 2023		
Machine Age	mls	Client Info		92891		
Oil Age	mls	Client Info		92891		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>100	57		
Chromium	ppm	ASTM D5185m	>20	3		
Nickel	ppm	ASTM D5185m	>4	<1		
Γitanium	ppm	ASTM D5185m		2		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	31		
_ead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	63		
Γin	ppm	ASTM D5185m	>15	3		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	6		
Barium	ppm	ASTM D5185m	0	2		
Molybdenum	ppm	ASTM D5185m	50	77		
Manganese	ppm	ASTM D5185m	0	1		
Magnesium	ppm	ASTM D5185m	950	1157		
Calcium	ppm	ASTM D5185m	1050	1710		
Phosphorus	ppm	ASTM D5185m	995	1280		
Zinc	ppm	ASTM D5185m	1180	1607		
Sulfur	ppm	ASTM D5185m	2600	3105		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	7		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	57		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.9		
Vitration	Abs/cm	*ASTM D7624	>20	11.5		
Sulfation	Abs/.1mm	*ASTM D7415	>30	22.9		
FLUID DEGRA	NOITAC	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	22.7		
Base Number (BN)	mg KOH/g	ASTM D2896		5.5		

Contact/Location: ROSTY VITER - MILPHINE



OIL ANALYSIS REPORT

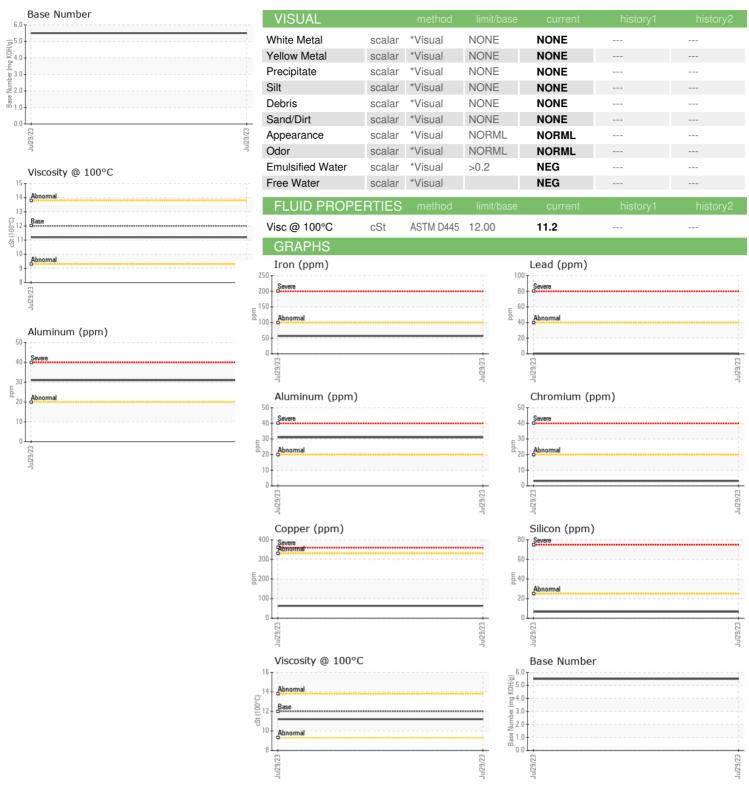





Laboratory Sample No.

Lab Number **Unique Number**

: PCA0100783 : 05921271 : 10593185

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Received : 10 Aug 2023 Diagnosed Diagnostician : Sean Felton

: 11 Aug 2023

Test Package : MOB 1 (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #118

2196 BENNETT ROAD PHILADELPHIA, PA US 19116

Contact: ROSTY VITER rviter@millertransgroup.com

Contact/Location: ROSTY VITER - MILPHINE

T: (215)552-9832 F: (215)552-9892