


# PROBLEM SUMMARY

Sample Rating Trend



**VIS DEBRIS**

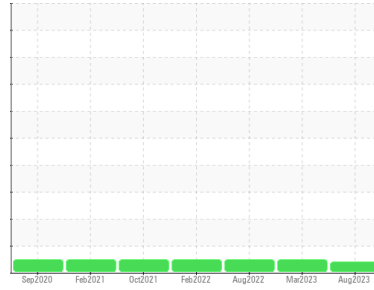

Machine Id  
**VILTER VILTER 5 (S/N 201373)**  
 Component  
**Compressor**  
 Fluid  
**PETRO CANADA REFLO SYNTHETIC 68A LOW TEMP FLUID (--- GAL)**

## COMPONENT CONDITION SUMMARY

No relevant graphs to display

## RECOMMENDATION

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

## PROBLEMATIC TEST RESULTS

Sample Status		ABNORMAL	NORMAL	NORMAL
Debris	scalar *Visual	▲ MODER	LIGHT	NONE

**Customer Id:** SMICUD  
**Sample No.:** PCA0102076  
**Lab Number:** 05933750  
**Test Package:** IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Don Baldrige +1  
[don.b505@comcast.net](mailto:don.b505@comcast.net)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Change Filter	---	---	?	We recommend you service the filters on this component if applicable.

## HISTORICAL DIAGNOSIS

**09 Mar 2023 Diag: Jonathan Hester**

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report



**10 Aug 2022 Diag: Jonathan Hester**

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

view report



**08 Feb 2022 Diag: Angela Borella**

NORMAL




Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the component. The condition of the oil is acceptable for the time in service.

view report



# OIL ANALYSIS REPORT

Sample Rating Trend

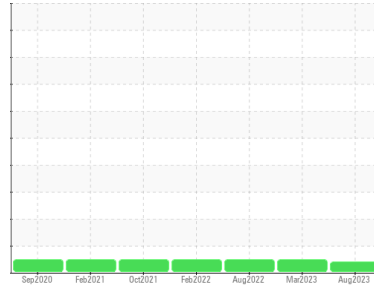

**VIS DEBRIS**



Machine Id  
**VILTER VILTER 5 (S/N 201373)**  
 Component  
**Compressor**  
 Fluid  
**PETRO CANADA REFLO SYNTHETIC 68A LOW TEMP FLUID (--- GAL)**

## DIAGNOSIS

### ▲ Recommendation

We recommend you service the filters on this component if applicable. Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### ▲ Contamination

Moderate concentration of visible dirt/debris present in the oil.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>PCA0102076</b>	PCA0092581	PCA0067415
Sample Date	Client Info		<b>18 Aug 2023</b>	09 Mar 2023	10 Aug 2022
Machine Age	hrs	Client Info	<b>0</b>	0	0
Oil Age	hrs	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>ABNORMAL</b>	NORMAL	NORMAL

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >50	<b>&lt;1</b>	<1	<1
Chromium	ppm	ASTM D5185m >10	<b>0</b>	0	0
Nickel	ppm	ASTM D5185m	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185m	<b>0</b>	0	0
Silver	ppm	ASTM D5185m	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185m >25	<b>0</b>	<1	<1
Lead	ppm	ASTM D5185m >25	<b>0</b>	0	0
Copper	ppm	ASTM D5185m >50	<b>0</b>	<1	0
Tin	ppm	ASTM D5185m >15	<b>0</b>	0	0
Antimony	ppm	ASTM D5185m	<b>---</b>	---	---
Vanadium	ppm	ASTM D5185m	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185m	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 0	<b>0</b>	0	1
Barium	ppm	ASTM D5185m 0	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185m 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185m	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185m 0	<b>0</b>	0	0
Calcium	ppm	ASTM D5185m 0	<b>2</b>	0	2
Phosphorus	ppm	ASTM D5185m 0	<b>1</b>	0	4
Zinc	ppm	ASTM D5185m 0	<b>0</b>	0	0
Sulfur	ppm	ASTM D5185m 0	<b>22</b>	98	61




## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	<b>&lt;1</b>	2	<1
Sodium	ppm	ASTM D5185m	<b>0</b>	0	<1
Potassium	ppm	ASTM D5185m >20	<b>0</b>	<1	0
Water	%	ASTM D6304 >0.1	<b>0.001</b>	0.003	---
ppm Water	ppm	ASTM D6304 >1000	<b>13.1</b>	33.3	---

## FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045 0.1	<b>0.015</b>	0.015	---


# OIL ANALYSIS REPORT

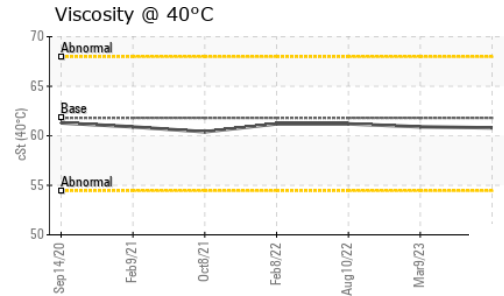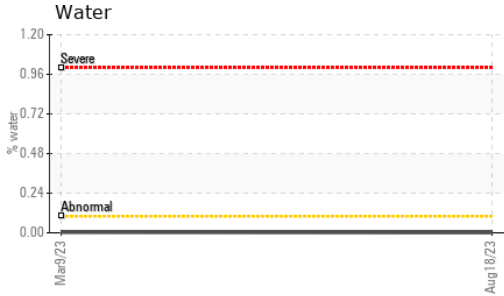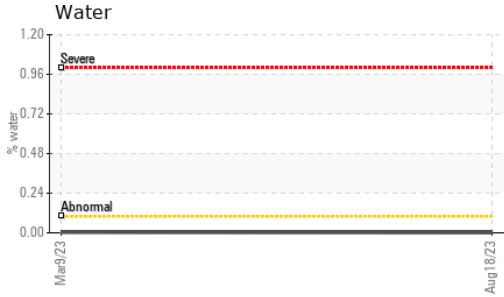





VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	▲ MODER	LIGHT
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D445	61.8	60.8	60.9

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

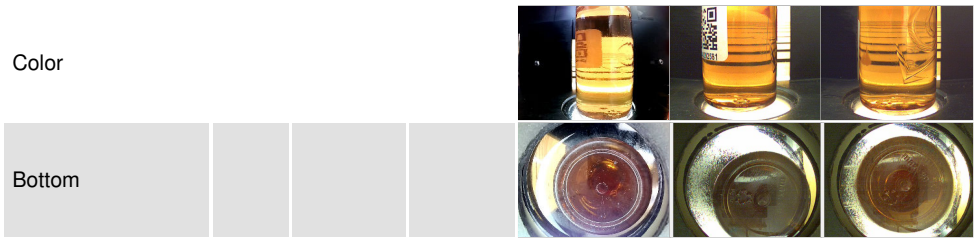

## GRAPHS

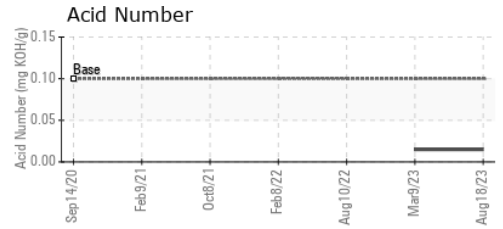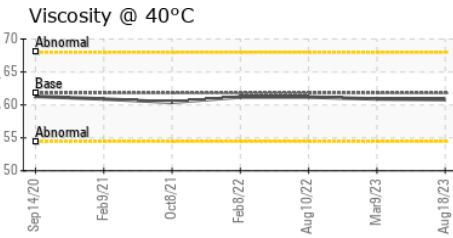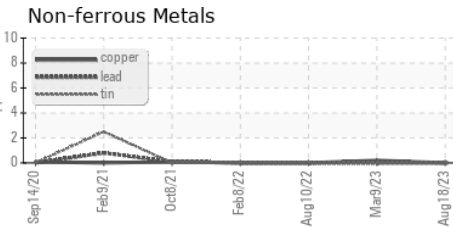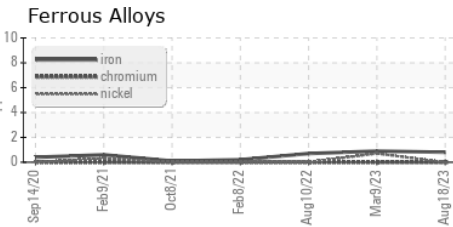

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : PCA0102076 **Received** : 24 Aug 2023  
**Lab Number** : 05933750 **Diagnosed** : 26 Aug 2023  
**Unique Number** : 10619021 **Diagnostician** : Don Baldrige  
**Test Package** : IND 2 ( Additional Tests: KF )

**SMITHFIELD FOODS**  
 ONE SWEET APPLEWOOD LANE  
 CUDAHY, WI  
 US 53110  
 Contact: PETE LERAY  
 pleray@smithfield.com  
 T: (414)918-3258  
 F:

To discuss this sample report, contact Customer Service at 1-800-237-1369.  
 \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.  
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)