


# **PROBLEM SUMMARY**



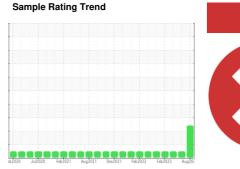


## 12052 Component


Machine Id

Diesel Engine

## PETRO CANADA DURON SHP 15W40 (34 QTS)

### COMPONENT CONDITION SUMMARY

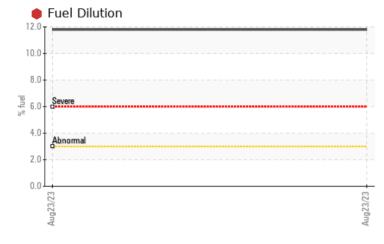

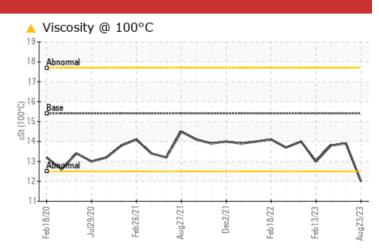

### RECOMMENDATION

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				SEVERE	NORMAL	NORMAL		
Fuel	%	ASTM D3524	>3.0	🛑 11.8	<1.0	<1.0		
Visc @ 100°C	cSt	ASTM D445	15.4	<b>12.0</b>	13.9	13.8		

Customer Id: GFL020 Sample No.: GFL0091181 Lab Number: 05934717 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS							
Action	Status	Date	Done By	Description			
Change Fluid			?	We recommend that you drain the oil from the component if this has not already been done.			
Resample			?	We recommend an early resample to monitor this condition.			
Check Fuel/injector System			?	We advise that you check the fuel injection system.			

### HISTORICAL DIAGNOSIS



01 Jun 2023 Diag: Wes Davis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.



view report

10 Mar 2023 Diag: Wes Davis



## Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of

any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

# NORMAL



### 13 Feb 2023 Diag: Wes Davis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.





## **OIL ANALYSIS REPORT**

Sample Rating Trend



#### 

		3b2020 Juli	020 Feb2021 Aug20	121 Dec2021 Feb2022 Feb20	123 Aug202	
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0091181	GFL0076976	GFL006495
Sample Date		Client Info		23 Aug 2023	01 Jun 2023	10 Mar 2023
Machine Age	hrs	Client Info		0	0	2983
Oil Age	hrs	Client Info		600	600	600
Oil Changed		Client Info		Not Changd	Not Changd	Not Change
Sample Status				SEVERE	NORMAL	NORMAL
CONTAMINA	ΓΙΟΝ	method	limit/base	current	history1	history2
Glycol		WC Method		NEG	NEG	NEG
WEAR META	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>90	22	15	5
Chromium	ppm	ASTM D5185m	>20	1	<1	<1
Nickel	ppm	ASTM D5185m	>2	0	<1	0
Titanium	ppm	ASTM D5185m	>2	0	0	<1
Silver	ppm	ASTM D5185m	>2	0	0	0
Aluminum	ppm	ASTM D5185m	>20	6	3	<1
Lead	ppm	ASTM D5185m	>40	<1	0	<1
Copper	ppm	ASTM D5185m	>330	2	2	1
Tin	ppm	ASTM D5185m	>15	<1	0	<1
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	4	7	6
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	56	60	58
Manganese	ppm	ASTM D5185m	0	<1	<1	1
Magnesium	ppm	ASTM D5185m	1010	922	973	906
Calcium	ppm	ASTM D5185m	1070	1049	1095	1121
Phosphorus	ppm	ASTM D5185m	1150	996	1056	973
Zinc	ppm	ASTM D5185m	1270	1223	1331	1264
Sulfur	ppm	ASTM D5185m	2060	3382	3852	3411
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	5	4	4
Sodium	ppm	ASTM D5185m		5	4	7
Potassium	ppm	ASTM D5185m	>20	0	1	2
Fuel	%	ASTM D3524	>3.0	<b>e</b> 11.8	<1.0	<1.0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>6	0.9	0.6	0.3
Nitration	Abs/cm	*ASTM D7624		11.8	8.2	6.0
Sulfation	Abs/.1mm	*ASTM D7415		22.3	20.3	18.3
FLUID DEGRA		method	limit/base	current	history1	history2
I LOID DEGIL					/	
Oxidation	Abs/.1mm	*ASTM D7414	>25	21.7	16.0	14.1

# Machine Id 12052

Component

Diesel Engine

PETRO CANADA DURON SHP 15W40 (34 QTS)

### DIAGNOSIS

### Recommendation

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

### Wear

All component wear rates are normal.

#### Contamination


There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.


#### Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.



# **OIL ANALYSIS REPORT**

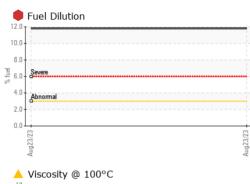

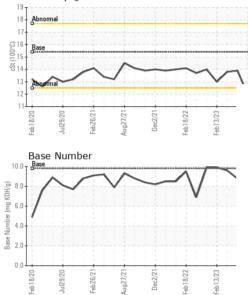


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG
FLUID PROPE	RTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	<b>12.0</b>	13.9	13.8
GRAPHS						


Ferrous Alloys

lead

140

120 100

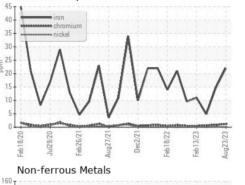

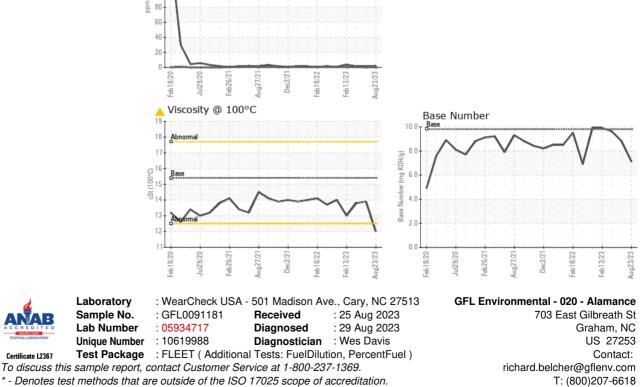

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Page 4 of 4

F: (336)229-0526