


# **OIL ANALYSIS REPORT**

Sample Rating Trend



**NORMAL** 

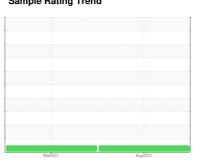

Machine Id **521560** 

Component **Diesel Engine** 

PETRO CANADA DURON SHP 10W30 (--- QTS)

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Metal levels are typical for a new component breaking in.

### Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.

### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

QTS)			Mar2023	Aug <sup>2</sup> 023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0098953	PCA0093132	
Sample Date		Client Info		18 Aug 2023	17 Mar 2023	
Machine Age	mls	Client Info		48607	35582	
Oil Age	mls	Client Info		0	35582	
Oil Changed		Client Info		Not Changd	Changed	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	
Glycol		WC Method		NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	14	46	
Chromium	ppm	ASTM D5185m	>20	2	4	
Nickel	ppm	ASTM D5185m	>4	<1	<1	
Titanium	ppm	ASTM D5185m		0	<1	
Silver	ppm	ASTM D5185m	>3	<1	3	
Aluminum	ppm	ASTM D5185m	>20	18	48	
Lead	ppm	ASTM D5185m	>40	2	2	
Copper	ppm	ASTM D5185m	>330	271	331	
Tin	ppm	ASTM D5185m	>15	3	6	
Vanadium	ppm	ASTM D5185m		<1	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	22	23	
Barium	ppm	ASTM D5185m	0	0	0	
Molybdenum	ppm	ASTM D5185m	50	67	39	
Manganese	ppm	ASTM D5185m	0	1	5	
Magnesium	ppm	ASTM D5185m	950	878	496	
Calcium	ppm	ASTM D5185m	1050	1315	1742	
Phosphorus	ppm	ASTM D5185m	995	1052	675	
Zinc	ppm	ASTM D5185m	1180	1244	867	
Sulfur	ppm	ASTM D5185m	2600	3565	2121	
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	3	8	
Sodium	ppm	ASTM D5185m		3	6	
Potassium	ppm	ASTM D5185m	>20	45	139	
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4	0.7	
Nitration	Abs/cm	*ASTM D7624	>20	7.1	10.6	
Sulfation	Abs/.1mm	*ASTM D7415	>30	18.5	23.0	
FLUID DEGRAI	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	13.3	22.3	
Base Number (BN)	mg KOH/g	ASTM D2896		8.1	7.9	



## **OIL ANALYSIS REPORT**







Laboratory Sample No. Lab Number

**Unique Number** 

: PCA0098953 : 05941905 : 10632517

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 05 Sep 2023 : 06 Sep 2023 Diagnosed Diagnostician : Wes Davis

Test Package : MOB 1 ( Additional Tests: TBN ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

**MILLER TRUCK LEASING #112** 

1504 MAINLINE DR CINNAMINSON, NJ US 08077

Contact: MIKE BOYER mboyer@millertransgroup.com T: (856)662-4264

F: (856)663-4898

Contact/Location: MIKE BOYER - MILPEN