

PROBLEM SUMMARY

Sample Rating Trend

VISCOSITY

VISCOSITI


10272C AUTOCAR ACX64

Component

Natural Gas Engine

PETRO CANADA DURON GEO LD 15W40 (29 QTS)

COMPONENT CONDITION SUMMARY

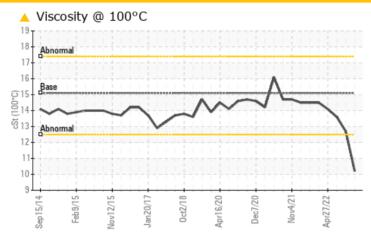

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS									
Sample Status				ATTENTION	NORMAL	NORMAL			
Visc @ 100°C	cSt	ASTM D445	15.1	10.2	12.7	13.6			

Customer Id: GFL001 Sample No.: GFL0094689 Lab Number: 05968709 Test Package: FLEET

To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 jhester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

26 Dec 2022 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.



30 Jun 2022 Diag: Angela Borella

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.



27 Apr 2022 Diag: Don Baldridge

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

Sample Rating Trend



10272C AUTOCAR ACX64

Component

Natural Gas Engine

PETRO CANADA DURON GEO LD 15W40 (29 QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

▲ Fluid Condition


The oil viscosity is lower than normal. The BN result indicates that there is suitable alkalinity remaining in the oil. Confirm oil type.


(29 QTS)		loo				
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0094689	GFL0056567	GFL0052471
Sample Date		Client Info		02 Oct 2023	26 Dec 2022	30 Jun 2022
Machine Age	hrs	Client Info		4274	2490	1459
Oil Age	hrs	Client Info		0	1505	474
Oil Changed		Client Info		Not Changd	Changed	Changed
Sample Status				ATTENTION	NORMAL	NORMAL
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	9	9	7
Chromium	ppm	ASTM D5185m	>4	<1	1	<1
Nickel	ppm	ASTM D5185m	>2	0	<1	<1
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m	>3	0	0	<1
Aluminum	ppm	ASTM D5185m	>9	2	2	2
Lead	ppm	ASTM D5185m	>30	10	2	<1
Copper	ppm	ASTM D5185m	>35	<1	<1	<1
Tin	ppm	ASTM D5185m	>4	<1	<1	<1
Vanadium	ppm	ASTM D5185m		<1	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	50	21	14	23
Barium	ppm	ASTM D5185m	5	0	0	0
Molybdenum	ppm	ASTM D5185m	50	36	43	46
Manganese	ppm	ASTM D5185m	0	<1	<1	<1
Magnesium	ppm	ASTM D5185m	560	351	488	502
Calcium	ppm	ASTM D5185m	1510	1084	1375	1492

Boron	ppm	ASTM D5185m	50	21	14	23
Barium	ppm	ASTM D5185m	5	0	0	0
Molybdenum	ppm	ASTM D5185m	50	36	43	46
Manganese	ppm	ASTM D5185m	0	<1	<1	<1
Magnesium	ppm	ASTM D5185m	560	351	488	502
Calcium	ppm	ASTM D5185m	1510	1084	1375	1492
Phosphorus	ppm	ASTM D5185m	780	552	648	653
Zinc	ppm	ASTM D5185m	870	588	855	824
Sulfur	ppm	ASTM D5185m	2040	1971	2590	2691
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>+100	3	3	6
Sodium	ppm	ASTM D5185m		8	5	5
Potassium	ppm	ASTM D5185m	>20	3	1	0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844		0	0.1	0.1
Nitration	Abs/cm	*ASTM D7624	>20	9.8	10.7	9.9
Sulfation	Abs/.1mm	*ASTM D7415	>30	24.8	24.6	21.0
FLUID DEGRAI	OITAC	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	26.3	22.2	19.5
Oxidation	MU3/.1111111	A31W D7414	725	20.3	22.2	10.0



OIL ANALYSIS REPORT

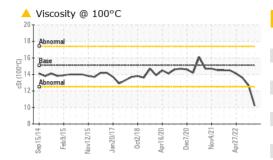


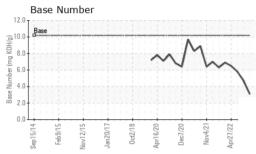



VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.1	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


FLUID PROP	ERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.1	10.2	12.7	13.6

GRAPHS

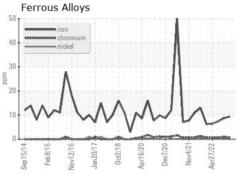

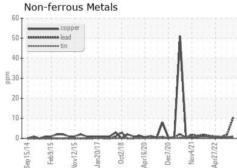

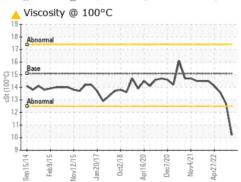

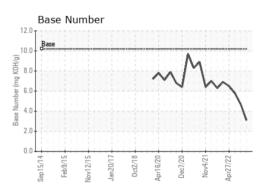





Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

Test Package : FLEET

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : GFL0094689 : 05968709 : 10675260

To discuss this sample report, contact Customer Service at 1-800-237-1369.

Received Diagnosed Diagnostician : Jonathan Hester

: 04 Oct 2023 : 06 Oct 2023 GFL Environmental - 001 - Raleigh(CNG)

3741 Conquest Drive Garner, NC US 27529

Contact: Ronald Gregory rgregory@gflenv.com

T:

F: (919)662-1730

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)