


PROBLEM SUMMARY


Machine Id 711011 Component


Diesel Engine

PETRO CANADA DURON SHP 15W40 (--- GAL)

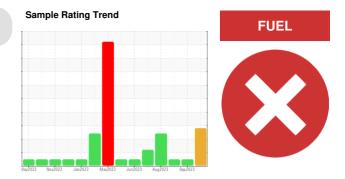

COMPONENT CONDITION SUMMARY

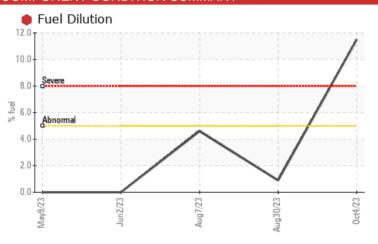

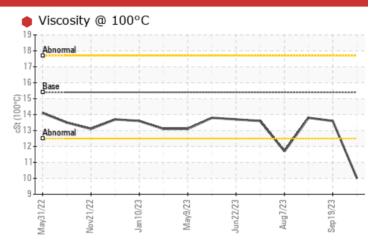

RECOMMENDATION

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

PROBLEMAT	IC TES	T RESULT	S			
Sample Status				SEVERE	NORMAL	NORMAL
Fuel	%	ASTM D3524	>5	11.5	<1.0	0.9
Visc @ 100°C	cSt	ASTM D445	15.4	10.0	13.6	13.8

Customer Id: GFL821 Sample No.: GFL0090162 Lab Number: 05972506 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data: Wes Davis +1 905-569-8600 x223 wesd@wearcheck.ca

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS Action **Status** Date Done By Description We recommend that you drain the oil from the component if this has not Change Fluid MISSED Oct 18 2023 ? already been done. Resample **MISSED** Oct 18 2023 We recommend an early resample to monitor this condition. Check Fuel/injector ? MISSED Oct 18 2023 We advise that you check the fuel injection system. System

HISTORICAL DIAGNOSIS

19 Sep 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.



30 Aug 2023 Diag: Wes Davis

NORMAL



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. Fuel content negligible. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.



07 Aug 2023 Diag: Jonathan Hester

GLYCOL



We advise that you check the fuel injection system. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition. All component wear rates are normal. Sodium and/or potassium levels are high. There is a moderate amount of fuel present in the oil. Test for glycol is negative. Fuel is present in the oil and is lowering the viscosity. The BN result indicates that there is suitable alkalinity remaining in the oil.






OIL ANALYSIS REPORT

Machine Id 711011 Component

Diesel Engine

PETRO CANADA DURON SHP 15W40 (--- GAL)

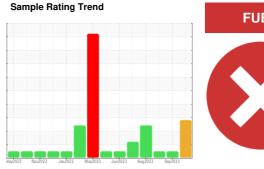



DIAGNOSIS

Recommendation

We advise that you check the fuel injection system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

JAL)		vlay2022 Ni	ov2022 Jan2023 Ma	y2023 Jun2023 Aug2023	Sep2023	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0090162	GFL0090175	GFL0090233
Sample Date		Client Info		04 Oct 2023	19 Sep 2023	30 Aug 2023
Machine Age	hrs	Client Info		7335	7212	7057
Oil Age	hrs	Client Info		150	150	150
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				SEVERE	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	27	13	6
Chromium	ppm	ASTM D5185m	>20	<1	<1	<1
Nickel	ppm	ASTM D5185m	>4	0	0	0
Titanium	ppm	ASTM D5185m		0	0	<1
Silver	ppm	ASTM D5185m	>3	0	0	0
Aluminum	ppm	ASTM D5185m	>20	9	3	2
Lead	ppm	ASTM D5185m	>40	<1	0	0
Copper	ppm	ASTM D5185m	>330	3	3	3
Tin	ppm	ASTM D5185m	>15	0	<1	0
Vanadium	ppm	ASTM D5185m		0	0	<1
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	0	5	0	0
Barium	ppm	ASTM D5185m	0	0	0	0
Molybdenum	ppm	ASTM D5185m	60	51	60	59
Manganese	ppm	ASTM D5185m	0	<1	<1	<1
Magnesium	ppm	ASTM D5185m	1010	770	926	1027
Calcium	ppm	ASTM D5185m	1070	850	1022	1131
Phosphorus	ppm	ASTM D5185m	1150	848	1010	1054
Zinc	ppm	ASTM D5185m	1270	1043	1239	1307
Sulfur	ppm	ASTM D5185m	2060	2879	3151	3867
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	8	6	4
Sodium	ppm	ASTM D5185m		41	22	19
Potassium	ppm	ASTM D5185m	>20	7	7	6
Fuel	%	ASTM D3524	>5	11.5	<1.0	0.9
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.9	0.4	0.3
Nitration	Abs/cm	*ASTM D7624		7.8	6.9	5.4
Sulfation	Abs/.1mm	*ASTM D7415	>30	20.2	19.0	17.7
FLUID DEGRAI	OITAC	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	15.7	14.5	13.0
Base Number (BN)	mg KOH/g		9.8	7.8	8.5	8.5
(211)	99					





OIL ANALYSIS REPORT

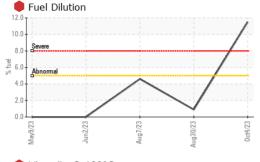


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG	NEG


Visc	osity @	100°C				
18 Abno	rmal					
. 16 - Base						
14 - Abno			*************	************		
Abno	rmal				\/	1
12					Y	1
10						
22 -8	22	- 53	- 53	53	- 53	33
May31/	Nov21/	an 10/2	May9/	un22/3	// Bm/	Sep19/
ž	ž	-5	2	7	44	Š

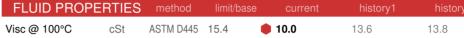


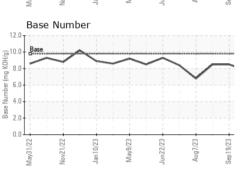


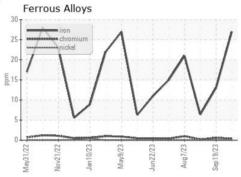

GRAPHS

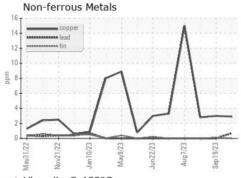

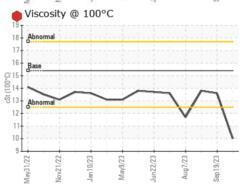

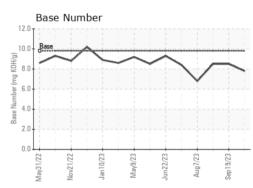





Laboratory Sample No. Lab Number **Unique Number**

: GFL0090162 : 05972506 : 10684456

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed

: 09 Oct 2023 : 10 Oct 2023

Diagnostician : Wes Davis **Test Package**: FLEET (Additional Tests: FuelDilution, PercentFuel)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

GFL Environmental - 821 - Ozarks Hauling

33924 Olath Drive Lebanon, MO US 65536

Contact: Landen Johnson landen.johnson@gflenv.com T: (417)664-0010

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)