


OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

 Machine Id
739151

 Component
Diesel Engine

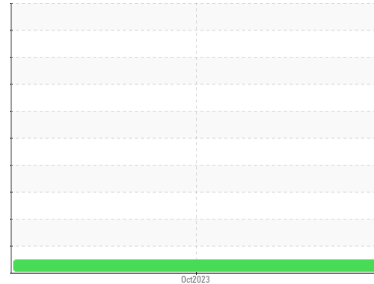 Fluid
PETRO CANADA DURON SHP 10W30 (--- QTS)

DIAGNOSIS
Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

Metal levels are typical for a new component breaking in.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. No other contaminants were detected in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		PCA0108326	---	---
Sample Date	Client Info		28 Oct 2023	---	---
Machine Age	mls	Client Info	61076	---	---
Oil Age	mls	Client Info	61076	---	---
Oil Changed	Client Info		Changed	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>5	<1.0	---	---
Glycol	WC Method		NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m >100	120	---	---
Chromium	ppm	ASTM D5185m >20	7	---	---
Nickel	ppm	ASTM D5185m >4	<1	---	---
Titanium	ppm	ASTM D5185m	0	---	---
Silver	ppm	ASTM D5185m >3	0	---	---
Aluminum	ppm	ASTM D5185m >20	92	---	---
Lead	ppm	ASTM D5185m >40	<1	---	---
Copper	ppm	ASTM D5185m >330	143	---	---
Tin	ppm	ASTM D5185m >15	5	---	---
Vanadium	ppm	ASTM D5185m	0	---	---
Cadmium	ppm	ASTM D5185m	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m 2	24	---	---
Barium	ppm	ASTM D5185m 0	0	---	---
Molybdenum	ppm	ASTM D5185m 50	41	---	---
Manganese	ppm	ASTM D5185m 0	3	---	---
Magnesium	ppm	ASTM D5185m 950	458	---	---
Calcium	ppm	ASTM D5185m 1050	1781	---	---
Phosphorus	ppm	ASTM D5185m 995	698	---	---
Zinc	ppm	ASTM D5185m 1180	883	---	---
Sulfur	ppm	ASTM D5185m 2600	1701	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m >25	12	---	---
Sodium	ppm	ASTM D5185m	8	---	---
Potassium	ppm	ASTM D5185m >20	228	---	---





INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844 >3	1.2	---	---
Nitration	Abs/cm	*ASTM D7624 >20	13.9	---	---
Sulfation	Abs/.1mm	*ASTM D7415 >30	26.0	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414 >25	31.5	---	---
Base Number (BN)	mg KOH/g	ASTM D2896	4.9	---	---









OIL ANALYSIS REPORT

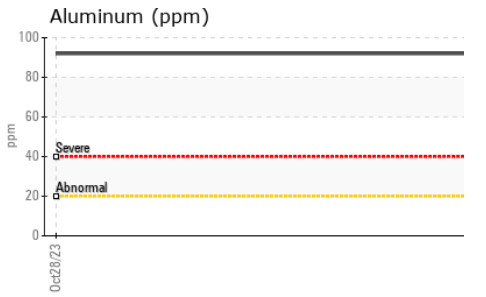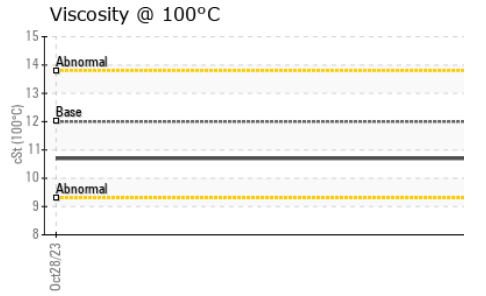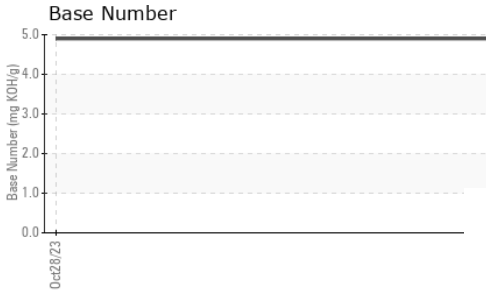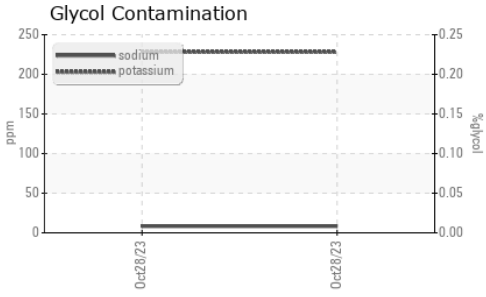

PARAMETER	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	---	---
Yellow Metal	scalar	*Visual	NONE	---	---
Precipitate	scalar	*Visual	NONE	---	---
Silt	scalar	*Visual	NONE	---	---
Debris	scalar	*Visual	NONE	---	---
Sand/Dirt	scalar	*Visual	NONE	---	---
Appearance	scalar	*Visual	NORML	---	---
Odor	scalar	*Visual	NORML	---	---
Emulsified Water	scalar	*Visual	>0.2	---	---
Free Water	scalar	*Visual	NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	10.7	---

GRAPHS

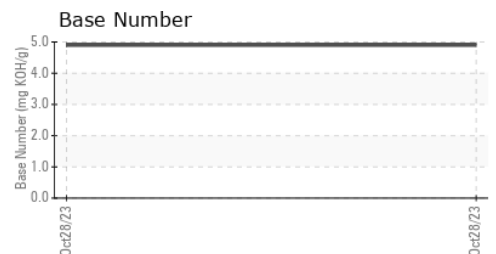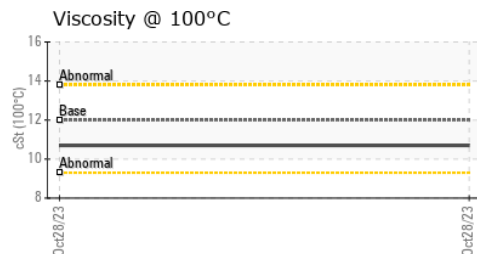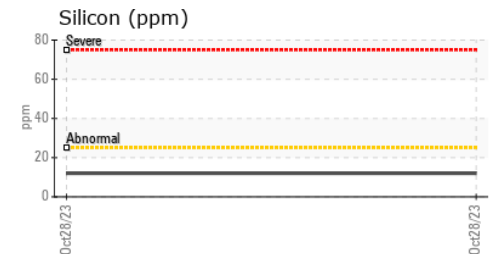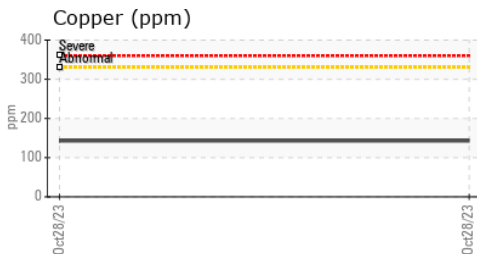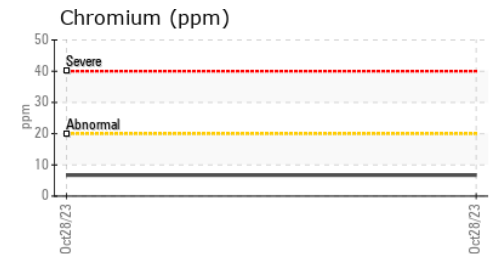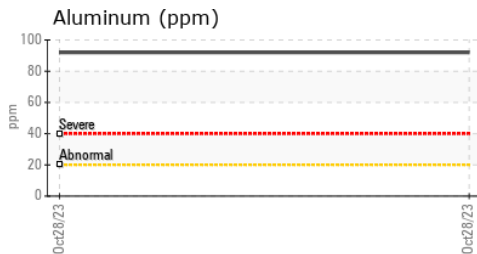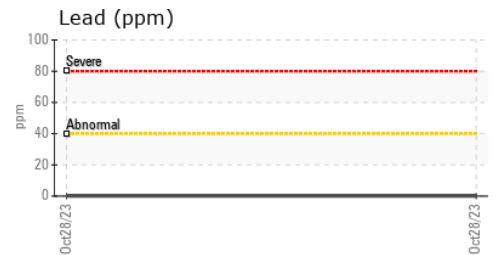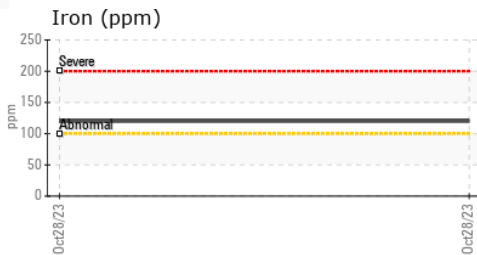

Certificate L2367

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : PCA0108326 **Received** : 06 Nov 2023
Lab Number : 05998731 **Diagnosed** : 07 Nov 2023
Unique Number : 10727091 **Diagnostician** : Don Baldrige
Test Package : MOB 1 (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #118
 2196 BENNETT ROAD
 PHILADELPHIA, PA
 US 19116
 Contact: ROSTY VITER
 rviter@millertransgroup.com
 T: (215)552-9832
 F: (215)552-9892