




PROBLEM SUMMARY

Sample Rating Trend

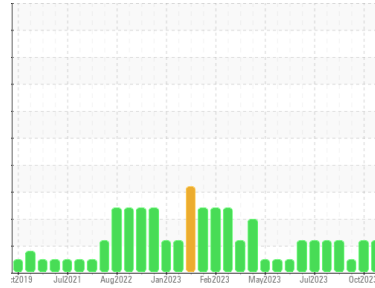


GLYCOL



Machine Id
12036
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (32 QTS)

COMPONENT CONDITION SUMMARY

▲ Glycol Contamination

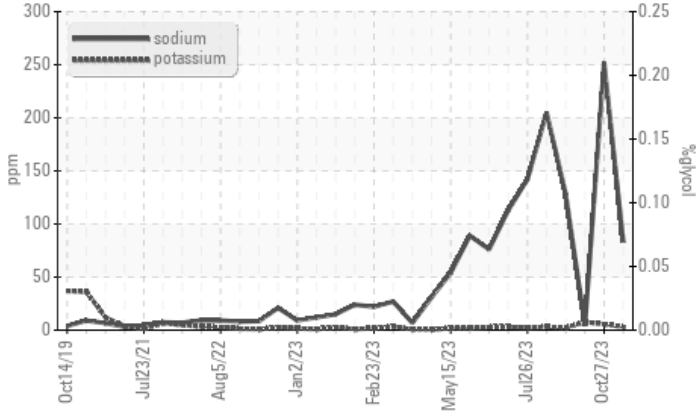

RECOMMENDATION

No corrective action is recommended at this time.
 Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS

Sample Status			ATTENTION	ATTENTION	NORMAL
Sodium	ppm	ASTM D5185m	▲ 83	▲ 252	4

Customer Id: GFL073
 Sample No.: GFL0097146
 Lab Number: 06029281
 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:
 Jonathan Hester +1 919-379-4092 x4092
jhester@wearcheckusa.com

To change component or sample information:
 Customer Service +1 1-800-237-1369
customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS

27 Oct 2023 Diag: Jonathan Hester

GLYCOL



The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition. All component wear rates are normal. Sodium and/or potassium levels are high. Test for glycol is negative. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

view report



06 Oct 2023 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

view report



14 Sep 2023 Diag: Jonathan Hester

GLYCOL



No corrective action is recommended at this time. Resample at the next service interval to monitor. All component wear rates are normal. Sodium and/or potassium levels remain high. Test for glycol is negative. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


view report





OIL ANALYSIS REPORT

Sample Rating Trend

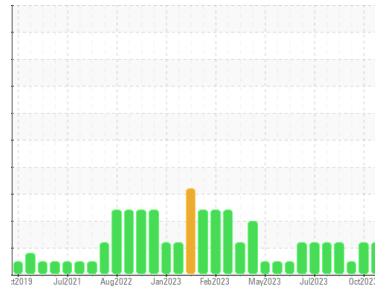

GLYCOL



Machine Id
12036
 Component
Diesel Engine
 Fluid
PETRO CANADA DURON SHP 15W40 (32 QTS)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

Sodium and/or potassium levels remain high. Test for glycol is negative.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	GFL0097146	GFL0097217	GFL0097194
Sample Date	Client Info	05 Dec 2023	27 Oct 2023	06 Oct 2023
Machine Age	hrs	13583	13305	13172
Oil Age	hrs	278	509	376
Oil Changed	Client Info	Not Changed	Changed	Not Changed
Sample Status		ATTENTION	ATTENTION	NORMAL

CONTAMINATION

method	limit/base	current	history1	history2
Fuel	WC Method >3.0	<1.0	<1.0	<1.0
Water	WC Method >0.2	NEG	NEG	NEG

WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >75	8	15	14
Chromium	ppm ASTM D5185m >5	<1	<1	<1
Nickel	ppm ASTM D5185m >4	<1	0	0
Titanium	ppm ASTM D5185m >2	<1	0	<1
Silver	ppm ASTM D5185m >2	0	0	0
Aluminum	ppm ASTM D5185m >15	5	4	5
Lead	ppm ASTM D5185m >25	0	0	0
Copper	ppm ASTM D5185m >100	1	1	1
Tin	ppm ASTM D5185m >4	0	0	0
Vanadium	ppm ASTM D5185m	0	0	0
Cadmium	ppm ASTM D5185m	0	0	0

ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m 0	4	4	3
Barium	ppm ASTM D5185m 0	0	0	0
Molybdenum	ppm ASTM D5185m 60	54	63	58
Manganese	ppm ASTM D5185m 0	<1	<1	<1
Magnesium	ppm ASTM D5185m 1010	850	823	931
Calcium	ppm ASTM D5185m 1070	918	950	985
Phosphorus	ppm ASTM D5185m 1150	941	1009	957
Zinc	ppm ASTM D5185m 1270	1145	1095	1203
Sulfur	ppm ASTM D5185m 2060	2857	2735	2904

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >25	10	7	6
Sodium	ppm ASTM D5185m	▲ 83	▲ 252	4
Potassium	ppm ASTM D5185m >20	3	6	8
Glycol	% *ASTM D2982	NEG	NEG	NEG

INFRA-RED




method	limit/base	current	history1	history2
Soot %	% *ASTM D7844 >6	0.3	0.6	0.9
Nitration	Abs/cm *ASTM D7624 >20	6.9	10.4	8.6
Sulfation	Abs/.1mm *ASTM D7415 >30	17.9	19.9	19.4

FLUID DEGRADATION

method	limit/base	current	history1	history2
Oxidation	Abs/.1mm *ASTM D7414 >25	13.4	16.3	14.8
Base Number (BN)	mg KOH/g ASTM D2896 9.8	8.3	7.9	8.2







OIL ANALYSIS REPORT

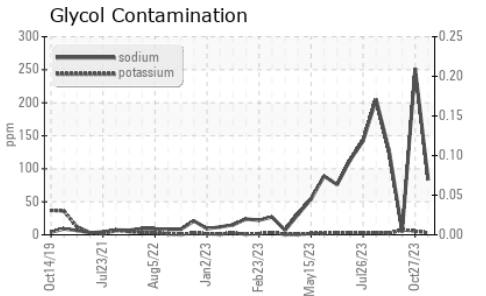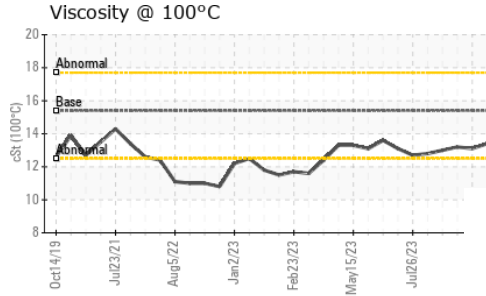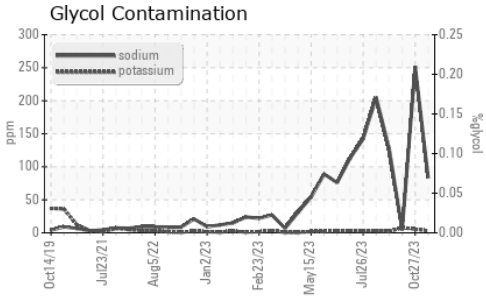

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 100°C	cSt	ASTM D445	15.4	13.4	13.1	13.2

GRAPHS

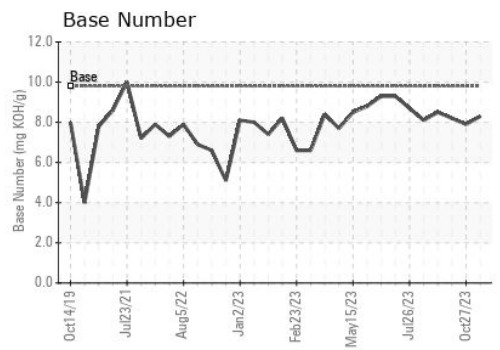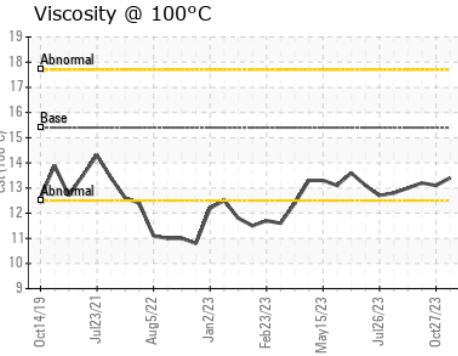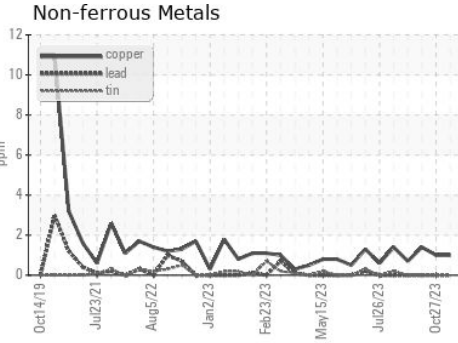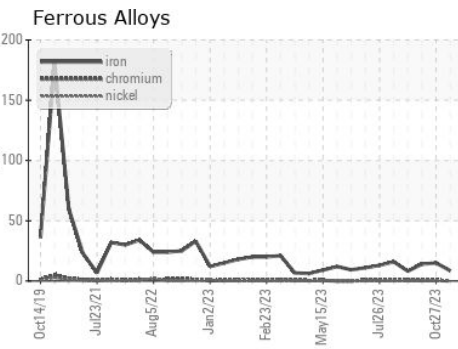

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513
Sample No. : GFL0097146 **Received** : 08 Dec 2023
Lab Number : **06029281** **Diagnosed** : 13 Dec 2023
Unique Number : 10779072 **Diagnostician** : Jonathan Hester
Test Package : FLEET (Additional Tests: Glycol)

GFL Environmental - 073 - Warner Robins - Transwaste
 155 Story Road
 Warner Robins, GA
 US 31093
 Contact: JOSH MALONEY
 jmaloney@gflenv.com

To discuss this sample report, contact Customer Service at 1-800-237-1369.
 * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.
 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)