


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

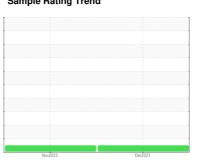

Machine Id **Abner Gap 2**

Component

Compressor

CITGO PACEMAKER GAS ENGIN 1700 SERIES 40W (26 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

	,		Nov2023	Dec2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0111850	PCA0111847	
Sample Date		Client Info		04 Dec 2023	10 Nov 2023	
Machine Age	hrs	Client Info		161864	161288	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		Not Changd	Not Changd	
Sample Status				NORMAL	NORMAL	
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	
Chromium	ppm	ASTM D5185m	>10	0	0	
Nickel	ppm	ASTM D5185m		0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	0	
Aluminum	ppm	ASTM D5185m	>25	<1	<1	
Lead	ppm	ASTM D5185m	>25	0	0	
Copper	ppm	ASTM D5185m	>50	0	0	
Tin	ppm	ASTM D5185m	>15	0	<1	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		0	0	
Magnesium	ppm	ASTM D5185m		7	7	
Calcium	ppm	ASTM D5185m		1254	1255	
Phosphorus	ppm	ASTM D5185m		279	278	
Zinc	ppm	ASTM D5185m		337	331	
Sulfur	ppm	ASTM D5185m		2395	2409	
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	2	1	
Sodium	ppm	ASTM D5185m		0	0	
Potassium	ppm	ASTM D5185m	>20	0	0	
FLUID DEGRA	OATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		0.325	0.32	



OIL ANALYSIS REPORT

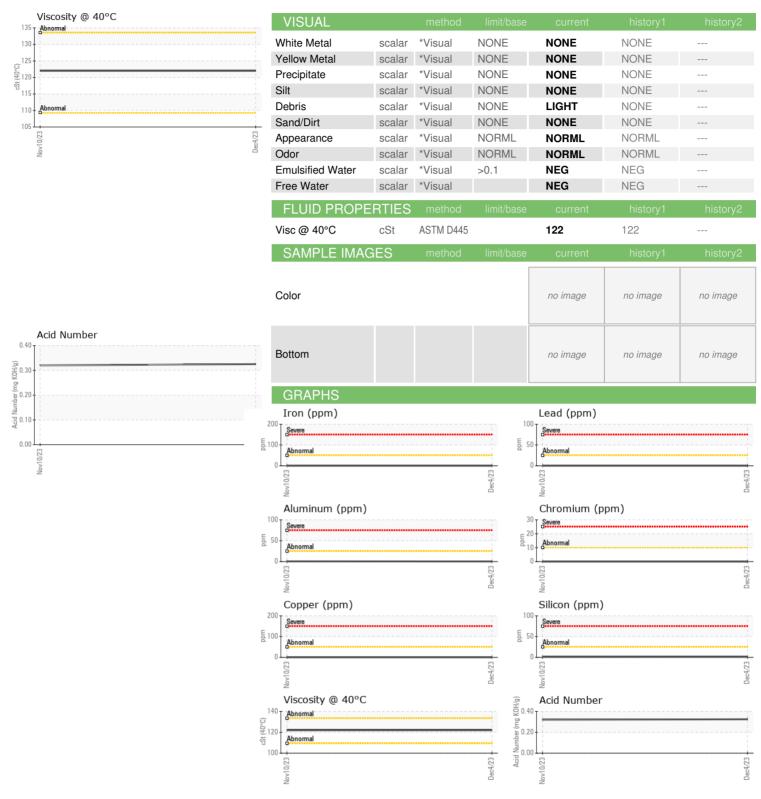



Certificate L2367

Laboratory Sample No. Lab Number **Unique Number**

: 06031747 : 10781538

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 11 Dec 2023 : PCA0111850 Diagnosed

: 14 Dec 2023

Diagnostician : Don Baldridge

Test Package : MOB 2 (Additional Tests: FuelDilution) To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

ENERVEST OPERATING - ABNER GAP

7556 SANDLICK ROAD

BEE, VA US 24217

Contact: Service Manager

T: F:

Report Id: ENEBEEAG [WUSCAR] 06031747 (Generated: 12/14/2023 14:36:55) Rev: 1