

PROBLEM SUMMARY

Sample Rating Trend

SEDIMENT



928088-260340

Component **Hydraulic System NOT GIVEN (--- GAL)**

COMPONENT CONDITION SUMMARY

No relevant graphs to display

RECOMMENDATION

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Silt	scalar	*Visual	NONE	▲ MODER				

Customer Id: GFL837 Sample No.: GFL0102531 Lab Number: 06035238 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data: Jonathan Hester +1 919-379-4092 x4092 ihester@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMEND	RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description			
Change Filter			?	We recommend you service the filters on this component.			
Alert			?	We were unable to perform a particle count due to a high concentration of particles present in this sample.			

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

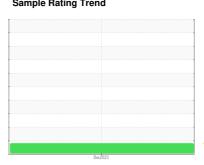





928088-260340

Component

Hydraulic System

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

We recommend you service the filters on this component. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of visible silt present in the sample.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

				Dec2023	,	
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GFL0102531		
Sample Date		Client Info		07 Dec 2023		
Machine Age	hrs	Client Info		13867		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
CONTAMINA	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAI	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	8		
Chromium	ppm	ASTM D5185m	>10	0		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	<1		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>75	0		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		3		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		39		
Calcium	ppm	ASTM D5185m		126		
Phosphorus	ppm	ASTM D5185m		382		
Zinc	ppm	ASTM D5185m		535		
Sulfur	ppm	ASTM D5185m		1029		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	2		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
	1/0/::	10TH Doc :-				


0.44

Acid Number (AN)

mg KOH/g ASTM D8045



OIL ANALYSIS REPORT

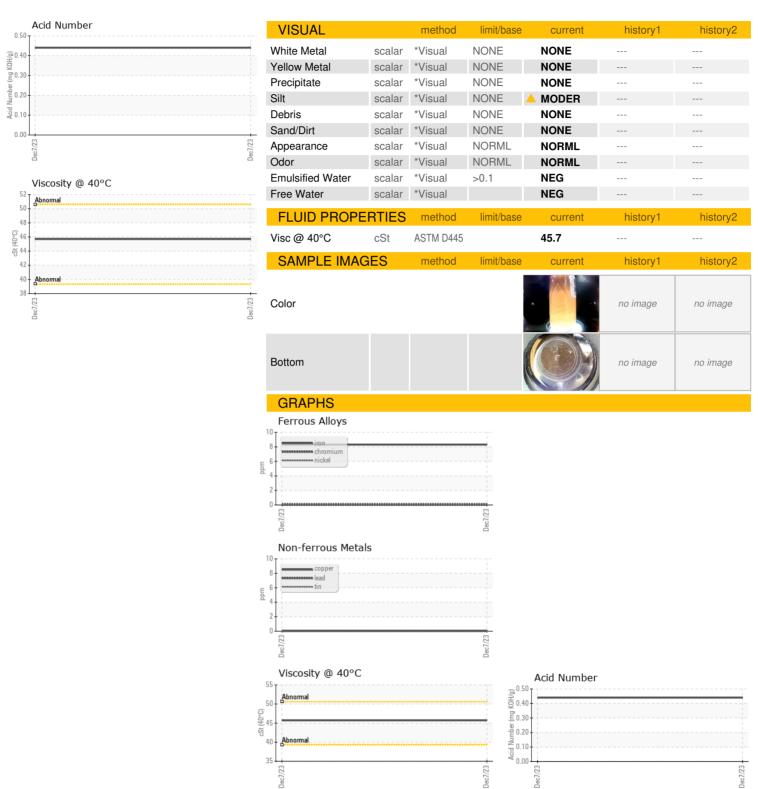





Laboratory Sample No. Lab Number **Unique Number**

: 06035238 : 10790467

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Recieved : 14 Dec 2023 : GFL0102531

: 19 Dec 2023 Diagnosed : Jonathan Hester Diagnostician

Test Package : FLEET (Additional Tests: PrtCount)

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

GFL Environmental - 837 - Harrison TS

22820 S State Route 291 Harrisonville, MO

US 64701 Contact: BRYAN SWANSON

bryanswanson@gflenv.com

T: F:

Contact/Location: BRYAN SWANSON - GFL837