




# PROBLEM SUMMARY

Sample Rating Trend

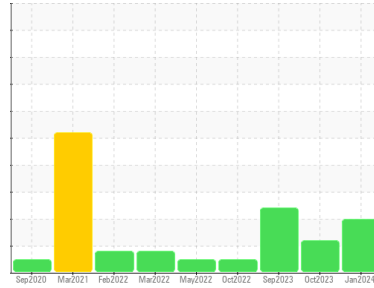


FUEL



Machine Id  
**710002**  
 Component  
**Diesel Engine**  
 Fluid  
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

## COMPONENT CONDITION SUMMARY

### Fuel Dilution

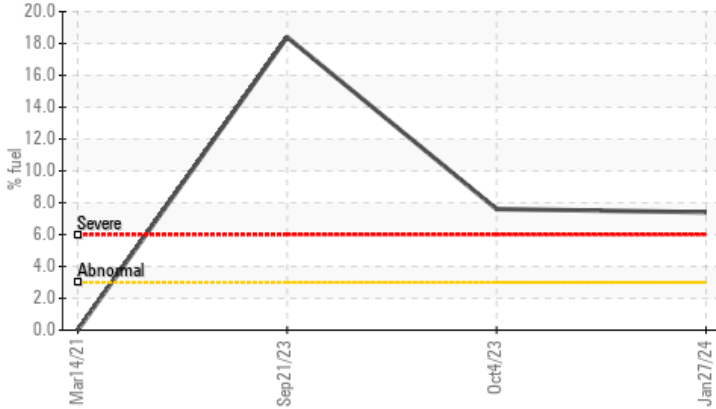

## RECOMMENDATION

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

## PROBLEMATIC TEST RESULTS

Sample Status				SEVERE	ABNORMAL	SEVERE
Fuel	%	ASTM D3524	>3.0	7.4	7.6	18.4

Customer Id: GFL015  
 Sample No.: GFL0104026  
 Lab Number: 06078147  
 Test Package: FLEET



To manage this report scan the QR code

To discuss the diagnosis or test data:  
 Wes Davis +1 905-569-8600 x223  
[wesd@wearcheck.ca](mailto:wesd@wearcheck.ca)

To change component or sample information:  
 Customer Service +1 1-800-237-1369  
[customerservice@wearcheck.com](mailto:customerservice@wearcheck.com)

## RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Resample	---	---	?	We recommend an early resample to monitor this condition.
Check Fuel/injector System	---	---	?	We advise that you check the fuel injection system.

## HISTORICAL DIAGNOSIS

### 04 Oct 2023 Diag: Jonathan Hester

#### FUEL



We advise that you check the fuel injection system. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. There is a moderate amount of fuel present in the oil. Fuel is present in the oil and is lowering the viscosity. The BN result indicates that there is suitable alkalinity remaining in the oil.

view report



### 21 Sep 2023 Diag: Don Baldrige

#### FUEL



We advise that you check the fuel injection system. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition. All component wear rates are normal. There is a high amount of fuel present in the oil. Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

view report



### 21 Oct 2022 Diag: Wes Davis

#### NORMAL



Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


view report





# OIL ANALYSIS REPORT

Sample Rating Trend

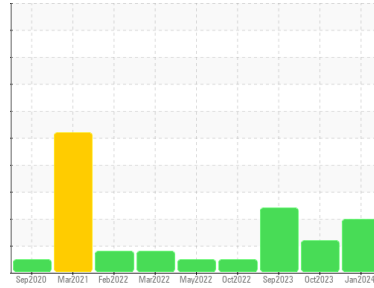

FUEL



Machine Id  
**710002**

Component  
**Diesel Engine**

Fluid  
**PETRO CANADA DURON SHP 15W40 (--- GAL)**

## DIAGNOSIS

### Recommendation

We advise that you check the fuel injection system. The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

### Wear

All component wear rates are normal.

### Contamination

There is a high amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.

### Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The oil is no longer serviceable due to the presence of contaminants.

## SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	<b>GFL0104026</b>	GFL0091199	GFL0091185
Sample Date	Client Info	<b>27 Jan 2024</b>	04 Oct 2023	21 Sep 2023
Machine Age	hrs	<b>10154</b>	9405	2322
Oil Age	hrs	<b>10154</b>	10943	2322
Oil Changed	Client Info	<b>Changed</b>	Changed	Changed
Sample Status		<b>SEVERE</b>	ABNORMAL	SEVERE

## CONTAMINATION

method	limit/base	current	history1	history2
Water	WC Method >0.2	<b>NEG</b>	NEG	NEG
Glycol	WC Method	<b>NEG</b>	NEG	NEG

## WEAR METALS

method	limit/base	current	history1	history2
Iron	ppm ASTM D5185m >90	<b>37</b>	18	44
Chromium	ppm ASTM D5185m >20	<b>2</b>	<1	3
Nickel	ppm ASTM D5185m >2	<b>1</b>	0	<1
Titanium	ppm ASTM D5185m >2	<b>&lt;1</b>	0	0
Silver	ppm ASTM D5185m >2	<b>0</b>	0	0
Aluminum	ppm ASTM D5185m >20	<b>4</b>	2	3
Lead	ppm ASTM D5185m >40	<b>&lt;1</b>	0	0
Copper	ppm ASTM D5185m >330	<b>3</b>	<1	1
Tin	ppm ASTM D5185m >15	<b>&lt;1</b>	0	<1
Vanadium	ppm ASTM D5185m	<b>0</b>	0	0
Cadmium	ppm ASTM D5185m	<b>&lt;1</b>	0	0

## ADDITIVES

method	limit/base	current	history1	history2
Boron	ppm ASTM D5185m 0	<b>37</b>	13	9
Barium	ppm ASTM D5185m 0	<b>0</b>	0	2
Molybdenum	ppm ASTM D5185m 60	<b>81</b>	59	49
Manganese	ppm ASTM D5185m 0	<b>&lt;1</b>	<1	<1
Magnesium	ppm ASTM D5185m 1010	<b>126</b>	794	619
Calcium	ppm ASTM D5185m 1070	<b>1672</b>	985	834
Phosphorus	ppm ASTM D5185m 1150	<b>873</b>	866	712
Zinc	ppm ASTM D5185m 1270	<b>1122</b>	1066	884
Sulfur	ppm ASTM D5185m 2060	<b>3016</b>	2720	2260

## CONTAMINANTS

method	limit/base	current	history1	history2
Silicon	ppm ASTM D5185m >25	<b>10</b>	4	8
Sodium	ppm ASTM D5185m	<b>1</b>	2	7
Potassium	ppm ASTM D5185m >20	<b>8</b>	2	3
Fuel	% ASTM D3524 >3.0	<b>7.4</b>	7.6	18.4

## INFRA-RED




method	limit/base	current	history1	history2
Soot %	% *ASTM D7844 >6	<b>0.5</b>	0.4	0.8
Nitration	Abs/cm *ASTM D7624 >20	<b>13.5</b>	9.8	15.3
Sulfation	Abs/.1mm *ASTM D7415 >30	<b>23.9</b>	20.6	26.4

## FLUID DEGRADATION

method	limit/base	current	history1	history2
Oxidation	Abs/.1mm *ASTM D7414 >25	<b>23.8</b>	19.9	34.7
Base Number (BN)	mg KOH/g ASTM D2896 9.8	<b>5.4</b>	8.0	3.8







# OIL ANALYSIS REPORT

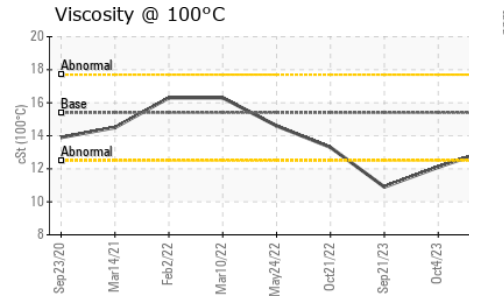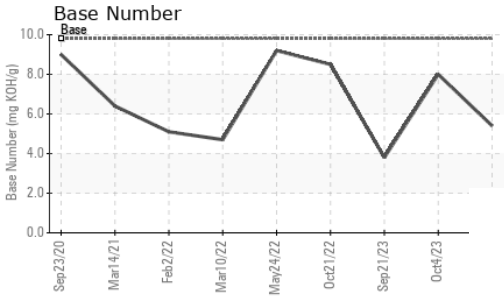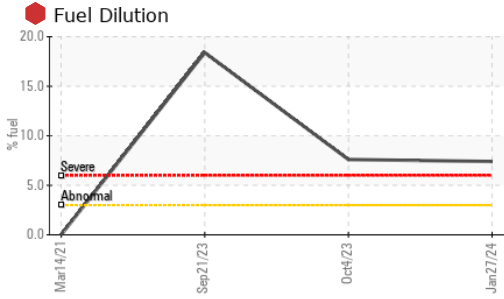

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE	NONE
Yellow Metal	scalar	*Visual	NONE	NONE	NONE
Precipitate	scalar	*Visual	NONE	NONE	NONE
Silt	scalar	*Visual	NONE	NONE	NONE
Debris	scalar	*Visual	NONE	NONE	NONE
Sand/Dirt	scalar	*Visual	NONE	NONE	NONE
Appearance	scalar	*Visual	NORML	NORML	NORML
Odor	scalar	*Visual	NORML	NORML	NORML
Emulsified Water	scalar	*Visual	>0.2	NEG	NEG
Free Water	scalar	*Visual		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D445	15.4	13.2 ▲	12.1 ▲

## GRAPHS

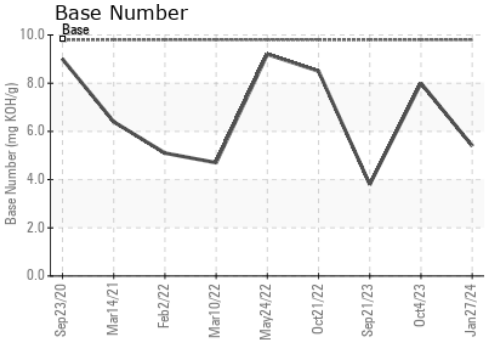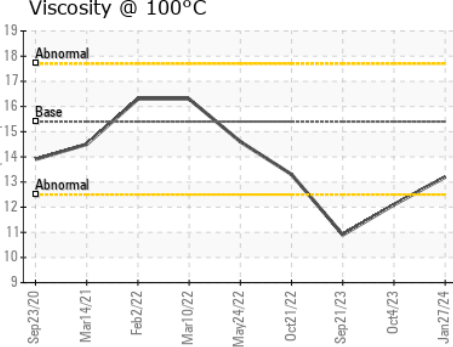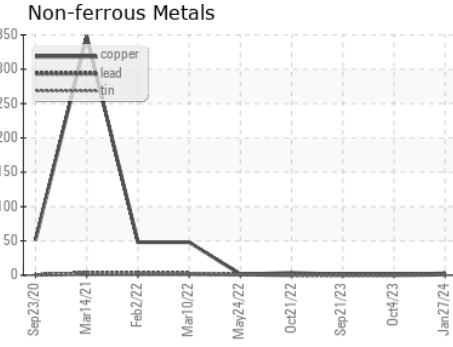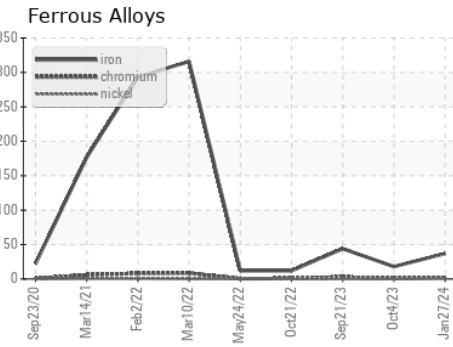

Certificate L2367

**Laboratory** : WearCheck USA - 501 Madison Ave., Cary, NC 27513  
**Sample No.** : GFL0104026 **Received** : 02 Feb 2024  
**Lab Number** : **06078147** **Diagnosed** : 05 Feb 2024  
**Unique Number** : 10860238 **Diagnostician** : Wes Davis  
**Test Package** : FLEET ( Additional Tests: PercentFuel )

**GFL Environmental - 015 - Columbia**  
 7800 Farrow Road  
 Columbia, SC  
 US 29203-3219  
 Contact: NOEL MATTHEWS  
 nmatthewsjr@gflenv.com  
 T: (803)935-0249  
 F: (803)935-0244

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)