


OIL ANALYSIS REPORT

Sample Rating Trend

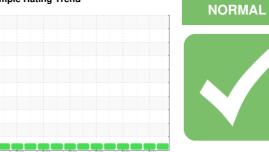

Brushy Ridge 1

Component

Compressor Fluid

PETRO CANADA TURBOFLO R&O 150 (55 GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	NOITAN	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0112009	PCA0112008	PCA0112007
Sample Date		Client Info		01 Feb 2024	01 Jan 2024	01 Dec 2023
Machine Age	hrs	Client Info		63075	62354	61598
Oil Age	hrs	Client Info		8882	8161	7405
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINATI	ON	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG	NEG	NEG
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>50	0	0	0
Chromium	ppm	ASTM D5185m	>10	0	0	0
Nickel	ppm	ASTM D5185m		<1	0	0
Titanium	ppm	ASTM D5185m		0	0	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>25	0	2	0
Lead	ppm	ASTM D5185m	>25	<1	0	0
Copper	ppm	ASTM D5185m	>50	0	0	0
Tin	ppm	ASTM D5185m	>15	0	0	0
Vanadium	ppm	ASTM D5185m		0	0	0
Cadmium	ppm	ASTM D5185m		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	0	0
Barium	ppm	ASTM D5185m		0	0	0
Molybdenum	ppm	ASTM D5185m		0	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m		1	<1	<1
Calcium	ppm	ASTM D5185m	0	12	2	2
Phosphorus	ppm	ASTM D5185m	4	6	33	6
Zinc	ppm	ASTM D5185m	0	<1	0	0
Sulfur	ppm	ASTM D5185m		638	605	683
CONTAMINAN [*]	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	0	0	0
Sodium	ppm	ASTM D5185m		1	0	0
Potassium	ppm	ASTM D5185m	>20	2	<1	0
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.18	0.11	0.11	0.11



OIL ANALYSIS REPORT

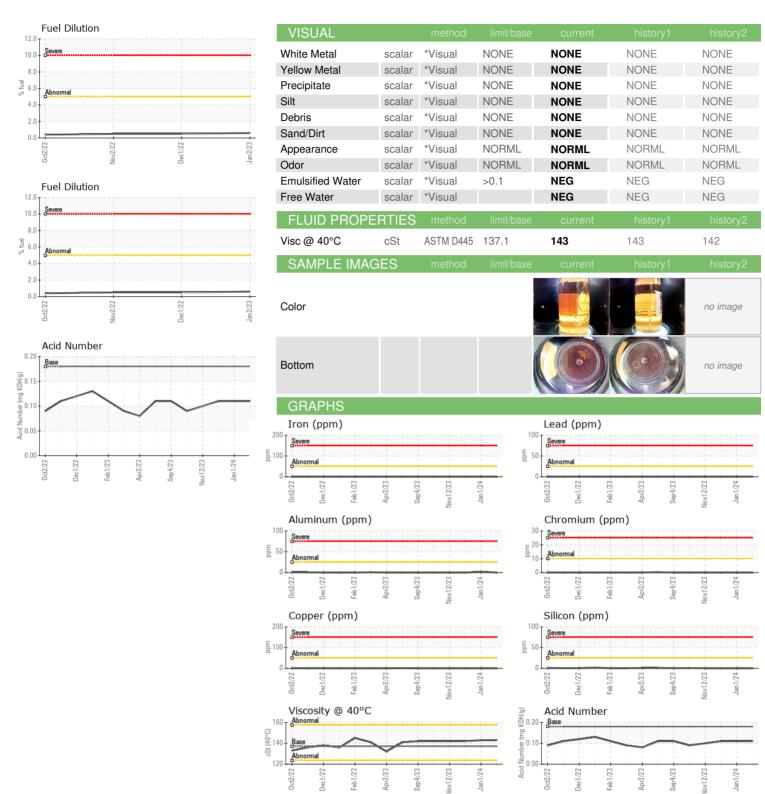





Laboratory Sample No. Lab Number

: PCA0112009 : 06092415

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 16 Feb 2024

Tested Unique Number : 10885268 Diagnosed

: 20 Feb 2024 : 20 Feb 2024 - Jonathan Hester

ENERVEST OPERATING - BRUSHY RIDGE 6000 DC CANEY RIDGE ROAD

COEBURN, VA US 24230

Test Package: MOB 2 (Additional Tests: FuelDilution) Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-800-237-1369.

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

T: F: