


# **PROBLEM SUMMARY**


Area [908106644] [] TANK 35 TANK 35

**Agitator Gearbox** 

COMP OIL (POE) ISO 220 (4 Oz)

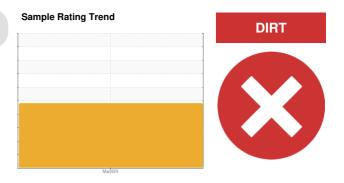

## **COMPONENT CONDITION SUMMARY**

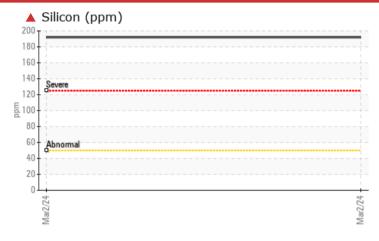

### RECOMMENDATION

We advise that you check all areas where dirt can enter the system. We recommend an early resample to monitor this condition.

PROBLEMATIC TEST RESULTS								
Sample Status				SEVERE				
Silicon	ppm	ASTM D5185m	>50	<b>192</b>				

**Customer Id: HERHER** Sample No.: PCA0093717 Lab Number: 06110319 Test Package: IND 2 To manage this report scan the QR code To discuss the diagnosis or test data: Don Baldridge +1 don.b505@comcast.net To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Resample			?	We recommend an early resample to monitor this condition.		
Check Dirt Access			?	We advise that you check all areas where dirt can enter the system.		

# HISTORICAL DIAGNOSIS




# **OIL ANALYSIS REPORT**

# Area [908106644] [] TANK 35 TANK 35

**Agitator Gearbox** 

COMP OIL (POE) ISO 220 (4 Oz)

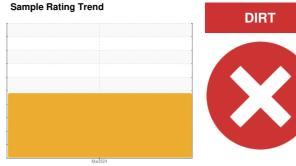

# **DIAGNOSIS**

### Recommendation

We advise that you check all areas where dirt can enter the system. We recommend an early resample to monitor this condition.

All component wear rates are normal.

## Contamination

Elemental level of silicon (Si) above normal indicating ingress of dirt/seal material.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.

				Mar2024		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0093717		
Sample Date		Client Info		02 Mar 2024		
Machine Age	hrs	Client Info		1		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
CONTAMINA	ΓΙΟΝ	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METAI	LS	method	limit/base	current	history1	history2
PQ		ASTM D8184		16		
Iron	ppm	ASTM D5185m	>150	4		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	2		
Lead	ppm	ASTM D5185m	>100	0		
Copper	ppm	ASTM D5185m	>50	<1		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	0		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		0		
Magnesium	ppm	ASTM D5185m	5	<1		
Calcium	ppm	ASTM D5185m	5	3		
Phosphorus	ppm	ASTM D5185m	400	478		
Zinc	ppm	ASTM D5185m	5	3		
Sulfur	ppm	ASTM D5185m	100	577		
CONTAMINA	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<b>192</b>		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	<1		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
A	1/011/	4.0TM D00.4F	0.40			


Acid Number (AN)

mg KOH/g ASTM D8045 0.40

0.59



# **OIL ANALYSIS REPORT**

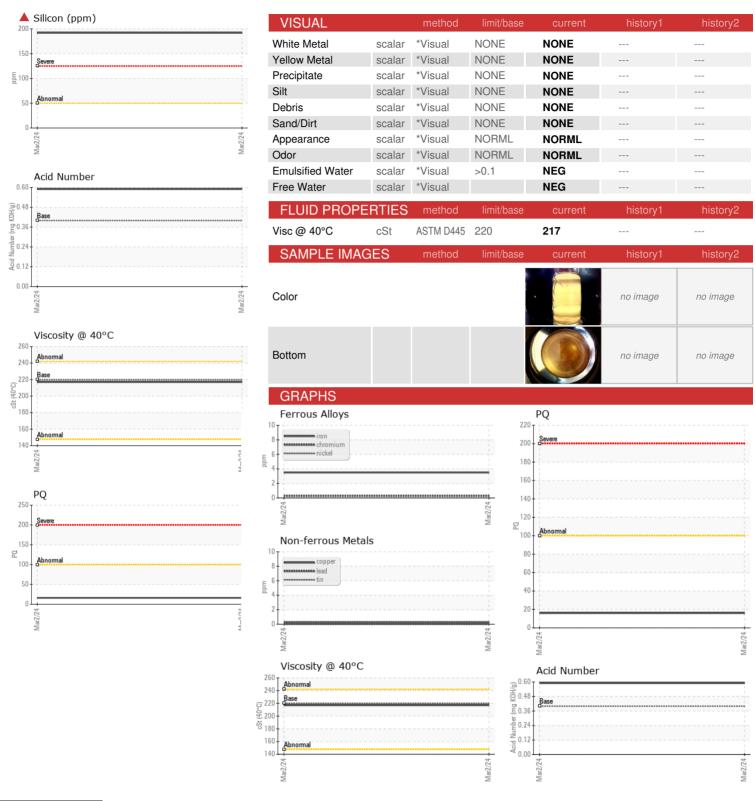





Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: PCA0093717 Lab Number : 06110319 **Unique Number** : 10913816

Test Package : IND 2 (Additional Tests: PQ)

Received **Tested** Diagnosed

: 06 Mar 2024

: 07 Mar 2024 : 08 Mar 2024 - Don Baldridge

THE HERSHEY COMPANY WEST HERSHEY - TECHNICAL ASSURANCE, 1033 OLDE WEST CHOCOLATE

HERSHEY, PA US 17033 Contact: CLINTON ZOHNER

Certificate L2367 To discuss this sample report, contact Customer Service at 1-800-237-1369.

clintzohner@hersheys.com T: (717)374-4846

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (717)374-4594