


# **OIL ANALYSIS REPORT**

# (68539Z) Walgreens - Tractor [Walgreens - Tractor] 136A624278

**Diesel Engine** 

PETRO CANADA DURON SHP 10W30 (11 GAL)

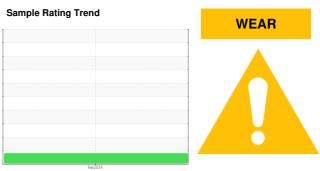

### **DIAGNOSIS**

### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

#### Wear

The copper level is abnormal. In the absence of other significant wear metals, suspect copper due to sources other than wear (i.e. cooling core). All other metal levels are typical for a new component breaking in.

#### Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


#### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

GAL)				Feb 2024		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0105876		
Sample Date		Client Info		16 Feb 2024		
Machine Age	mls	Client Info		29365		
Oil Age	mls	Client Info		29365		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	82		
Chromium	ppm	ASTM D5185m	>5	6		
Nickel	ppm	ASTM D5185m	>2	2		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>30	103		
Lead	ppm	ASTM D5185m	>30	<1		
Copper	ppm	ASTM D5185m	>150	<u>^</u> 292		
Tin	ppm	ASTM D5185m	>5	7		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	53		
Barium	ppm	ASTM D5185m	0	<1		
Molybdenum	ppm	ASTM D5185m	50	64		
Manganese	ppm	ASTM D5185m	0	9		
Magnesium	ppm	ASTM D5185m	950	818		
Calcium	ppm	ASTM D5185m	1050	2324		
Phosphorus	ppm	ASTM D5185m	995	1106		
Zinc	ppm	ASTM D5185m	1180	1332		
Sulfur	ppm	ASTM D5185m	2600	3422		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	11		
Sodium	ppm	ASTM D5185m		13		
Potassium	ppm	ASTM D5185m	>20	253		
Glycol	%	*ASTM D2982		NEG		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4		
Nitration	Abs/cm	*ASTM D7624	>20	8.2		
Sulfation	Abs/.1mm	*ASTM D7415	>30	22.4		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	21.4		
Oxidation Base Number (BN)	Abs/.1mm mg KOH/g	*ASTM D7414 ASTM D2896	>25	21.4 8.4		



## **OIL ANALYSIS REPORT**

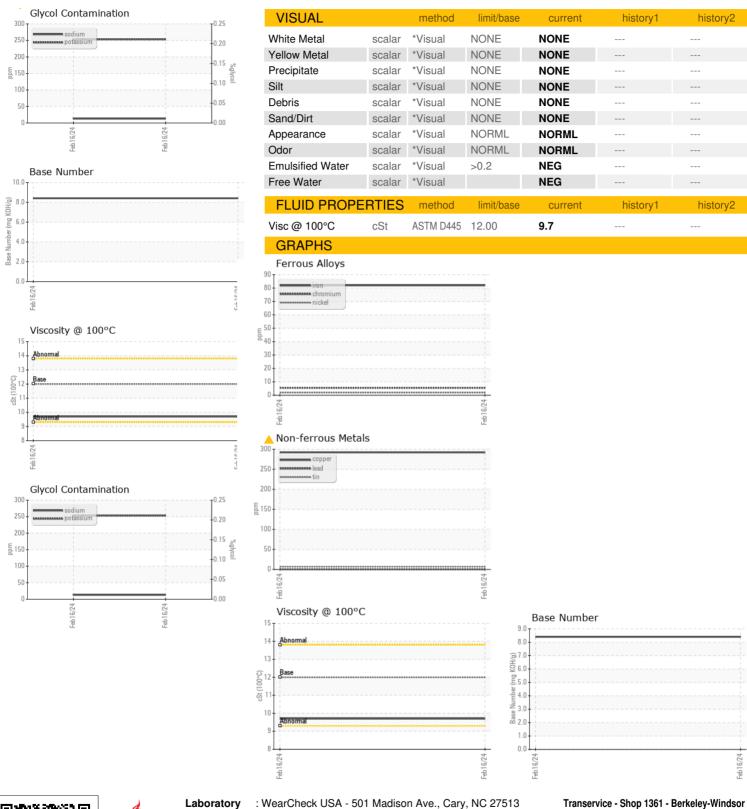





Certificate L2367

Laboratory Sample No.

Lab Number : 06120709

: PCA0105876

Received **Tested Unique Number** : 10929542 Test Package: FLEET (Additional Tests: Glycol)

: 18 Mar 2024 : 20 Mar 2024 Diagnosed

: 20 Mar 2024 - Sean Felton

Transervice - Shop 1361 - Berkeley-Windsor 4400 State Road 19 Windsor, WI

US 53598 Contact: Mike Hurda mhurda@transervice.com

To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (608)846-2726 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (608)846-0389