

OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



Machine Id **326654**

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- GAL

DIAGNOSIS

Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

Wear

Metal levels are typical for a new component breaking in.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

AL)				Mar2024		
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0118581		
Sample Date		Client Info		21 Mar 2024		
Machine Age	mls	Client Info		101413		
Dil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
-uel		WC Method	>5	<1.0		
<i>N</i> ater		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>100	89		
Chromium	ppm	ASTM D5185m	>20	3		
Nickel	ppm	ASTM D5185m	>4	0		
Γitanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	28		
ead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	8		
Γin	ppm	ASTM D5185m	>15	2		
/anadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	6		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	68		
Manganese	ppm	ASTM D5185m	0	2		
Magnesium	ppm	ASTM D5185m	950	936		
Calcium	ppm	ASTM D5185m	1050	1232		
Phosphorus	ppm	ASTM D5185m	995	1040		
Zinc	ppm	ASTM D5185m	1180	1253		
Sulfur	ppm		2600	2974		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	6		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	44		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1.1		
Vitration	Abs/cm	*ASTM D7624	>20	15.1		
Sulfation	Abs/.1mm	*ASTM D7415	>30	28.0		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	26.5		
Base Number (BN)	mg KOH/g	ASTM D2896		5.4		



OIL ANALYSIS REPORT

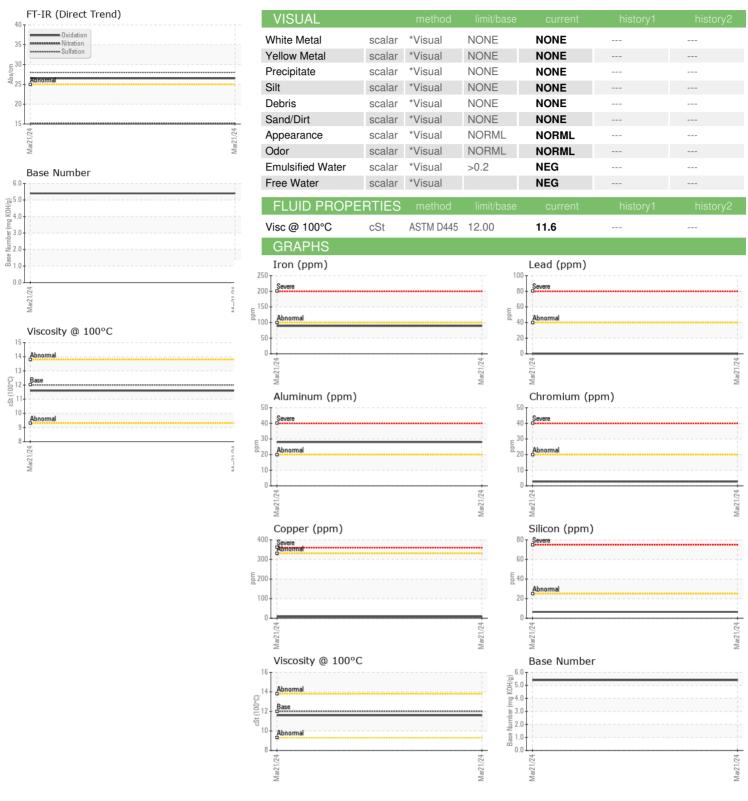





Certificate 12367

Laboratory Sample No.

Lab Number : 06148243 Unique Number : 10978321

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0118581

Received **Tested** Diagnosed

: 16 Apr 2024 - Sean Felton Test Package : MOB 1 (Additional Tests: TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

: 15 Apr 2024

: 15 Apr 2024

* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #116

1197 NORTH MAIN ROAD VINELAND, NJ

US 08360 Contact: JOHN KEEN

F: (856)696-5629

jkeen@millertransgroup.com T:

Report Id: MILVIN [WUSCAR] 06148243 (Generated: 04/16/2024 16:11:23) Rev: 1

Contact/Location: JOHN KEEN - MILVIN