

PROBLEM SUMMARY

Sample Rating Trend

SOOT


Machine Id


FREIGHTLINER 30

Diesel Engine

PETRO CANADA DURON SHP 15W40 (13 LTR)

COMPONENT CONDITION SUMMARY

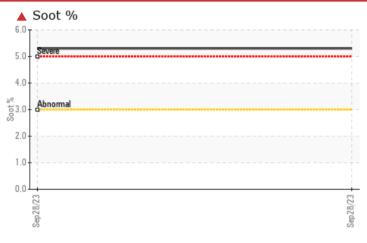

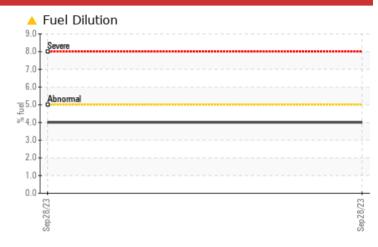

RECOMMENDATION

We advise that you check for faulty combustion, plugged air filters, or aftercoolers. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition. NOTE: High solids (carbon/soot) in the sample have limited the accuracy of Infra-Red data including Total Base Number (TBN) value.

PROBLEMATI	C TEST	RESULT	S		
Sample Status				SEVERE	
Fuel	%	ASTM D3524	>5	4.0	
Soot %	%	*ASTM D7844	>3	▲ 5.3	
Base Number (BN)	ma KOH/a	ASTM D2896	9.8	A 0.0	

Customer Id: ATRPIN Sample No.: PCA0102593 Lab Number: 06188602 Test Package: FLEET

To manage this report scan the QR code

To discuss the diagnosis or test data:

Don Baldridge +1 don.b505@comcast.net

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com


RECOMMENDED ACTIONS						
Action	Status	Date	Done By	Description		
Change Fluid			?	Oil and filter change at the time of sampling has been noted.		
Change Filter			?	Oil and filter change at the time of sampling has been noted.		
Resample			?	We recommend an early resample to monitor this condition.		
Alert			?	NOTE: High solids (carbon/soot) in the sample have limited the accuracy of Infra-Red data including Total Base Number (TBN) value.		
Check Combustion			?	We advise that you check for faulty combustion, plugged air filters, or aftercoolers.		

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

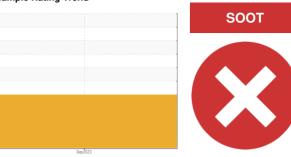

Machine Id

FREIGHTLINER 30

Diesel Engine

PETRO CANADA DURON SHP 15W40 (13 L

DIAGNOSIS

Recommendation

We advise that you check for faulty combustion, plugged air filters, or aftercoolers. Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition. NOTE: High solids (carbon/soot) in the sample have limited the accuracy of Infra-Red data including Total Base Number (TBN) value.

All component wear rates are normal.

Contamination

There is an abnormal amount of solids and carbon present in the oil. Light fuel dilution occurring.


Fluid Condition

The BN level is low.

LTR)				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0102593		
Sample Date		Client Info		28 Sep 2023		
Machine Age	mls	Client Info		577690		
Oil Age	mls	Client Info		24569		
Oil Changed		Client Info		Changed		
Sample Status				SEVERE		
CONTAMINATI	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	52		
Chromium	ppm	ASTM D5185m	>5	3		
Nickel	ppm	ASTM D5185m	>2	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>30	1		
Lead	ppm	ASTM D5185m	>30	22		
Copper	ppm	ASTM D5185m	>150	3		
Tin	ppm	ASTM D5185m	>5	2		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
ADDITIVES Boron	ppm	method ASTM D5185m	limit/base	current 7	history1	history2
	ppm ppm					
Boron	• • • • • • • • • • • • • • • • • • • •	ASTM D5185m	0	7		
Boron Barium	ppm	ASTM D5185m ASTM D5185m	0	7 0		
Boron Barium Molybdenum	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60	7 0 52		
Boron Barium Molybdenum Manganese	ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60 0	7 0 52 <1		
Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60 0 1010	7 0 52 <1 809		
Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60 0 1010 1070	7 0 52 <1 809 1151		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60 0 1010 1070 1150	7 0 52 <1 809 1151 911		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60 0 1010 1070 1150	7 0 52 <1 809 1151 911 1166		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060	7 0 52 <1 809 1151 911 1166 3088		
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060	7 0 52 <1 809 1151 911 1166 3088	 history1	 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon	ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060	7 0 52 <1 809 1151 911 1166 3088 current	 history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060 limit/base	7 0 52 <1 809 1151 911 1166 3088 current 8	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060 limit/base >20	7 0 52 <1 809 1151 911 1166 3088 current 8 0	 history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel	ppm ppm ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060 limit/base >20 >20	7 0 52 <1 809 1151 911 1166 3088 current 8 0 4 4.0	history1	history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED	ppm	ASTM D5185m	0 0 60 0 1010 1070 1150 1270 2060 limit/base >20 >5	7 0 52 <1 809 1151 911 1166 3088 current 8 0 4	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot %	ppm	ASTM D5185m	0 0 60 0 1010 1150 1270 2060 limit/base >20 >5 limit/base	7 0 52 <1 809 1151 911 1166 3088 current 8 0 4 ▲ 4.0 current \$ 5.3	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot % Nitration	ppm	ASTM D5185m ASTM D7844 *ASTM D7624 *ASTM D7624	0 0 60 0 1010 1150 1270 2060 limit/base >20 >5 limit/base	7 0 52 <1 809 1151 911 1166 3088 current 8 0 4 4.0 current 5.3 13.0	history1 history1	history2 history2
Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur CONTAMINAN Silicon Sodium Potassium Fuel INFRA-RED Soot % Nitration Sulfation	ppm	ASTM D5185m ASTM D7844 *ASTM D7624 *ASTM D7624	0 0 60 0 1010 1150 1270 2060 limit/base >20 >5 limit/base >3 >20 >3	7 0 52 <1 809 1151 911 1166 3088 current 8 0 4 △ 4.0 current ▲ 5.3 13.0 31.8	history1 history1	history2 history2



OIL ANALYSIS REPORT

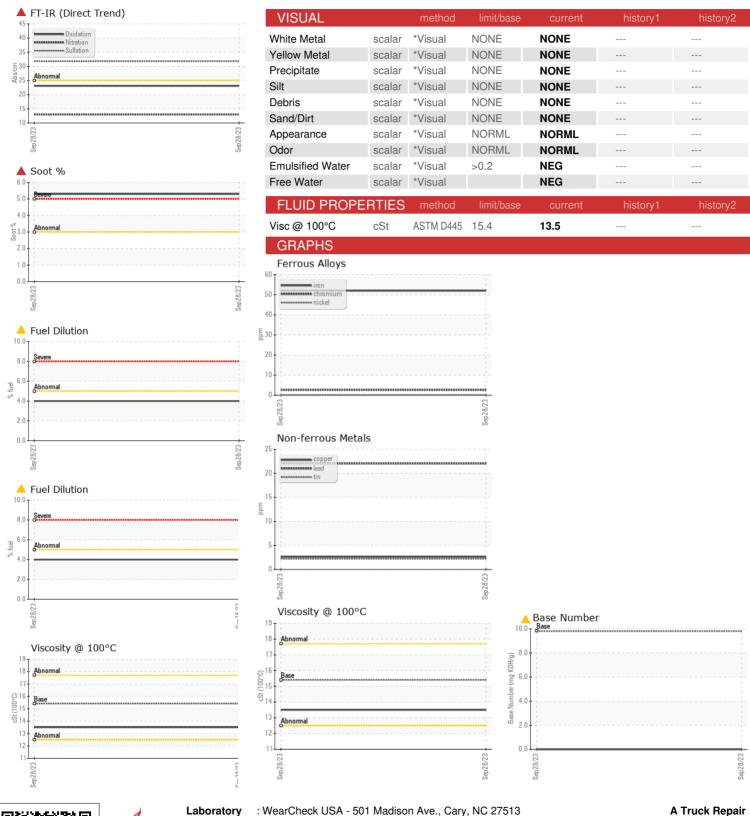



Certificate 12367

Sample No.

: PCA0102593 Lab Number : 06188602 Unique Number : 11045354

Received : 23 May 2024 **Tested**

: 28 May 2024 Diagnosed : 28 May 2024 - Don Baldridge

Test Package: FLEET (Additional Tests: FuelDilution, PercentFuel) To discuss this sample report, contact Customer Service at 1-800-237-1369.

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Contact: Vlad Melnichuk shop@migway.com T: (980)255-3200

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

9349 China Grove Church Road

Pineville, NC

US 28134