


OIL ANALYSIS REPORT

(51467Z) Walgreens - Tractor [Walgreens - Tractor] 136A63392

Diesel Engine

PETRO CANADA DURON SHP 10W30 (11 GAL)

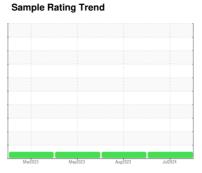



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the


Fluid Condition


The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.


GAL)		Mar202	3 May2023	Aug ² 023 Ji	12024	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0129471	PCA0093997	PCA0093874
Sample Date		Client Info		03 Jul 2024	29 Aug 2023	15 May 2023
Machine Age	mls	Client Info		229252	106014	81660
Oil Age	mls	Client Info		0	50539	0
Oil Changed		Client Info		Not Changd	N/A	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0	<1.0	<1.0
Water		WC Method	>0.2	NEG	NEG	NEG
Glycol		WC Method		NEG	NEG	NEG
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>80	17	19	32
Chromium	ppm	ASTM D5185m	>5	2	2	3
Nickel	ppm	ASTM D5185m	>2	0	0	<1
Titanium	ppm	ASTM D5185m		1	<1	3
Silver	ppm	ASTM D5185m	>3	0	0	<1
Aluminum	ppm	ASTM D5185m	>30	21	8	29
Lead	ppm	ASTM D5185m	>30	0	0	1
Copper	ppm	ASTM D5185m	>150	6	28	36
Tin	ppm	ASTM D5185m	>5	0	<1	2
Vanadium	ppm	ASTM D5185m		0	<1	0
Cadmium	ppm	ASTM D5185m		0	0	<1
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	8	4	14
Barium	ppm	ASTM D5185m	0	0	0	5
Molybdenum	ppm	ASTM D5185m	50	64	64	57
Manganese	ppm	ASTM D5185m	0	<1	<1	3
Magnesium	ppm	ASTM D5185m	950	981	1048	925
Calcium	ppm	ASTM D5185m	1050	1234	1254	1414
Phosphorus	ppm	ASTM D5185m	995	1048	1026	963
Zinc	ppm	ASTM D5185m	1180	1283	1309	1215
Sulfur	ppm	ASTM D5185m	2600	3363	3092	2704
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>20	5	4	5
Sodium	ppm	ASTM D5185m		2	1	3
Potassium	ppm	ASTM D5185m	>20	40	22	63
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.5	0.6	0.6
Nitration	Abs/cm	*ASTM D7624	>20	7.4	8.0	9.4
Sulfation	Abs/.1mm	*ASTM D7415	>30	19.3	19.9	21.8
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	14.9	16.7	19.8
Base Number (BN)	mg KOH/g	ASTM D2896		7.8	7.5	7.7




OIL ANALYSIS REPORT

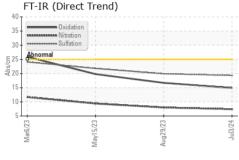

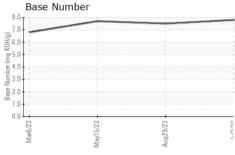


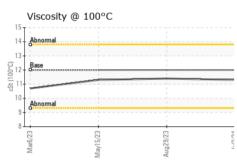


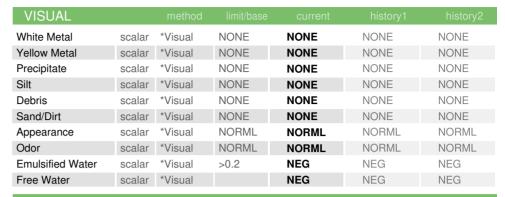



FLUID PROP	ERHES	method			history1	history2
Visc @ 100°C	cSt	ASTM D445	12.00	11.3	11.4	11.3

GRAPHS

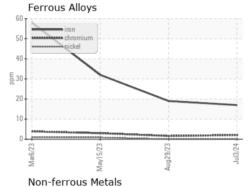

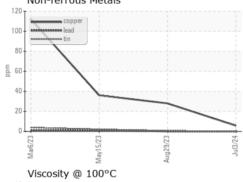

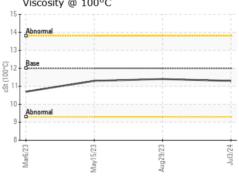

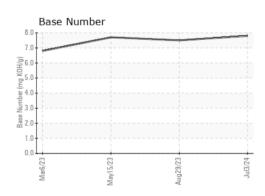





Certificate 12367

Sample No.

Laboratory : WearCheck USA - 501 Madison Ave., Cary, NC 27513 Lab Number : 06231011 Unique Number : 11114504 Test Package : FLEET

: PCA0129471

Received : 08 Jul 2024 **Tested** : 10 Jul 2024 Diagnosed

: 10 Jul 2024 - Wes Davis

Transervice - Shop 1372 - Berkeley-Moreno Valley

17500 Perris Blvd. Moreno Valley, CA US 92551

Contact: Ryan Cruz rcruz@transervice.com

T: (951)924-7131

F: (951)924-7151

To discuss this sample report, contact Customer Service at 1-800-237-1369. st - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Report Id: TSV1372 [WUSCAR] 06231011 (Generated: 07/10/2024 00:44:13) Rev: 1

Submitted By: Ryan Cruz