CONSTRUCTION EQUIPMENT 387808 VOLVO L60H 621601 - FRONT AXLE



 Sample No:
 VCP394301

 Oil Type:
 VOLVO WB 102

 Job No:
 387808

VOINTO

	INFORMATION			
				_
Sample Number		VCP394301	 	
Sample Date		11 Dec 2023	 	
Machine Hours		5863	 	
Oil Hours		0	 	
Oil Changed		Not Changd	 	
Sample Status		NORMAL	 	
OIL CON	DITION			
Visc @ 40°C	cSt	41.9	 	
VISC @ 40 C	CSI	41.5		
VOLVO				
CONTAN	MINATION			
Water	%	NEG	 	
Silicon	ppm	1 4	 	
Sodium	ppm	10	 	
Potassium	ppm	0	 	
WEAR N	AFTAIS			
Iron	ppm	45	 	
Copper	ppm	□ <1	 	
Lead	ppm	0	 	
Tin	ppm	0	 	
Aluminum	ppm	1	 	
Chromium	ppm		 	
Molybdenum	ppm	0	 	
Nickel	ppm		 	
Titanium	ppm	0	 	
Silver	ppm	<1	 	
Manganese	ppm	■ <1	 	
Vanadium	ppm	0	 	
VOLVO			 	
ADDITI\	VES			
Calcium	ppm	4105	 	
Magnesium	ppm	15	 	
Zinc	ppm	1699	 	
Phosphorus	ppm	1319	 	
	PPIII			



STRONGCO EQUIPMENT (CE)

1051 Heritage Rd. Burlington, ON CA L7L 4Y1 Contact: Sue Hooton shooton@strongco.com T: (905)331-3835 F: (905)643-6077

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	VOLVO0252		
Unique No:	5696388		
Signed:	Wes Davis		
Report Date:	14 Dec 2023		

|| <1

119

ppm

ppm

Barium


Boron

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

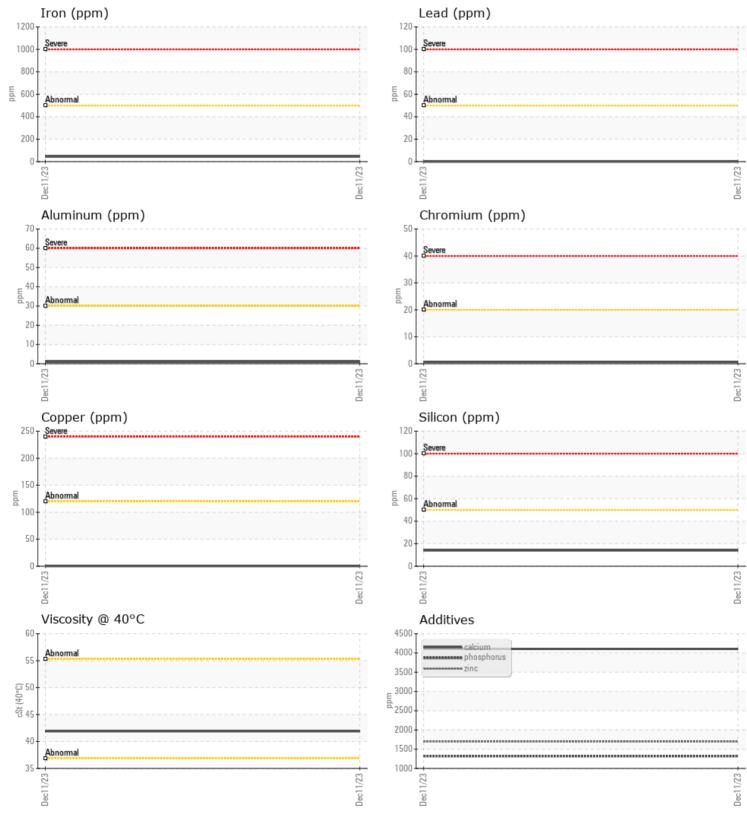

Report Id: VOLVO0252 [WCAMIS] 02603303 (Generated: 12/14/2023 16:51:48) Rev: 1

Contact/Location: Crane - Sue Hooton - VOLVO0252