


CONSTRUCTION EQUIPMENT PUMP 3 - PUMP

Sample No: VCP386722 **Oil Type:** NOT GIVEN

Job No:

	INFORMATION			
Sample Number		VCP386722	VCP386948	
Sample Date		15 Sep 2023	24 Jan 2023	
Machine Hours		0	0	
Oil Hours		0	0	
Oil Changed		N/A	N/A	
Sample Status		NORMAL	SEVERE	
		NORMAL	SEVENCE	
VOLVO				
VIL CON	DITION			
Visc @ 40°C	cSt	148	4 958	
	INATION			
Water	%		14.6	
Silicon	ppm	1 4	21	
Sodium	ppm	■ <1	0	
Potassium	ppm		12	
VOLVO				
🤍 WEAR M	IETALS			
Iron	ppm	22	5 06	
Copper	ppm	1	11	
Lead	ppm	0	<1	
Tin	ppm	0	<1	
Aluminum	ppm	0	4	
Chromium	ppm	□ <1	6	
Molybdenum	ppm	<1	<1	
Nickel	ppm	0	<1	
Titanium	ppm	<1	<1	
Silver	ppm	0	0	
Manganese	ppm	<1	5	
Vanadium	ppm	0	0	
	1.1.			
VOLVO				
V ADDITIV	15			
Calcium	nnm	3	25	





HOLCIM US

3210 WATLING ST EAST CHICAGO, IN US 46312 Contact: LINDA FLORES LINDA.FLORES@HOLCIM.COM T: F:

Diagnosis

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.


Depot:	HOLEASIN		
Unique No:	10662640		
Signed:	Sean Felton		
Report Date:	27 Sep 2023		

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

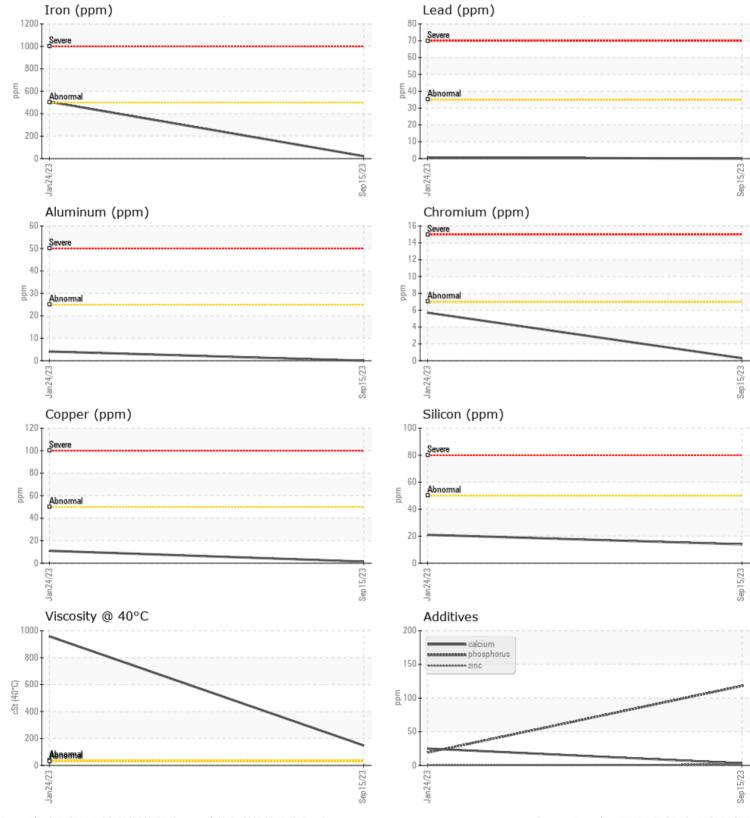

Report Id: HOLEASIN [WUSCAR] 05961427 (Generated: 10/04/2023 20:45:12) Rev: 1

Contact/Location: LINDA FLORES - HOLEASIN