
CONSTRUCTION EQUIPMENT

SW0-068517 EPIROC D60-10 TMG23SED0506 - REAR RIGHT FINAL DR

Sample No:	VCP449245
Oil Type:	NOT GIVEN
Job No:	SWO-068517

VOLVO

SAMPLE INFORMATION VCP449245 Sample Number Sample Date 27 Dec 2023 Machine Hours 263 Oil Hours 0 Oil Changed Not Changd NORMAL Sample Status **OIL CONDITION** Visc @ 40°C cSt 205 CONTAMINATION Water % NEG Silicon 15 ppm Sodium 0 🔲 ppm Potassium ppm 0 WEAR METALS Iron ppm 55 Copper ppm 0 Lead ppm 1 🔲 Tin ppm 0 🔲 Aluminum ppm 2 Chromium 1 ppm Molybdenum ppm 0 Nickel 0 ppm Titanium 0 ppm Silver 0 ppm Manganese ppm 0 Vanadium ppm 0 101 **ADDITIVES**





WHITAKER CONTRACTING

692 CONVICT CAMP RD GUNTERSVILLE, AL US 35976 Contact: BROTHER WHITAKER BrotherWhitaker@whitaker-contracting.com T: (256)298-3905 F:

Diagnosis

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

 Depot:
 WHIGUN

 Unique No:
 10809852


 Signed:
 Jonathan Hester

 Report Date:
 04 Jan 2024

CONSTRUCTION EQUIPMENT



VOLVO

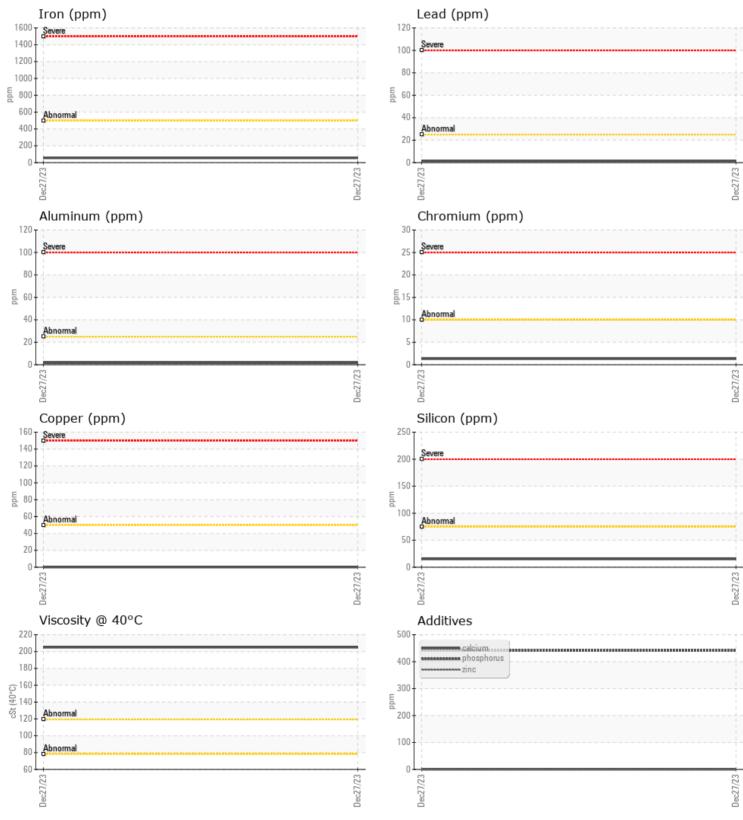

Report Id: WHIGUN [WUSCAR] 06049244 (Generated: 01/04/2024 09:10:54) Rev: 1

Contact/Location: BROTHER WHITAKER - WHIGUN