

# CONSTRUCTION EQUIPMENT VOLVO A40G 352780 - HYDRAULIC SYSTEM



Sample No: VCP445654

Oil Type: VOLVO SUPER HYDRAULIC OIL 46

Job No:

VOLVO				
SAMPLE II	NFORMATION			
Sample Number	-	VCP445654	 	
Sample Date		19 Mar 2024	 	
Machine Hours		4328	 	
Oil Hours		0	 	
Oil Changed		Changed	 	
Sample Status		ABNORMAL	 	
		7121101111111		
VOLVO	TION			
OIL CONDI	TIUN			
Visc @ 40°C	cSt	<b>47.3</b>	 	
Acid Number (AN)	mg KOH/g	<b>0.62</b>	 	
CONTAMIN	NATION			
Water	%	NEG	 	
Silicon	ppm	<b>■ 12</b>		
Sodium	ppm	<b>1</b>	 	
Potassium	ppm	<b>■</b> 0	 	
VOLVO				
WEAR ME	TALS			
Iron	ppm	■4	 	
Copper	ppm	<b>1</b>	 	
Lead	ppm	<b>2</b>	 	
Tin	ppm	■0	 	
Aluminum	ppm	<b>1</b> 5	 	
Chromium	ppm	■0	 	
Molybdenum	ppm	■0	 	
Nickel	ppm	■0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	■0	 	
Vanadium	ppm	0	 	
		-		
VOLVO				
ADDITIVE	7			
Calcium	ppm	619	 	
Magnesium	ppm	<b>■</b> 3	 	
Zinc	ppm	<b>■</b> 555	 	
Phosphorus	ppm	<b>464</b>	 	
Barium	ppm	<b>■</b> 0	 	
Boron	ppm	■0	 	



### **ALTA EQUIPMENT COMPANY**

5151 DR MARTIN LUTHER KING BLVD FORT MYERS, FL US 33905 Contact: TODD LARK tlark@altaequipfl.com

F: (239)481-3302

## Diagnosis

No corrective action is recommended at this time. Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. We were unable to perform a particle count due to a high concentration of particles present in this sample. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


Depot:VOLVO0090Unique No:10941853Signed:Don BaldridgeReport Date:27 Mar 2024




## **CONSTRUCTION EQUIPMENT**






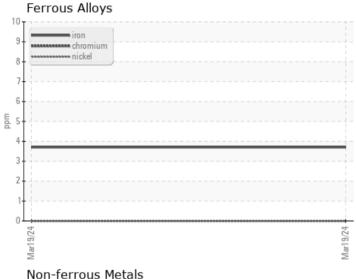

## Non-ferrous Metals

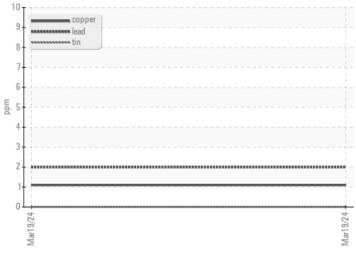

## Viscosity @ 40°C

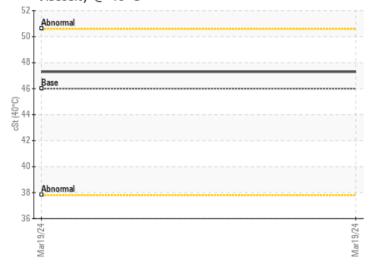

## Acid Number

