CONSTRUCTION EQUIPMENT X18706 VOLVO A40G 353135 - TRANSMISSION (AUTO)



Sample No: VCP433028

VOLVO

Job No:

Boron

X18706

	E INFORMATION			
Sample Number		VCP433028	 	
Sample Date		17 Jun 2024	 	 APAC BENTON
Machine Hours		4110	 	 393 OREILLY RD
Oil Hours		0	 	 BENTON, MS
Oil Changed		Changed	 	 US 39039
Sample Status		NORMAL	 	 Contact: WILL RAT
				will.ratliffjr@apac.
	NDITION			T: (601)397-3696
			 -	 F:
Visc @ 40°C	cSt	28.4	 	
VOLVO				Diagnosis
CONTA	MINATION			Resample at the
Water	%	NEG	 	 to monitor.All co
Silicon	ppm	8	 	 are normal. There
Sodium	ppm	4	 	 any contaminatio
Potassium	ppm	2	 	 condition of the
				the time in servic
WEAR	METALS			
		- 27		
Iron	ppm	37	 	
Copper Lead	ppm	1 2	 	
Tin	ppm	□ <1 □ 2	 	
Aluminum	ppm	16	 	
Chromium	ppm	■ 10 ■ <1	 	
Molybdenum	ppm	■<1	 	
Nickel	ppm	1	 	
Titanium	ppm ppm	<1	 	
Silver	ppm		 	
Manganese	ppm	1	 	
Vanadium	ppm	0	 	
Vanadam	ppin	Ū		
VOLVO	WEC			
ADDITI	INF2			
Calcium	ppm	76	 	
Magnesium	ppm	1	 	
Zinc	ppm	6	 	
Phosphorus	ppm	214	 	
Barium	ppm	0	 	

ATLIFF c.com

e next service interval omponent wear rates re is no indication of ion in the oil. The oil is acceptable for ice.

Depot: APABEN Unique No: 11100886 Signed: Don Baldridge Report Date: 29 Jun 2024 Contact/Location: WILL RATLIFF - APABEN

79


ppm

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

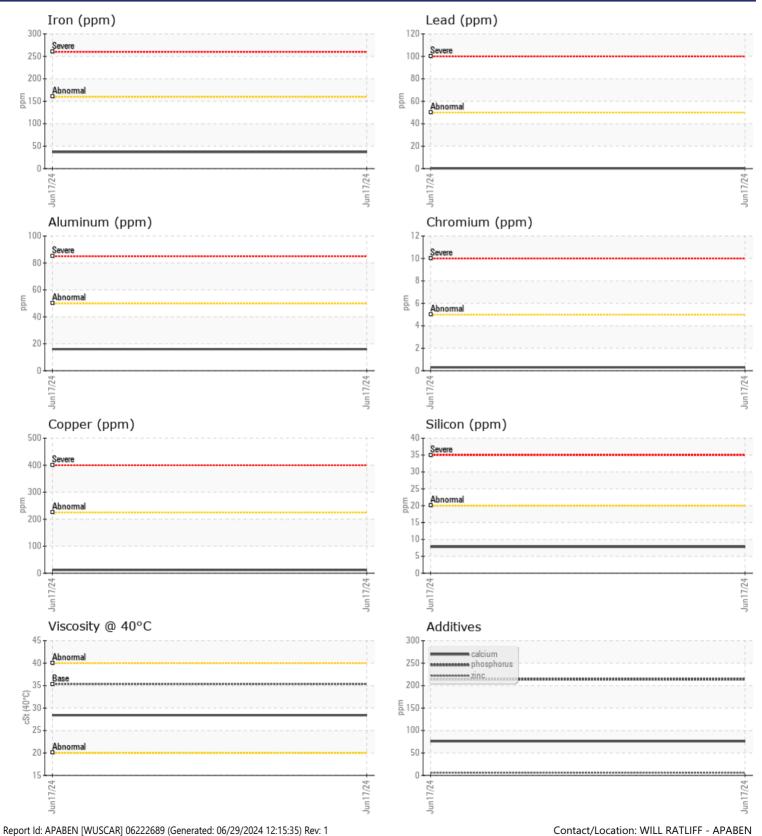

Page 2 of 2